

AMERICAN
ENGINEERS & SURVEYORS
INSTRUMENTS.

A

MANUAL

OF THE PRINCIPAL

INSTRUMENTS

USED IN

AMERICAN ENGINEERING AND SURVEYING.

MANUFACTURED BY

W. & L. E. GURLEY,

TROY, N. Y.

~~~~~  
FOURTEENTH EDITION—REVISED.  
~~~~~

TROY, N. Y.:

PUBLISHED BY W. & L. E. GURLEY.

1868.

Entered according to Act of Congress, in the year 1862,
BY W. & L. E. GURLEY,
in the Clerk's Office of the District Court for the Northern District of
New York.

C. VAN BENTHUYSEN & SONS,
Printers, Stereotypers and Binders,
405 Broadway, Albany.

PRICE LIST,

Troy, Jan. 1st, 1868.



All prices in this work are in U. S. currency.

Compasses.

Plain, with Jacob Staff mountings, 4 inch needle	\$30 00
do do do 5 do	35 00
do do do 6 do	40 00
Vernier, do do 4 do	40 00
do do do 5 do	45 00
do do do 6 do	50 00
Railroad, do do single vernier to limb, 5 inch needle.....	65 00
do do do do do 5½	70 00
do do do double do 5½	80 00

Extras.

Compass tripod, with cherry legs.....	\$8 00
do do leveling screws and clamp and tangent movements.....	18 00
do mountings without legs	7 00
Compound tangent ball.....	7 00
Jacob Staff mountings, brass head	2 50
do do steel point.....	0 60
Brass cover for compass glass	1 00
Outkeeper for keeping tally.....	1 00

Transits.

Vernier, plain telescope,* 4 inch needle, with compass tripod	\$75 00
do do 5 do do do	80 00
do do 6 do do do	85 00
Surveyors' do 4 inch single vernier to limb, adjusting tripod	135 00
do do 5 do do do do	140 00
do do 5½ do do do do	140 00
do do 4 inch double vernier to limb, do	160 00
do do 5 do do do do	165 00
do do 5½ do do do do	165 00
Engineers' do 4 inch double vernier to limb.....	175 00
do do 5 do do do do	180 00
do do 5 inch, with watch telescope.....	220 00
do do 5 inch, with theodolite axis.....	220 00

* A "plain" telescope is one without any of the attachments or extras, as we term them, such as the clamp and tangent, vertical circle and level.

PRICE LIST.

Extras to Transits.

Vertical circle, 3½ inch diameter, vernier reading to five minutes.....	\$8 00
do 4½ do do do single do	14 00
Clamp and tangent movement to axis of telescope.....	7 00
Level on telescope, with ground bubble and scale.....	14 00
Rack and pinion movement to eye glass.....	5 00
Sights on telescope, with folding joints.....	8 00
Sights on standards at right angles to telescope.....	8 00

Solar Compasses.

Solar compass, with adjusting sockets and tripod.....	\$210 00
Solar telescope compass, with adjusting socket and leveling tripod.....	235 00
Micrometer telescope, 16 to 20 inches long, with rack movement to object glass, and with movable clips to attach the sights to No. 1.....	25 00

Leveling Rods, &c.

Yankee or Boston.....	\$16 00
New York, with improved mountings	16 00
Mountings for New York rod, target.....	5 50
do do do clamp	2 50

Leveling Instruments.

Sixteen inch telescope, with adjusting tripod.....	\$135 00
Eighteen do do do do	135 00
Twenty do do do do	135 00
Twenty-two inch telescope do do	135 00
Builders' level, with adjusting tripod	60 00
do with leveling socket and tripod.....	55 00

Chains.

100 feet, with oval rings, No. 5 refined iron wire.....	\$12 00
do do do 6 do do	9 00
50 feet, do do 5 do do	6 50
50 feet, do do 6 do do	5 00
66 feet, do do 8 do do	4 75
33 feet, do do 8 do do	2 75
66 feet, do do 10 do do	4 00
33 feet, do do 10 do do	2 50
100 feet, do do 8 best steel wire	12 00
100 feet, do do 10 do do	10 50
50 feet, do do 8 do do	6 50
50 feet, do do 10 do do	5 75
66 feet, do do 8 do do	10 50
66 feet, do do 10 do do	8 00
33 feet, do do 8 do do	5 75
33 feet, do do 10 do do	4 50

PRICE LIST.

100 feet,	brazed links and rings,	No. 12 best steel wire,	tempered		\$15 00
50 feet,	do	do	12	do	8 00
66 feet,	do	do	12	do	14 00
33 feet,	do	do	12	do	7 00

Marking Pins.

Set of 11 pins,	iron wire,	No. 4			\$1 50
do	do	steel wire,	No. 6		2 00
do	do	brass wire,	No. 4		3 00

Measuring Tapes.

Chesterman's steel,	33 feet				\$9 00
do	do	50 feet			12 50
do	do	66 feet			15 50
do	do	100 feet			22 00
do	metallic,	33 feet			3 25
do	do	50 feet			4 25
do	do	66 feet			4 75
do	do	70 feet			5 25
do	do	80 feet			6 00
do	do	100 feet			6 75

Pocket Compasses.

With folding sights,	2½ inch needle,	very serviceable for tracing lines once surveyed			\$9 00
With folding sights,	2½ inch needle,	with Jacob staff mountings			11 50
do	do	do	3½	do	13 50
do	do	do	3½	do	15 00
do	do	do	3½	do	11 00
Vernier pocket compass,	with staff mountings,	two levels,	and 3½ inch needle		18 00
Pocket compasses without sights				see Supplement.	
Miners' compass, or Dipping needle, for tracing iron ore, a new and beautiful article, glass on both sides					10 00
Miners' compass, or Dipping needle, with stop to needle					12 00

Drawing Instruments.

French and German					see Supplement, &c.
Swiss					do
Drawing, profile, and cross-section paper					do
Colors, pencils, ink, brushes, &c.					do
Books on engineering and surveying					do
Telescopes, microscopes, opera glasses, &c.					do

All prices are in currency.

Information to Purchasers.

INSTRUMENTS WANTED.—In regard to the best kind of instruments for particular purposes, we would here say, that where only common surveying, or the bearing of lines in the surveys for county maps is required, a plain compass is all that is necessary. In cases where the variation of the needle is to be allowed, as in retracing the lines of an old survey, &c., the vernier compass or the vernier transit is required.

Where, in addition to the variation of the needle, horizontal angles are to be taken, and in cases of local attraction, the railroad compass is preferable; and for a mixed practice of surveying and engineering, we consider the surveyor's transit superior to any instrument made by us or any other manufacturers.

In the surveys of U. S. public lands, the county and township lines are required to be run by such instruments as the solar compass.

Where engineering is the exclusive design, the engineer's transit and the leveling instrument are of course indispensable.

The builders' level is intended for laying out mill seats and determining the levels of buildings in course of erection.

WARRANTY.—All our instruments are examined and tested by us in person, and are sent to the purchaser adjusted and ready for immediate use.

They are warranted correct in all their parts—we agreeing in the event of any defect appearing after reasonable use, to repair or replace with a new and perfect instrument, promptly and at our own cost, express charges included, or we will refund the money and the express charges paid by the customer.

Instances may sometimes occur, in a business as large and widely extended as ours, where, owing to careless transportation, or to defects escaping the closest scrutiny of the maker, instruments may reach our customers in bad condition. We consider the retention of such instruments in all cases an injury very much greater to us than to the purchaser himself.

TRIAL OF INSTRUMENTS.—It may often happen that this statement of the prices and quality of our instruments may come into the hands of those who are entirely unacquainted with us, or with the quality of our work, and who therefore feel unwilling to make a final purchase of an article, of the excellence of which they are not perfectly assured.

To such we make the following proposition: We will send the instrument to the express station nearest the person giving the order, and direct the express agent, on delivery of the same, to collect our bill, together with charges of transportation, and hold the money on deposit until the purchaser shall have had, say two weeks, actual trial of its quality.

If not found as represented, he may return the instrument before the expiration of that time, and receive the money paid, in full, including express charges, and direct the instrument to be returned to us.

EXTENT OF OUR BUSINESS.—The manufacture of surveying instruments has been conducted by us nearly twenty-five years, and thousands of our instruments have been distributed to customers in all parts of the United States and Canadas; in Cuba, South America and the Sandwich Islands.

Our facilities for manufacturing, which for many years have been far superior to those of any other similar establishment, we have now (1868) greatly increased by the introduction of new machinery and tools of the most improved construction. Our manufactory has been re-built of nearly three times its former size, and we are better prepared than ever before to fill orders for any of our instruments with promptness and satisfaction.

LOW PRICES OF OUR INSTRUMENTS.—It is often urged by other makers, and persons prejudiced in their favor, that it is impossible to make first rate instruments at the prices charged by us, and which are so very far below those of other skillful manufacturers.

We have only to reply, in addition to what we have stated in our warranty, that a visit to our works, and a comparison of our facilities, with those of our competitors, would dispel all questions as to our ability to surpass them, not only in the cheapness, but also in the superior quality of our work.

PACKING, &c.—Each instrument is packed in a well finished mahogany case, furnished with lock and key and brass hooks, the larger ones having besides these, a leather strap for convenience in carrying. Each case is provided with screw drivers, adjusting pin, and wrench for centre pin, and, if accompanied by a tripod, with a brass plumb-bob; with all instruments for taking angles, without the needle, a reading microscope is also furnished.

Unless the purchaser is already supplied, each instrument is accompanied by our "Manual," giving full instructions for such adjustments and repairs as are possible to one not provided with the facilities of an instrument maker.

When sent to the purchaser, the mahogany cases are carefully enclosed in outside packing boxes, of pine, made a little larger on all sides to allow the introduction of elastic material, and so effectually are our instruments protected by these precautions, that of several thousand sent out by us during the last twenty years, in all seasons, by every mode of transportation, and to all parts of the Union and the Canadas, not more than three or four have sustained any serious injury.

MEANS OF TRANSPORTATION.—Instruments can be sent by express to almost every town in the United States and Canadas, regular agents being located at all the more important points, by whom they are forwarded to smaller places by stage. The charges of transportation from Troy to the purchaser are in all cases to be borne by him, we guaranteeing the safe arrival of our instruments to the extent of express transportation, and holding the express companies responsible to us for all losses or damages on the way.

FINISH OF INSTRUMENTS.—Customers ordering instruments, will do us a favor by mentioning whether they prefer them of bright, or bronze finish, the cost being the same in either case.

If no direction is given, we usually send instruments finished bright.

TERMS OF PAYMENT are uniformly cash, and we have but one price, whether ordered in person or by mail. Our terms are as low as we think instruments of equal quality can be made, and will not be varied from the list given on the previous pages.

Remittances may be made by a draft, payable to our order at Troy, Albany, New York, Boston or Philadelphia, which can be procured from banks or bankers in almost all the larger villages, or by post office money order.

These may be sent by mail with the order for the instrument, and if lost or stolen on the route, can be replaced by a duplicate draft, obtained as before, and without additional cost.

The customer may also send the money in advance through the express agent, or as is most common, may pay the agent on receipt of the instrument in funds current in New York or Boston.

The cost of returning the money on bills collected by express of amounts under \$20, will be charged to the customer.

REPAIR OF INSTRUMENTS.

Hundreds of instruments of our own and others' make, come to us every year for refitting and repairs, and so much correspondence arises therefrom, that we are led to believe that a brief statement in this place, of the cost of such repairs, &c., will be of service to our customers and ourselves.

Most instruments sent to us for repairs are injured by falls; many are worn and defective in parts after long use; and others are sent for repolishing and renovation.

We advise our customers having instruments in need of repairs, &c., to send them immediately to us, as our facilities enable us to do the work much more economically and promptly than any other maker however accessible.

They should always, when practicable, be placed in their own boxes, and these inclosed in an outside packing case, an inch larger in all its dimensions, that the interval between the two may be filled with paper wadding, hay or fine shavings.

A note specifying the repairs needed, should accompany the instrument, and a letter should also be sent by mail to us, giving not only directions as to the repairs, but also stating when the return of the instrument is required, and the precise location to which it should be forwarded. It should also be remembered that each instrument is made to fit its own spindle and no other; and therefore this part with the parallel plates and leveling screws, if it has any, should always be sent with it.

The legs and brass head in which they are inserted need never be sent, unless themselves in need of repairs.

COMPASSES.—These come to us with the plates sprung, the sights bent or broken, the glass or level vials fractured, and the pivot so dulled as to render the needle sluggish and unreliable. The cost of repairing the defects above named, ranges from 2 to 8 or 10 dollars. A new pair of sights fitted costs 5 dollars; a new needle, with jeweled centre and pivot complete, \$2.50; a new jeweled centre, \$1.50.

The compass should always be accompanied by the ball spindle, and if a new ball spindle is required, the whole instrument, or at least the socket in which the spindle fits, should be sent with the letter of advice to us; a new ball spindle costs two dollars.

TRANSIT INSTRUMENTS.—The repairs of the Vernier Transits cost about the same as those of the compasses above stated.

The injuries sustained by the falls of Engineers' and Surveyors' Transits are usually much more serious; in these the plates, standards and cross-

bar of telescope are often bent, and the sockets or centres usually so de-
ranged as to be entirely useless.

The cost of repairing an instrument with such injuries, ranges from 10
to 30 or even 50 dollars, the new sockets alone costing from 10 to 20 dollars.

LEVELING INSTRUMENTS are generally much less injured by falling than
Transits, the damages being included usually in the bending of the cross-
bar, the springing of the sockets, and the breaking of the level vial.

The cost of repairs varies from 5 to 15 dollars; a new level vial set in the
tube costs two dollars.

RE-POLISHING INSTRUMENTS.—The cost of re-polishing an instrument,
involving also of course its complete renovation and adjustment, varies with
the different kinds, but may be stated generally as follows:

Compasses, from.....	\$5 to \$8
Transits do	10 to 16
Levels do	10 to 13

No additional charge is made for bronzing or blackening an instrument
when re-polished.

PAYMENT OF REPAIRS, &c., may be made at the express office where
the instrument is received, the customer paying for the first transportation
of the instruments to us or not as he may prefer. Whenever the freight is
paid in advance, the express receipt should be mailed immediately to us.

W. & L. E. GURLEY,

Mathematical Instrument Makers,

FULTON ST., OPPOSITE NORTH END OF UNION R. R. DEPOT, TROY, N. Y.

Preface to the Eleventh Edition.

We herewith present the Engineers and Surveyors of the Union, this new edition of our little work, materially enlarged, and, as we trust, improved.

We are now (January, 1868), much better furnished with facilities of all kinds to prosecute with enlarged success the business to which we have devoted over twenty-five years.

It is with the hope, therefore, that we shall still further enlarge the list of our many patrons and friends in this and in other countries, and that this description of our instruments may be of increasing service to the Surveyor and Engineer, that we now commit it to their indulgence.

W. & L. E. GURLEY.

TROY, *January*, 1868.

Surveying Instruments.

THE various instruments used in Surveying may be conveniently arranged, into two general divisions.

(1.) NEEDLE instruments,—or such as owe their accuracy and value to the magnetic needle only, embracing the Plain and Vernier compasses, and the Vernier Transit.

(2.) ANGULAR instruments, including those in which the horizontal angles, are measured by a divided circle and verniers, as well as by the needle also; as the Railroad Compass, the Surveyors' and Engineers' Transits, &c.

In the present work we shall consider first, those instruments comprised in the first division, and, as in these the accuracy of the horizontal angles indicated, depends upon the delicacy of the needle, and the constancy with which it assumes a certain direction, termed the "magnetic meridian," we shall here remark briefly upon the *form*, the *length*, and the *movement* of

THE MAGNETIC NEEDLE.—The *forms* of the needle are almost infinitely varied, according to the taste or fancy of the maker or surveyor, but may be resolved into two general classes, one having the greatest breadth in a horizontal, the other in a vertical direction.

We have usually made our needles about one-twentieth of an inch broad and one-third as thick, parallel from end to end, the north and south poles being distinguished from each other, by a small scollop on the north end.

Of course the form of the needle is always varied according to the choice of our customers, and without additional charge.

The *length* of the needle varies in different instruments, from four to six or even seven inches, those of five and a half, or six inches long, being generally preferred by surveyors.

The *movement* of the needle, with the least possible friction, is secured by suspending it, by a steel or jewel centre, upon

a hardened steel pivot, the point of which is made perfectly sharp and smooth.


The test of the delicacy of a magnetic needle is the number of horizontal vibrations, which it will make in a certain arc, before coming to rest—besides this most surveyors prefer also to see a sort of quivering motion in a vertical direction.

This quality, which is manifested more in a horizontal, than in a vertical needle, and depends upon the near coincidence of the point of suspension with the centre of gravity of the needle, serves to show merely that the cap below is unobstructed.

Having now considered the different qualities of a good needle, we shall proceed to speak of those instruments of which it makes so important a part; of these, the most simple is that termed the

PLAIN COMPASS.

Fig. 1.

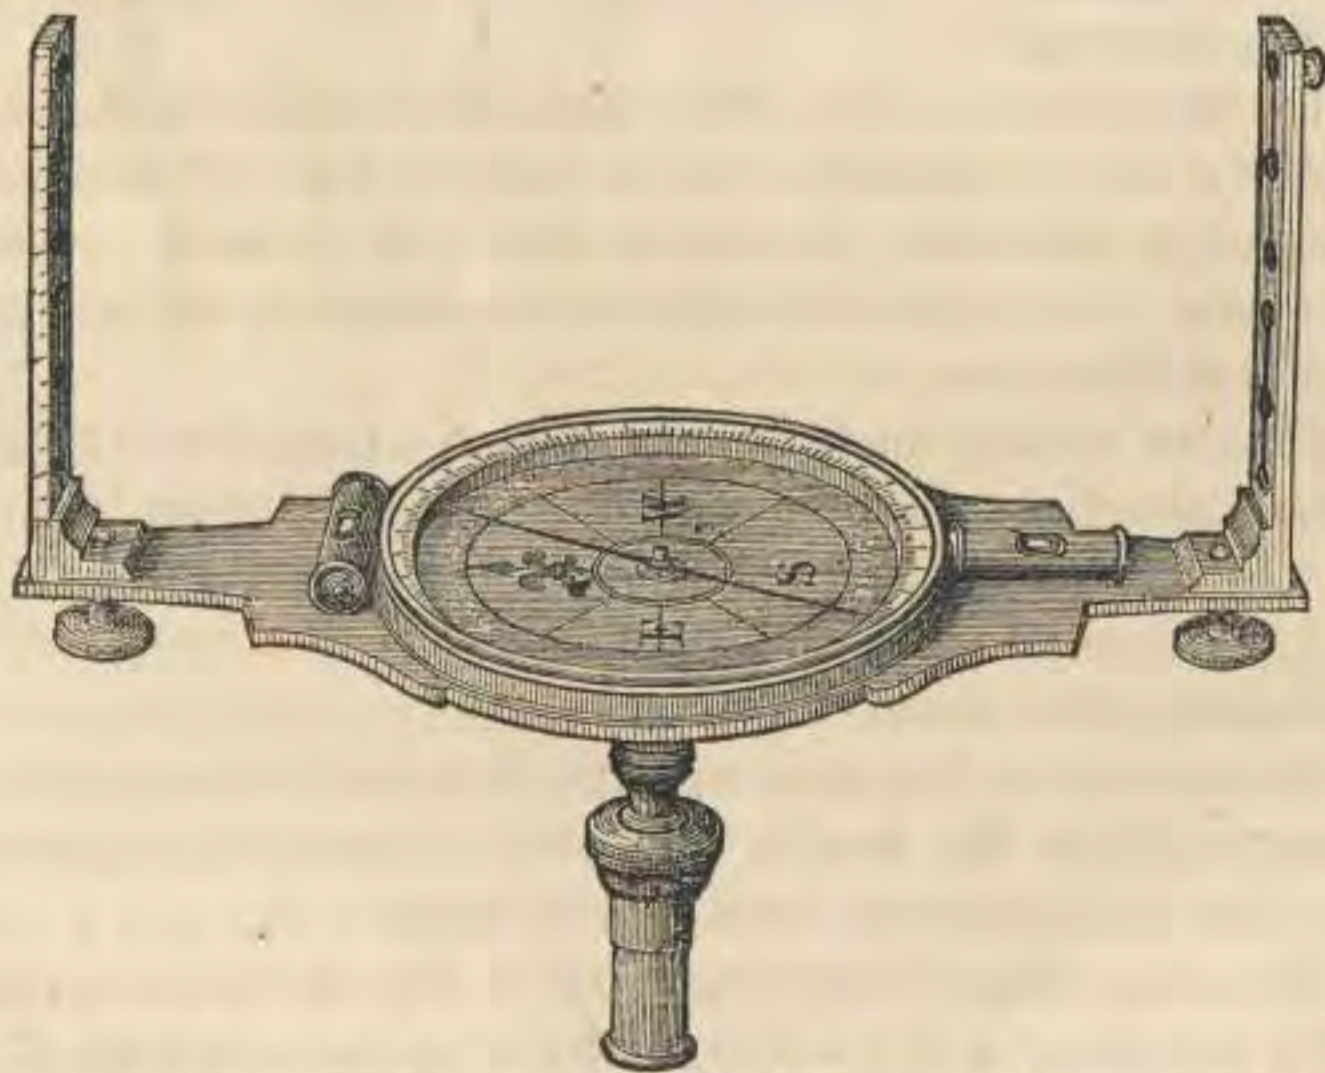

As represented above, the Plain Compass has a needle six

inches long, a graduated circle, main plate, levels and sights, and is placed upon the brass head of the "Jacob staff."

THE COMPASS CIRCLE in this, as in all our instruments, is divided to half degrees on its upper surface, the whole degree marks being also cut down on the inside circumference, and is figured from 0 to 90, on each side of the centre or "line of zeros."

The circle and face of the compass are silvered.

THE SPIRIT LEVELS are placed at right angles to each other so as to level the plate in all directions, and are balanced upon a pivot underneath the middle of the tube, so as to be adjustable by a common screw-driver.

THE SIGHTS, or standards, have fine slits cut through nearly their whole length, terminated at intervals by large circular apertures, through which the object sighted upon is more readily found. Sometimes a fine horse-hair or wire is substituted for one half the slit, and placed alternately with it on opposite sights.

TANGENT SCALE.—The right and left hand edges of the sights of our compasses, have respectively an eye-piece, and a series of divisions, by which angles of elevation and depression, for a range of about twenty degrees each way, can be taken with considerable accuracy.

Such an arrangement is very properly termed a "tangent scale," the divided edges of the north sight, being tangents to segments of circles having their centres at the eye-pieces, and their points of contact with the tangent lines at the zero divisions of the scale.

The cut shows the eye-piece and divisions for angles of depression; those for angles of elevation, concealed in this cut, are seen in that of the Railroad Compass.

THE JACOB STAFF mountings which are furnished with all our compasses, and packed in the same case, consist of the

brass head already mentioned, and an iron ferule or shoe, pointed with steel, so as to be set firmly in the ground.

The staff, to which the mountings should be securely fastened, is procured from any wheelwright, or selected by the surveyor himself from a sapling of the forest.

To adjust the Compass.

THE LEVELS.—First bring the bubbles into the centre, by the pressure of the hand on different parts of the plate, and then turn the compass half way around; should the bubbles run to the end of the tubes, it would indicate that those ends were the highest; lower them by tightening the screws immediately under, and loosening those under the lowest ends until, by estimation, the error is half removed; level the plate again, and repeat the first operation until the bubbles will remain in the center, during an entire revolution of the compass.

THE SIGHTS may next be tested by observing through the slits a fine hair or thread, made exactly vertical by a plumb. Should the hair appear on one side of the slit, the sight must be adjusted by filing off its under surface on that side which seems the highest.

THE NEEDLE is adjusted in the following manner: Having the eye nearly in the same plane with the graduated rim of the compass circle, with a small splinter of wood or a slender iron wire, bring one end of the needle in line with any prominent division of the circle, as the zero, or ninety degree mark, and notice if the other end corresponds with the degree on the opposite side; if it does, the needle is said to "cut" opposite degrees; if not, bend the centre-pin by applying a small brass wrench, furnished with our compasses, about one eighth of an inch below the point of the pin, until the ends of the needle are brought into line with the opposite degrees.

Then holding the needle in the same position, turn the compass half way around, and note whether it now cuts opposite degrees ; if not, correct half the error by bending the needle, and the remainder by bending the centre-pin.

The operation should be repeated until perfect reversion is secured in the first position.

This being obtained, it may be tried on another quarter of the circle ; if any error is there manifested, the correction must be made in the centre-pin only, the needle being already straightened by the previous operation.

When again made to cut, it should be tried on the other quarters of the circle, and corrections made in the same manner until the error is entirely removed, and the needle will reverse in every point of the divided surface.

To use the Compass.

In using the compass the surveyor should keep the south end towards his person, and read the bearings from the north end of the needle. He will observe that the E and W letters on the face of the compass are reversed from their natural position, in order that the direction of the line of sight may be correctly read.

The compass circle being graduated to half degrees, a little practice will enable the surveyor to read the bearings to quarters, or even finer—estimating with his eye the space bisected by the point of the needle, and as this is as low as the traverse table is usually calculated, it is the general practice.

Sometimes, however, a small vernier is placed upon the south end of the needle, and reads the circle to five minutes of a degree—the circle being in that case graduated to whole degrees.

This contrivance, however, is quite objectionable on account of the additional weight imposed on the centre-pin,

and the difficulty of reading a vernier which is in constant vibration, and is therefore but little used.

TO TAKE ANGLES OF ELEVATION.—Having first leveled the compass, bring the south end towards you, and place the eye at the little button, or eye piece, on the right side of the south sight, and with the hand fix a card on the front surface of the north sight, so that its top edge will be at right angles to the divided edge, and coincide with the zero mark; then sighting over the top of the card, note upon a flagstaff the height cut by the line of sight; then move the staff up the elevation, and carry the card along the sight until the line of sight again cuts the same height on the staff, read off the degrees and half degrees passed over by the card, and we shall have the angle required.

FOR ANGLES OF DEPRESSION.—Proceed in the same manner, using the eye-piece and divisions on the opposite sides of the sights, and reading from the top of the standards.

JACOB STAFF SOCKET.—The compass is furnished with a ball spindle, or socket, upon which it turns, and by which it is levelled. The ball may be placed in a single or “jacob staff” socket, as represented in the figure, or in a compass tripod, such as is shown in the cut of the Vernier Transit beyond.

CLAMP SCREW.—In the side of the hollow cylinder, or socket of the compass, which fits to the ball spindle, is a screw by which the instrument may be clamped to the spindle in any position.

SPRING CATCH.—Besides the clamp screw, we have recently fitted to the sockets of our compasses a little spring catch, which, as soon as the instrument is set upon the spindle, slips into a groove, and thus removes all danger of falling when the instrument is carried.

NEEDLE LIFTER.—There is also underneath the main plate, a needle lifting screw which, by moving a concealed spring,

raises the needle from the pivot, and thus prevents the blunting of the point in transportation.

When the compass is not in use it is the practice of many surveyors to let down the needle upon the point of the centre-pin, and let it assume its position in the magnetic meridian, so as to retain or even increase its polarity.

We would advise in addition, that after the needle has settled it should be raised against the glass, in order not to dull the point of suspension.

OUTKEEPER.—A small dial plate, having an index turned by a milled head underneath, is often used with this and the other compasses to keep tally in chaining.

The dial is figured from 0 to 16, the index being moved one notch for every chain run.

ELECTRICITY.—A little caution is necessary in handling the compass, that the glass covering be not excited by the friction of cloth, silk, or the hand, so as to attract the needle to its under surface.

A brass cover is sometimes fitted over the glass of the compass, and serves to protect it from accident, as well as to prevent electric disturbance.

When, however, the glass becomes electric, the fluid may be removed by breathing upon it, or touching different parts of its surface with the moistened finger.

An ignorance of this apparently trifling matter has caused many errors and perplexities in the practice of the inexperienced surveyor.

Repairs of the Compass.

To enable the surveyor to make such repairs as are possible without having recourse to an instrument maker, we here add a few simple directions.

1. **THE NEEDLE.**—It may sometimes happen that the needle

inch compass is twelve and a half inches long, and in the larger sizes, fifteen and a half inches.

The six-inch needle compass is generally preferred.

Weight of the Plain Compasses.

The average weights of the different sizes, with the brass mountings of the jacob staff, are :

For the 4-inch needle, 6 lbs.

For the 5-inch needle, $7\frac{1}{2}$ lbs.

For the 6-inch needle, $8\frac{1}{2}$ lbs.

The plain compass, which was the only one in use in this country previous to the time of David Rittenhouse, has gradually given way to the superior advantages of the Vernier or Rittenhouse compass, which we shall now proceed to describe

...in the year 1780, and a full ...

...of the ...

...the ...

...the ...

...the ...

...the ...

...the ...

...the ...

...the ...

...the ...

...the ...

VERNIER COMPASS.

Made by

W. & L. E. GURLEY,

TROY, N. Y.

GAULT & CO. ALBANY, N. Y.



Surveying Instruments.

THE VERNIER COMPASS.

This instrument, represented in the engraving opposite, is in most respects like that already described, differing from it mainly in having its compass circle, to which is attached a "vernier," movable about a common centre a short distance in either direction, thus enabling the surveyor to set the zeros of the circle at any required angle with the line of sights, the number of degrees contained in this angle or the "variation of the needle" being read off by the vernier.

The movement of the circle is effected either by a slow moving or "tangent screw," as shown in the engraving, or by a concealed rack and pinion—the head of which projects from the under side of the main compass plate.

When the variation is set off as described, the circle is securely fastened in its position by a clamping nut underneath the main plate.

BALL SPINDLE.—The compass is usually fitted to a spindle made slightly conical and having on its lower end a ball turned perfectly spherical, and confined in a socket by a pressure so light that the ball can be moved in any direction in the operation of leveling the compass.

The ball is placed either in the brass head of the Jacob Staff already shown with the previous instrument, or still better, in the compass tripod seen in the engraving of the Vernier Transit beyond.

The superiority of the vernier over the plain compass con-

sists in its adaptation to the retracing the lines of an old survey, and to the surveys of the U. S. public lands, where the lines are based on a true meridian.

Variation of the Needle.

It is well known that the magnetic needle, in almost all parts of the United States, points more or less to the east or west of a true meridian, or north and south line.

This deviation, which is called the VARIATION OR DECLINATION of the needle, is not constant, but increases or decreases to a very sensible amount in a series of years.

Thus at Troy, N. Y., a line bearing in 1838, N. 31° E., would now, 1868, with the same needle, have a bearing of about N. 32° E., the needle having thus in that interval travelled a full degree to the west.

For this reason, therefore, in running over the lines of a farm from field notes of some years standing, the surveyor would be obliged to make an allowance, both perplexing and uncertain, in the bearing of every line.

To avoid this difficulty the *vernier* was devised, the arrangement of which we shall now describe.

THE VERNIER is divided on its edge to thirty equal parts, and figured in two series on each side of the centre line.

In the same plane with the vernier is an arc or limb, fixed to the main plate of the compass, and graduated to half degrees.

The surfaces of both vernier and limb are silvered.

On the vernier are thirty equal divisions, which exactly correspond in length with thirty-one of the half degrees of the limb.

Each division of the vernier is, therefore, one-thirtieth or, in other words, one minute longer than a single division of the limb.

TO READ THE VERNIER.—In "reading" the vernier, if it is

moved to the right, count the minutes from its zero point to the left, and vice versa. Proceed thus until a division on the vernier is found exactly in line with another on the limb, and the lower row of figures on the vernier will give the number of minutes passed over. When the vernier is moved more than fifteen minutes to either side the number of the additional minutes up to thirty or one-half degree of the limb is given by the upper row of figures on the opposite side of the vernier.

To read beyond thirty, add the minutes given by the vernier to that number, and the sum will be the correct reading.

In all cases when the zero point of the vernier passes a whole degree of the limb, this must be added to the minutes, in order to define the distance over which the vernier has been moved.

TO TURN OFF THE VARIATION.—It will now be seen that the surveyor having the vernier compass, can by moving the vernier to either side, and with it of course the compass circle attached, set the compass to any variation.

He therefore places his instrument on some well defined line of the old survey, and turns the tangent screw until the needle of his compass indicates the same bearing as that given in the old field notes of the original survey.

Then screwing up the clamping nut underneath the vernier, he can run all the other lines from the old field notes without further alteration.

The reading of the vernier on the limb in such a case would give the change of variation at the two different periods.

The variation of the needle at any place being known, a true meridian, or north and south line, may be run by moving the vernier to either side, as the variation is east or west, until the arc passed over on the limb is equal to the angle of variation; and then turning the compass until the needle is made to cut the zeros on the divided circle, when the line of

the sights would give the direction of the true meridian of the place.

Such a change in the position of the vernier is necessary in surveying the U. S. public lands, which are always run from the true meridian.

“THE LINE OF NO VARIATION, as it is called, or that upon which the needle will indicate a true north and south direction, is situated in the United States, nearly in an imaginary line drawn from the middle of lake Erie to Cape Hatteras, on the coast of North Carolina.

A compass needle, therefore, placed east of this line would have a variation to the west, and when placed west of the line, the variation would be to the east, and in both cases the variation would increase as the needle was carried farther from the line of no variation.

Thus in Minnesota the variation is from 15° to 16° to the east, while in Maine it is from 17° to 18° to the west.

At Troy, in the present year, 1868, the variation is about 9° to the west, and is increasing in the same direction from two to three minutes annually.

TO READ TO MINUTES.—A less important use of the vernier is to give a reading of the needle to single minutes, which is obtained as follows:

First be sure, as in all observations, that the zero of the vernier exactly corresponds with that of the limb; then noting the number of whole degrees given by the needle, move back the compass circle with the tangent screw until the nearest whole degree mark is made to coincide with the point of the needle, read the vernier as before described, and this reading added to the whole degrees will give the bearing to minutes.

To use the Vernier Compass.

Proceed in the same manner as directed in regard to the Plain Compass, when making new surveys, always taking

care that the vernier is set at zero and securely clamped by screwing up the nut beneath the plate.

In surveying old farms, allowance and correction must be made for the variation, as just described.

Sizes of the Vernier Compass.

We make three sizes of this compass, having needles of four, five and six inches long respectively, the main plates of the two largest being over fifteen inches long; and of the smallest size, thirteen inches, the sights of the last are also about an inch shorter.

In the four and five inch Vernier Compasses, the variation arc is within the compass circle like that of the railroad compass hereafter described, and the variation is set off to minutes by a pinion head underneath the plate; the circle is also clamped at any variation by a screw placed opposite the pinion.

Weight of the Vernier Compasses.

The average weights of the different sizes, including the brass head of the Jacob Staff, beginning with the smallest, are respectively $5\frac{1}{2}$, $7\frac{1}{2}$ and $9\frac{1}{2}$ pounds.

Surveying Instruments.

THE VERNIER TRANSIT.

This instrument, shown in the engraving opposite, resembles the Vernier Compass in its construction and general principles, differing from it mainly in the use of a telescope in place of the ordinary sights. The variation of the needle is set off by a pinion, as shown, and the circle clamped by a nut underneath the plate as usual.


The instrument is clamped to the spindle and secured from falling from it by the clamp screw and spring catch, seen on opposite sides of the socket in the engraving.

The Vernier Transit should always be used with the compass tripod at least, as shown in the engraving, and often, especially when furnished with the extra attachments to telescope, is placed upon the light leveling tripod, shown with the Surveyor's Transit beyond, and described in our account of that instrument.

The needle of this instrument is either four, five or six inches long, as the surveyor may prefer, the one with the six inch needle being shown in the engraving, and generally selected by our customers.

The advantages of the Vernier Transit over the ordinary compass, are due mainly to the telescope and its attachments, which we shall proceed to describe in detail.

VERNIER TRANSIT.

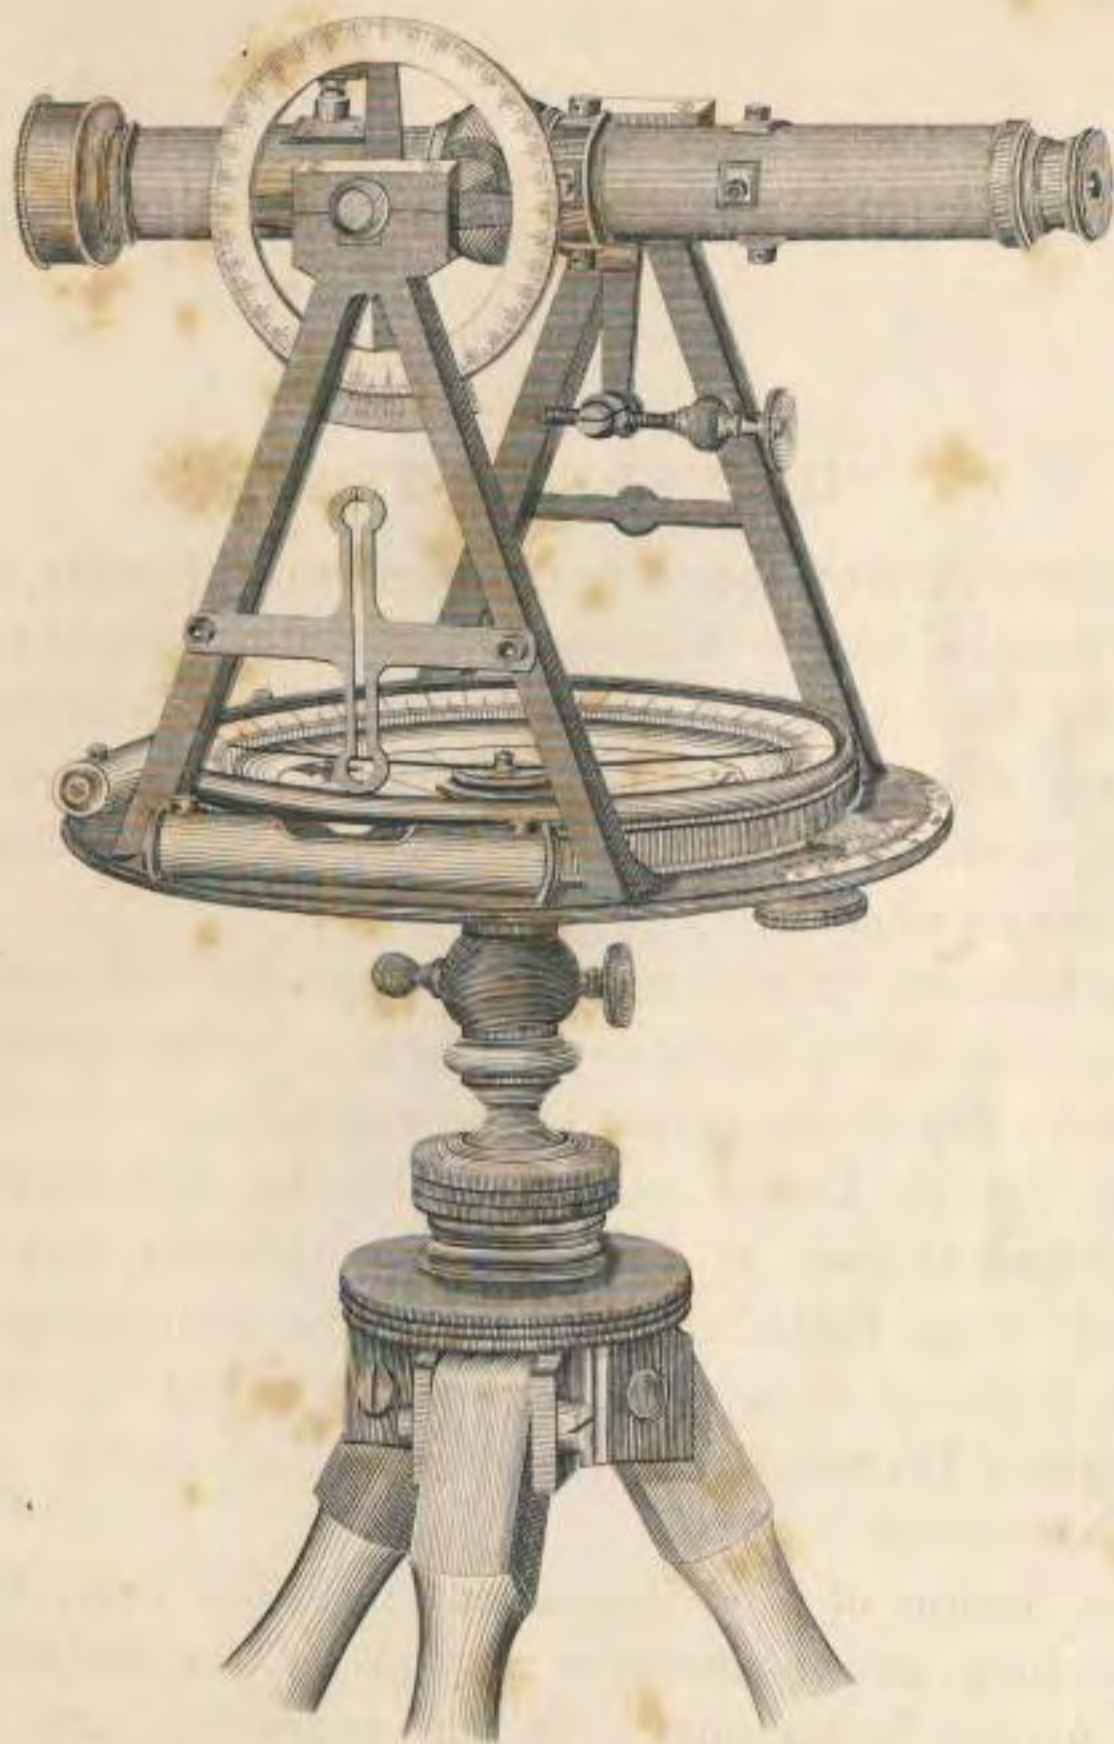

Made by

W. & L. E. GURLEY,

TROY, N. Y.



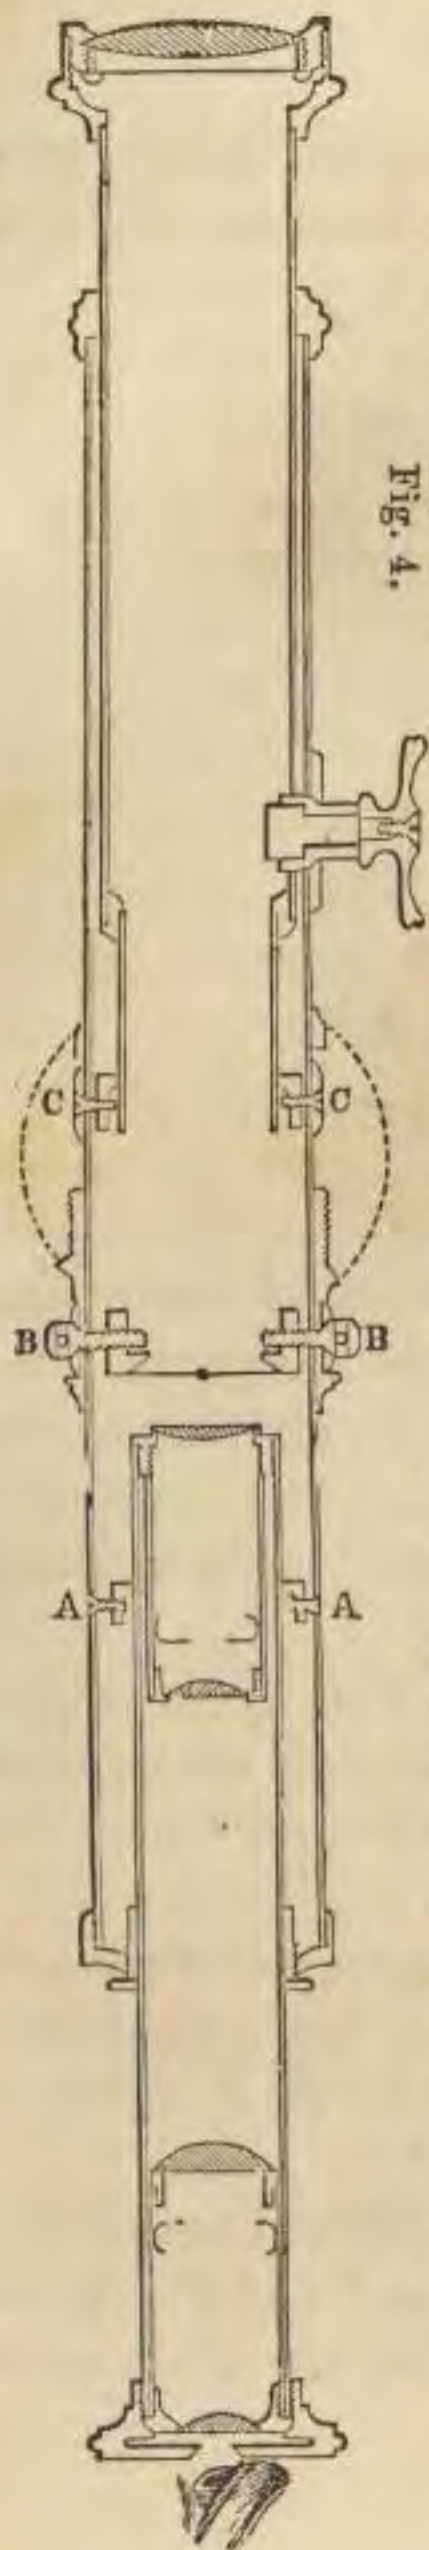


Fig. 4.

The telescope is from ten to twelve inches long, and sufficiently powerful to see and set a flag at a distance of two miles in a clear day.

The cross-bar in which it is fixed, turns readily in the standards, so that the telescope can be turned in either direction, and back and fore sights be taken without removing the instrument.

Like all telescopes used by us in our instruments, it shows objects in an erect position.

THE TELESCOPE.—The interior construction of the telescope of the Vernier Transit, which is very similar to those of the other instruments we shall describe, is well shown in the longitudinal section represented in fig. 4.

As here seen, the telescope consists essentially of an object-glass, an eye-piece tube, and a cross-wire ring or diaphragm.

The object-glass is composed of two lenses, one of flint, the other of crown glass, which are so made and disposed as to show the object seen through it without color or distortion.

The object glass and the whole telescope is therefore said to be “achromatic.”

The eye-piece is made up of four plano-convex lenses, which, beginning at the eye end, and proceeding on, are called respectively, the eye, the field, the amplifying, and the object lenses.

Together, they form a compound microscope, magnifying the minute image of any object formed at the cross-wires by the interposition of the object glass.

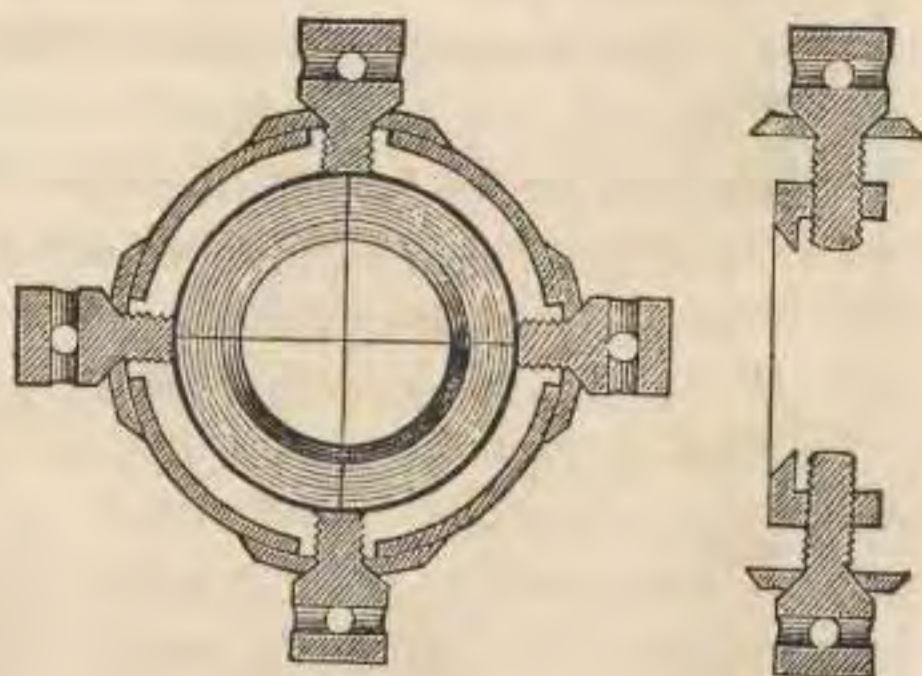


Fig. 5.

THE CROSS WIRES.—The cross-wire diaphragm, two views of which are here exhibited, is a small ring of brass, suspended in the tube of the telescope by four capstan head screws, which press upon the washers shown on the outside of the tube.

The ring can thus be moved in either direction by working the screws with an ordinary adjusting pin.

Across the flat surface of the ring two fine fibres of spider's web are extended at right angles to each other, their ends being cemented with beeswax or varnish, into fine lines cut in the metal of the ring.

The intersection of the wires forms a very minute point, which, when they are adjusted, determines the optical axis of the telescope, and enables the surveyor to fix it upon an object with the greatest precision.

The imaginary line passing through the optical axis of the telescope, is termed the "line of collimation," and the operation of bringing the intersection of the wires into the optical

axis, is called the "adjustment of the line of collimation." This will be hereafter described.

The openings in the telescope tube are made considerably larger than the screws, so that when these are loosened, the whole ring can be turned around for a short distance in either direction.

The object of this will be seen more plainly, when we describe the means by which the wire is made truly vertical.

The sectional view of the telescope (fig. 4) also shows two moveable rings, one placed at A A, the other at C C, which are respectively used, to effect the centering of the eye-piece, and the adjustment of the object-glass slide.

The centering of the eye-tube is performed after the wires have been adjusted, and is effected by moving the ring, by means of the screws, shown on the outside of the tube, until the intersection of the wires is brought into the centre of the field of view.

The adjustment of the object slide, which will be fully described in our account of the Leveling Instrument, secures the movement of the object-glass in a straight line, and thus keeps the line of collimation in adjustment through the whole range of the slide, preventing at the same time what is termed the "travelling" of the wires.

This adjustment, which is peculiar to our telescopes, is always made in the process of construction, and needing no further attention at the hands of the engineer, is concealed within the hollow ball of the telescope axis.

Optical Principles of the Telescope.


In order that the advantages gained by the use of the telescope may be more fully understood, we shall here venture briefly to consider the optical principles involved in its construction.

We are said to "see" objects because the rays of light which proceed from all their parts, after passing through the pupil of the eye, are by the crystalline lens and vitreous humor, converged to a focus on the retina, where they form a very minute inverted image; an impression of which is conveyed to the brain by the optic nerve.

The rays proceeding from the extremities of an object, and crossing at the optic center of the eye, form the "visual angle," or that under which the object is seen.

The apparent magnitude of objects depends on the size of the visual angle which they subtend, and this being great or small, as the object is near or distant—the objects will appear large or small, in an inverse proportion to the distances which separate them from the observer.

Fig. 6.

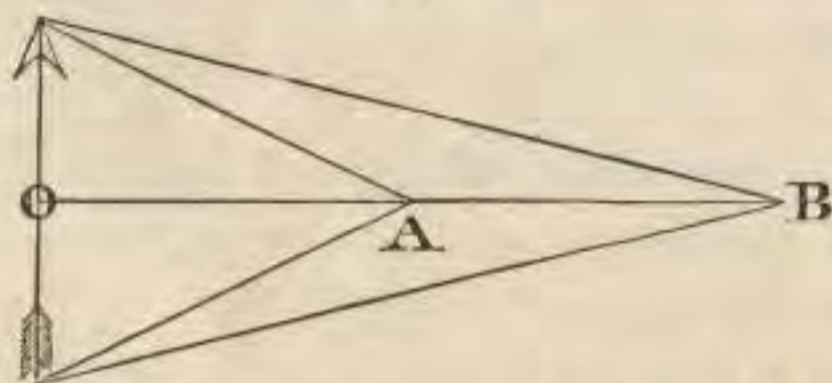

Thus, (in fig. 6,) if the distance $O A$ is one-half of $O B$, the visual angle, subtended by the object at the point A , and therefore the apparent magnitude of the object will

be twice that observed at B . If, therefore, the visual angle subtended by any object, can be made by any means twice as large, the same effect will be produced as if the observer were moved up over one half the intervening distance.

Now this is the principal advantage gained in the use of a telescope.

The object-glass receiving the rays of light which proceed from all the points of a visible object, converges them to a focus at the cross-wires, and there forms a minute, inverted, and very bright image, which may be seen by placing a piece of ground glass to receive it at that point.

The eye-piece acting as a compound microscope, magnifies



Fig. 7.

this image, restores it to its natural position, and conveys it to the eye.

The visual angle which the image there subtends, is as many times greater than that which would be formed without the use of the telescope, as the number which expresses its magnifying power.

Thus, a telescope which magnifies twenty times, increases the visual angle just as much, and therefore diminishes the apparent distance of the object twenty times—or in other words, it will show an object two hundred feet distant, with the same distinctness as if it was distant only ten feet from the naked eye.

The accompanying cut, (fig. 7) which we are kindly permitted to copy from an excellent treatise on surveying, by Prof. Gillespie of Union College, will give a correct idea of the manner in which the rays of light coming from an object are affected, by passing through the several glasses of a telescope.

We shall only consider the rays which proceed from the extremities; these, after passing through the object-glass, here shown as a single lens, are conveyed to the point B, the centre of the cross-wires and the common focus of the object and eye-glasses. At this place the rays cross each other and the image is inverted.

The rays next come to the object lens C, and passing through it are refracted so as again to cross each other, and come thus to the amplifying lens D. By this they are again refracted, made more nearly parallel, and thus reach the large field lens E. After passing through this, they

form a magnified and erect image in the focus of the eye lens G. By the eye lens the image is still further magnified, and at last enters the eye of the observer, subtending an angle as much greater than that at the point O, as is the magnifying power of the telescope.

In place of the eye-piece of four lenses, which we have just been considering, and which is exclusively used in all American instruments made at the present day; another, which has but three lenses, is often seen in the telescopes of imported instruments.

This latter, which inverts the object, though saving a little more light than the former, is exceedingly troublesome to the inexperienced observer, and has never been popular in American engineering.

To ascertain the Magnifying Power of a Telescope.

Set up the instrument about twenty or thirty feet from the side of a white wooden house, and observe through the telescope the space covered by one of the boards in the field of the glass; then still keeping that eye on the telescope, hold open the other with the finger, if necessary, and look with it at the same object. By steady and careful observation there will appear on the surface of the magnified board, a number of smaller ones seen by the naked eye, count these, and we shall obtain the magnifying power.

If the limits of the magnified board, as seen through the telescope, can be noted so as to be remembered after the eye is removed, the number of boards contained in this space may then be easily counted.

The side of an unpainted brick wall, or any other surface containing a number of small, well marked and equal objects, may be observed, in place of the surface we have described.

The operation described requires great care and close

observation, but may be performed with facility after a little practice.

We have spoken of the effect of the telescope in magnifying objects, but have not mentioned what is termed its "illuminating power."

This arises from the great diameter or aperture of the object-glass compared with that of the pupil of the eye, which enables the observer to intercept many more rays of light, and bring the object to the eye highly illuminated.

The advantage gained in this increase of light, depends, as is evident, on the size of the object glass, and the perfection with which the lenses transmit the light without absorbing or reflecting it.

The superficial magnifying power of a telescope, is found by squaring the number which expresses its linear magnifying power; thus a telescope which magnifies twenty times, increases the surface of an object four hundred times.

Before an observation is made with the telescope, the eyepiece should be moved in or out, until the wires appear distinct to the eye of the operator; the object-glass is then adjusted by turning the pinion head until the object is seen clear and well defined, and the wires appear as if fastened to its surface.

The intersection of the wires, being the means by which the optical axis of the telescope is defined, should be brought precisely upon the centre of the object to which the instrument is directed.

Having thus briefly considered the principles, we shall now proceed to describe the

Attachments of the Telescope.

A telescope is said to be "plain" when it is without any appendages to its tube or axis, as that of the Engineer's

Transit shown in the engraving, and most instruments are made in that manner.

Many surveyors, however, prefer to add these conveniences, and we shall now consider them in detail.

CLAMP AND TANGENT.—This consists essentially of a ring, encircling the axis of the telescope, and having two projecting arms, the one above being slit through the middle and holding the clamp screw, the other much longer and below, is connected with the tangent screw.

As soon as the clamp screw is tightened, the ring is brought firmly around the axis, and the telescope can then be moved up or down by turning the tangent screw.

The clamp and tangent ought always to accompany the vertical circle, and the level on the telescope.

VERTICAL CIRCLE.—A divided circle as seen in the cut of the Vernier Transit, is often attached to the axis of the telescope, giving, with a vernier, the means of measuring vertical angles with great facility.

We make two sizes of these circles, one of about $3\frac{1}{2}$ inches diameter, seen with this instrument, the other an inch larger, and shown in the cut of the Surveyor's Transit. The former is graduated to single degrees, and reads by the vernier, to five minutes of a degree. The latter, divided to half degrees, gives a reading, with the vernier, to single minutes.

The vertical circle is fitted firmly to the telescope axis, and fastened with a screw, so that it remains permanent.

The vernier, however, may be shifted in either direction, by loosening the screws which confine it to the standards.

The vernier of the small circle is divided into twelve equal parts, which correspond with thirteen degrees on the circle.

Each division of the vernier is, therefore, one-twelfth of one degree, or five minutes longer than a single division of the circle, so that the angles are read to five minutes of a degree.

The vernier is double, having its zero point in the middle, and the reading up to thirty minutes, is said to be direct; that is, if the circle is moved to the right, the minutes are read off on the right side of the vernier, and vice versa.

The minutes beyond thirty are obtained on the opposite side, and in the lower row of figures.

By following these directions, and noticing the first divisions on the circle and vernier, which exactly correspond, the surveyor can obtain a reading to five minutes with great facility.

LEVEL ON TELESCOPE.—Besides the vertical circle, there is sometimes a small level attached to the telescope of this and other instruments, which we shall hereafter describe.

Such an attachment is shown in the cut of the Surveyor's Transit, and its adjustment and advantages will be explained in our account of that instrument.

SIGHTS ON TELESCOPE.—We are sometimes desired by surveyors to place a pair of short sights on the upper side of the telescope tube.

They are best made to fold close to the tube when not in use, like those of the pocket compass, described hereafter.

These sights are useful in taking back sights without turning the telescope, and in sighting through bushes or in the forest, and as the telescope can be turned up or down, answer all the purposes of the longer sights of the ordinary compass.

SIGHTS FOR RIGHT ANGLES.—Besides the sights just mentioned, we have often attached others to the plate of the instrument, on either side of the compass circle or on the standards.

These being adjusted to the telescope give a very ready means of laying off right angles, or running out offsets, without changing the position of the instrument.

To adjust the Vernier Transit.

THE LEVELS of this instrument have a capstan head screw at each end, and are adjusted with a steel pin in the same manner as those of the Plain compass.

THE NEEDLE is also adjusted as described in our account of that instrument.

LINE OF COLLIMATION.—To make this adjustment, which is, in other words, to bring the intersection of the wires into the optical axis of the telescope, so that the instrument, when placed in the middle of a straight line will, by the revolution of the telescope, cut its extremities—proceed as follows:

Set the instrument firmly on the ground and level it carefully; and then having brought the wires into the focus of the eye-piece, adjust the object-glass on some well defined point, as the edge of a chimney or other object, at a distance of from two to five hundred feet; determine if the vertical wire is plumb, by clamping the instrument firmly to the spindle and applying the wire to the vertical edge of a building, or observing if it will move parallel to a point taken a little to one side; should any deviation be manifested, loosen the cross-wire screws, and by the pressure of the hand on the head outside the tube, move the ring around until the error is corrected.

The wires being thus made respectively horizontal and vertical, fix their point of intersection on the object selected; clamp the instrument to the spindle, and having revolved the telescope, find or place some good object in the opposite direction, and at about the same distance from the instrument as the first object assumed.

Great care should always be taken in turning the telescope, that the position of the instrument upon the spindle is not in the slightest degree disturbed.

Now, having found or placed an object which the vertical wire bisects, unclamp the instrument, turn it half way around, and direct the telescope to the first object selected; having bisected this with the wires, again clamp the instrument, revolve the telescope, and note if the vertical wire bisects the second object observed.

Should this happen, it will indicate that the wires are in adjustment, and the points bisected are with the centre of the instrument, in the same straight line.

If not, however, the space which separates the wires from the second point observed, will be double the deviation of that point from a true straight line, which may be conceived as drawn through the first point and the centre of the instrument, since the error is the result of two observations, made with the wires when they are out of the optical axis of the telescope.

Fig. 8.



For as in the diagram, let A represent the centre of the instrument, and B C the imaginary straight line, upon the extremities of which the line of collimation is to be adjusted.

B represents the object first selected, and D the point which the wires bisected, when the telescope was made to revolve.

When the instrument is turned half around, and the telescope again directed to B, and once more revolved, the wires will bisect an object, E, situated as far to one side of the true line as the point D is on the other side.

The space, D E, is therefore the sum of two deviations of the wires from a true straight line, and the error is made very apparent

In order to correct it, use the two capstan head screws on the sides of the telescope, these being the ones which affect the position of the vertical wire.

Remember that the eye-piece inverts the position of the wires, and therefore that in loosening one of the screws and tightening the other on the opposite side, the operator must proceed as if to increase the error observed. Having in this manner moved back the vertical wire until, by estimation, one-quarter of the space, D E, has been passed over, return the instrument to the point B, revolve the telescope, and if the correction has been carefully made, the wires will now bisect a point, C, situated midway between D and E, and in the prolongation of the imaginary line, passing through the point B and the centre of the instrument.

To ascertain if such is the case, turn the instrument half around, fix the telescope upon B, clamp to the spindle, and again revolve the telescope towards C. If the wires again bisect it, it will prove that they are in adjustment, and that the points, B, A, C, all lie in the same straight line.

Should the vertical wire strike to one side of C, the error must be corrected precisely as above described, until it is entirely removed.

Another method of adjusting the line of collimation often employed in situations where no good points in opposite directions can be selected upon which to reverse the wires, may here be described.

The operator sets up the instrument in some position which commands a long sight in the same direction, and having leveled his instrument, clamps to the spindle, and with the telescope locates three points which we will term A, B and C, which are distant from the instrument about one, two and three hundred feet respectively.

These points, which are usually determined by driving a nail into a wooden stake set firmly into the ground, will all

lie in the same straight line, however much the wires are out of adjustment, since the position of the instrument remains unchanged during the whole operation.

Having fixed these points he now moves the instrument to B, and sets its centre directly over the nail head, by letting down upon it the point of a plumb-bob suspended from the tripod.

Then having leveled the instrument, he directs the wires to A, clamps to the spindle and revolves the telescope towards C. Should the wires strike the nail at that point, it would show that they were in adjustment.

Should any deviation be observed, the operator must correct it by moving the wire with the screws until, by estimation, half the error is removed.

Then bringing the telescope again upon either A or C, and revolving it, he will find that the wires will strike the point in the opposite direction if the proper correction has been applied.

If not, repeat the operation until the telescope will exactly cut the two opposite points, when the intersection of the wires will be in the optical axis, and the line of collimation in adjustment.

In our description of the previous operation, we have spoken more particularly of the vertical wire, because in a revolving telescope this occupies the most important place, the horizontal one being employed mainly to define the centre of the vertical wire, so that it may be moved either up or down without materially disturbing the line of collimation.

The wires being adjusted, their intersection may now be brought into the centre of the field of view.

THE EYE-PIECE is centered by moving the screws A A, shown in the sectional view of the telescope, Fig. 4, which are slackened and tightened in pairs, the movement being now direct, until the wires are seen in their proper position.

It is here proper to observe, that the position of the line of collimation depends upon that of the object-glass, solely, so that the eye-piece may, as in the case just described, be moved in any direction, or even entirely removed and a new one substituted, without at all deranging the adjustment of the wires.

THE STANDARDS.—In order that the wires may trace a vertical line as the telescope is moved up or down, it is necessary that both the standards of the telescope should be of precisely the same height.

To ascertain this and make the correction if needed, proceed as follows:

Having the line of collimation previously adjusted, set the instrument in a position where points of observation, such as the point and base of a lofty spire, can be selected, giving a long range in a vertical direction.

Level the instrument, fix the wires on the top of the object and clamp to the spindle; then bring the telescope down, until the wires bisect some good point, either found or marked at the base; turn the instrument half around, fix the wires on the lower point, clamp to the spindle, and raise the telescope to the highest object.

If the wires bisect it, the vertical adjustment is effected; if they are thrown to either side this would prove that the standard opposite that side was the highest, the apparent error being double that actually due to this cause.

To correct it, we now make one of the bearings of the axis movable, so that by turning a screw underneath this sliding piece, as well as the screws which hold on the cap of the standard, the adjustment is made with the utmost precision.

This arrangement, which is common to all our telescope instruments, is very substantial and easily managed.

THE VERTICAL CIRCLE.—When this attachment requires adjustment, proceed by leveling the instrument carefully, and

having brought into line the zeros of the wheel and vernier, find or place some well defined point or line which is cut by the horizontal wire.

Turn the instrument half around, revolve the telescope, and fixing the wire upon the same point as before, note if the zeros are again in line.

If not, loosen the screws and move the zero of the vernier over half the error; bring the zeros again into coincidence, and proceed precisely as at first described until the error is entirely corrected, when the adjustment will be completed.

Should it be desired, at any time, the circle can be removed by the surveyor and replaced at pleasure.

THE LEVEL ON TELESCOPE.—The adjustment of this will be best considered when we come to speak of the Surveyors' Transit.


ADJUSTMENTS IN GENERAL.—We ought here to say that the above adjustments, as well as all the others which we have previously explained or may hereafter describe, are always made by us in person, but are given in this work in order that the surveyor and engineer may fully understand their instruments, and be enabled to detect and remedy errors and accidents, which in practice will often occur.

To use the Vernier Transit.

This instrument is used on the ordinary ball and spindle, placed most commonly in the compass tripod, as shown in Fig. 3.

TRIPOD HEAD.—Sometimes leveling screws with the parallel plates, and which together we shall designate the "tripod head," with a clamp and tangent movement, are used with this instrument as well as with the Surveyors' Transit.

This tripod head can be unscrewed from the legs, and is packed in the instrument box; it is of very moderate cost, and in almost every situation is infinitely superior to a ball and socket or any other support.

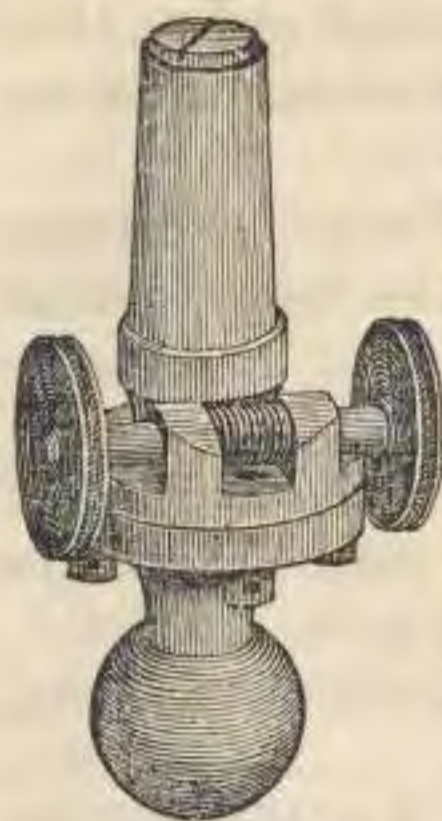

[Fig. 9.]

COMPOUND BALL.—We also manufacture what may be termed a “compound ball spindle,” which has a tangent movement, and gives all the perfection of more costly arrangements, with a very moderate expense.

As represented in the cut, it has an interior spindle, around which an outside hollow cylinder is moved by turning the double-headed tangent screw, which has in the middle an endless screw, working into teeth cut spirally around in a groove of the cylinder. The compass, or other instrument, revolves on the outside socket, precisely as it placed on a common ball spindle; but when a slower movement is required, can be made fast by the clamp screw, and then turned gradually around the interior spindle by the tangent screw, until the slote of the sight or the intersection of the wires, is made to bisect the object with the utmost certainty.

The compound ball may be placed either in a jacob-staff socket or compass tripod.

LEVELING SOCKET.—A convenient arrangement for use, either with this instrument or with a sight compass, is shown in the leveling socket described in our account of the solar compass beyond.

The socket may be used either with the ordinary compass ball or the compound ball, as there represented, and gives a very rapid and accurate means of leveling the instrument.

THE SPRING CATCH, described in our account of the Plain Compass, is always attached to the socket of this instrument, whether placed upon a ball or tripod, so that it cannot slip off from the spindle in carrying.

THE CLAMP SCREW, in the side of the socket of this instru-

ment, is shown in Fig 3, and by pressing a brass spring in the interior against the spindle, serves to fix the instrument in any position.

THE VERNIER is moved by the pinion head, now always placed beneath the plate, precisely as described in our account of the Vernier Compass, and is read to minutes in the same manner.

There is also a clamp nut underneath the circle, by which it is securely fixed in any position, which must be loosened whenever the vernier is moved by the pinion.

THE NEEDLE LIFTING SCREW is the same as those of the compasses previously described.

IN SURVEYING with this instrument the operator proceeds precisely as with the Vernier Compass, keeping the south end towards his person, reading the bearings of lines from the north end of the needle, and using the telescope in place of sights, revolving it as objects are selected in opposite directions.

PARALLAX.—Before an observation is made with the telescope, the eye-piece should be moved in or out until the wires appear distinct to the eye of the operator, the object-glass may then be placed in position by turning the pinion head on the top of the telescope, until the object is seen clear and well defined, and the wires appear as if fastened to its surface.

When, on the contrary, the wires are not perfectly distinct, the observer, by moving his eye to either side of the small aperture of the eye piece, will cause the wires to “travel” on the object, and thus occasion what is termed the “error of parallax.”

The intersection of the wires being the means by which the optical axis of the telescope is defined, should be brought precisely upon the centre of the object to which the instrument is directed.

TO TAKE ANGLES OF ELEVATION.—Level the instrument carefully, fix the zeros of the circle and vernier in line, and note the height cut upon the staff or other object, by the horizontal wire; then carry the staff up the elevation, fix the wire again upon the same point, and the angle of elevation will be read off by the vernier.

By careful usage, the adjustments of the Vernier Transit will remain as permanent as those of the ordinary compass, the only one liable to derangement being that of the line of collimation.

This should be examined occasionally, and corrected in the manner previously described.

Repairs of the Vernier Transit.

These being in great part already spoken of, it will be necessary to consider only such as belong to the telescope.

TO REPLACE THE CROSS WIRES.—Take out the eye-piece tube, together with the little ring by which it is centered, and having removed two opposite cross-wire screws, with the others turn the ring until one of the screw holes is brought into view from the open end of the telescope tube, in this thrust a stout splinter of wood or a small wire so as to hold the ring when the remaining screws are withdrawn; the ring is then taken out and is ready for the wires.

For these the web of the spider is to be preferred above any thing else, but when this is not obtainable, a fine silk fibre may be substituted.

We usually procure our webs from the living manufacturer directly, selecting those of a yellowish-brown color, as furnishing the most perfect product.

The spider being held between the thumb and finger of an assistant, in such position as to suffer no serious injury, and at the same time be unable to make any effectual resistance with his extremities, the little fibre may be drawn out at pleasure, and being placed in the fine lines cut on the surface

of the diaphragm, is then firmly cemented to its place by applying softened beeswax with the point of a knife blade.

In case the spider is not procurable, a fine strand of a web which is free from dust, and long enough to serve for both wires, may be selected.

In such times as the spiders remain in their winter quarters, we have been able to procure very good fibres from a box in which a number had been confined.

When the wires are cemented, the ring is returned to its position in the tube, and either pair of screws being inserted, the splinter or wire is removed, and the ring turned until the other screws can be replaced.

Care must also be taken that the same side of the ring is turned to the eye-piece as before it was removed.

When this has been done, the eye-tube is inserted, and its centering ring brought into such a position that the screws in it can be replaced, and then by screwing on the end of the telescope, the little cover into which the eye-tube is fixed, the operation will be completed.

TO CLEAN THE TELESCOPE.—The only glasses that will ordinarily require cleaning, are the object-glass on its outside surface, and the little eye-lens, which is exposed when the cap of the eye-tube is removed.

To remove the dust from these use a very soft and clean silk or cotton cloth, and be careful not to rub the same part of the cloth a second time on the surface of the glass.

No one should ever be allowed to touch the glasses with the fingers or with a dusty cloth.

Excellencies of the Vernier Transit.

These are due chiefly to the telescope and its attachments, and from what has already been said, it will appear are such as to render this instrument greatly superior to one provided with the ordinary sights.

1. The magnifying power of the telescope enables the sur-

veyor to take accurate observations at distances entirely beyond the reach of the naked eye.

2. The fine intersection of the cross-wires can be set precisely upon the centre of the object.

3. The revolving property of the telescope gives the means of running long lines up or down steep ascents or descents with perfect ease, where, with the short sights of the ordinary compass, two or three observations would have to be taken.

4. The use of a telescope entirely avoids the incessant trying of the eyes, experienced in surveys with the ordinary sights.

5. With the telescope, lines can be run through the forest or brushwood, and the flagstaff distinguished with much greater certainty than through the sights of a compass.

This statement may appear very unreasonable to those not familiar with the instrument, and these, in fact, raise the greatest objection to a telescope, from its supposed unfitness for surveys in such locations.

They have only to use it a few times in this kind of work, in connection with a flagstaff, painted white or covered with paper, to distinguish it from the surrounding objects, to be convinced of its great superiority.

In the Vernier Transit, as furnished by us, is supplied, as we believe, to the surveyor the most perfect of all needle instruments, and this at a cost but little above that charged by other makers for a sight compass.

The advantages of the telescope and its attachments are so great that a surveyor, accustomed to them, would find it difficult to content himself with the ordinary compass, and such in fact is the universal testimony of those familiar with the Vernier Transit.

Weight of the Vernier Transit.

The weight of this instrument, exclusive of the tripod legs, and with a plain telescope, is about ten pounds.

Sizes of the Vernier Transit.

We make three sizes, having respectively needles of four, five and six inches long.

The telescopes of our five and six inch transits, are both eleven inches long, and reverse at either end; the telescope of the four inch size is about seven inches, and the whole instrument very light and portable.

Weights of the Vernier Transits.

The average weights of the different sizes, not including the tripods are, for the four inch instrument, five pounds; the five inch, eight, and the six inch, ten pounds.

Needle Instruments.

We have now described the instruments included under the division termed Needle Instruments, in the beginning of this work.

As there stated, the Plain and Vernier Compasses and the Vernier Transit depend for their accuracy and value, mainly upon the perfection of movement of the magnetic needle.

With such instruments, the greater part of the surveying in our country has been, and will for a long time in the future, continue to be done.

And though with the improvements made in these instruments, a good surveyor may, with great care and skill, do work with a surprising degree of accuracy and perfection, yet all needles are liable to many irregularities.

Imperfections of the Needle.

These may arise either from the loss of magnetic virtue in the poles, the blunting of the centre-pin, or the attraction exerted upon it by bodies of iron, whose presence may be entirely unsuspected.

The two first of these errors may be easily remedied in the manner we have described.

LOCAL ATTRACTION.—The third and most frequent source of inaccuracy, may be detected by taking back sights, as well as fore sights, upon every line run with the needle, and by the agreement of the bearings, determining the true direction of the line.

Sometimes a compass may have little particles of iron concealed within the surface of the metal circle or plates.

It is the business of the maker to examine every instrument, in search of this defect, by trying the reversion of the needle upon all points of the divided circle.

If the needle should fail to reverse, when the compass is turned half around, and the sights directed a second time upon any object, the instrument should be thrown aside and never sold.

Besides the difficulties caused by the above imperfections, the variation of the needle is a frequent source of annoyance.

What is termed the secular variation, we have already mentioned in our account of the Vernier Compass, we will now speak of the

DIURNAL VARIATION.—This is owing to the influence of the sun, which, in summer, will cause the needle to vary from ten to fifteen minutes in a few hours, when exposed to its fullest influence.

To guard against these causes of inaccuracy in the use of needle instruments, the surveyor will need the greatest care and attention; and yet, with all the precautions than can be suggested, the difficulty of measuring horizontal angles with certainty, and to a sufficient degree of minuteness by the needle alone, has caused a demand to be felt more and more sensibly in all parts of the country for instruments, in the use of which the surveyor may proceed with assured accuracy and precision.


Indeed, in Canada, so great is the distrust of needle instruments, that the Provincial Land Surveyors are forbidden to use an instrument in their land surveys, unless it is capable of taking angles independently of the needle.

To supply the demand thus created for increased perfection in the implements of the surveyor, we manufacture a variety of instruments; three of which we shall now describe under the names of *The Railroad Compass*, *The Surveyor's Transit*, and the *Solar Compass*.

Surveying Instruments.

THE RAILROAD COMPASS.

Fig. 10.

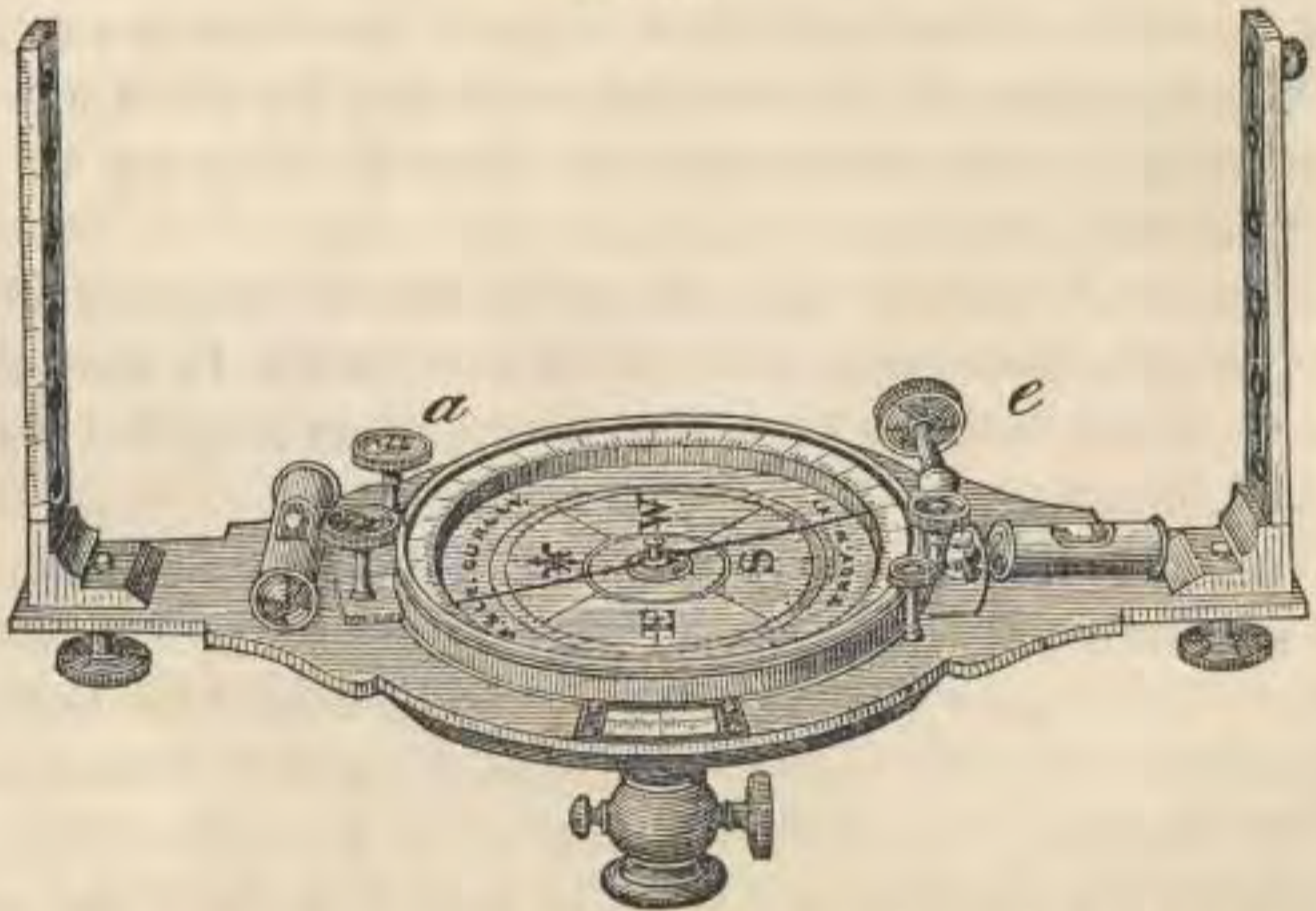

As shown in Fig. 10, this instrument has the main plate, levels, sights, and needle of the ordinary instrument, and has also underneath the main plate a divided circle or limb by which horizontal angles to single minutes can be taken independently of the needle.

The verniers are attached to the under surface of the main plate the openings through which they are seen being covered with slips of glass to protect the divisions from dust and moisture; only one of the verniers is shown in the cut.

The connection between the two plates is made by a clamp and tangent movement shown at *e*, by which they can be fas-

tened together or released at will, or moved slowly around each other as may be desired in the use of the compass.

The needle lifting screw is shown near the clamp screw, on the same end of the plate.

On the opposite side of the compass circle is seen the head *a* of a pinion working into a circular rack fixed to the edge of the compass circle, and thus enabling the surveyor to move the compass circle about its centre in setting off the variation of the needle, precisely as in the case of the vernier compass.

The variation is read to single minutes by a vernier and divided arc, partially shown near the letter *S* in the cut.

Near the pinion head is also shown a clamp screw, by which the circle is securely fixed when moved to the proper position.

The sockets upon which the plates of this instrument turn are long and well fitted, and the movement of the vernier plate around the limb is almost perfectly free from friction.

THE GRADUATED CIRCLE OF limb is divided to half degrees, and figured in two rows, viz: from 0° to 90° , and from 0° to 360° ; sometimes but a single series is used, and then the figures run from 0° to 360° , or from 0° to 180° on each side.

The figuring, which is the same upon this as in the other angular instruments we shall hereafter describe, is varied when desired by the surveyor. The first method is our usual practice.

THE VERNIERS are double, having on each side of the zero mark thirty equal divisions corresponding precisely with twenty-nine half degrees of the limb; they thus read to single minutes, and the number passed over is counted in the same direction in which the vernier is moved.

The use of two opposite verniers in this and other instruments gives the means of "cross questioning" the graduations, the perfection with which they are centered and the dependence which can be placed upon the accuracy of the

THE NEEDLE of this instrument is about five and a half inches long, and made precisely like those previously described.

THE ADJUSTMENTS of this instrument, with which the surveyor will have to do, have been already described.

To use the Railroad Compass.

It can be set upon the common compass ball, or still better, the tangent ball already described, placed either in a jacob-staff socket, a compass tripod, or the leveling socket and tripod as shown with the solar compass.

We have also adapted to many of these instruments, the leveling tripod head, with clamp and tangent movement, and this is preferable to any other support.

TO TAKE HORIZONTAL ANGLES.—First level the plate and set the limb at zero, fix the sights upon one of the objects selected, and clamping the whole instrument firmly to the spindle, unclamp the vernier plate and turn it with the hand, until the sights are brought nearly upon the second object; then clamp to the limb, and with the tangent screw fix them precisely upon it.

The number of degrees and minutes read off by the vernier, will give the angle between the two objects, taken from the centre of the instrument.

It will be understood that the horizontal angles can be taken in any position of the verniers, with reference to the zero point of the limb; we have given that above as being the usual method and liable to the fewest errors.

It is advisable where great accuracy is required, in this and other instruments furnished with two verniers, to obtain the readings of the limb from both, add the two together and halve their sum; the result will be the mean of the two readings, and the true angle between the points observed.

Such a course is especially necessary when the readings of the verniers essentially disagree, as may sometimes happen when the instrument has been injured by an accident.

USE OF THE NEEDLE.—In taking horizontal angles as just described, the magnetic bearings of the two objects are often noted, and thus two separate readings of the same angle, one by the limb, the other by the needle, are obtained, to be used as checks upon each other to prevent mistakes.

TO TURN OFF THE VARIATION OF THE NEEDLE.—Having leveled the instrument, set the limb at zero, and place the sights upon the old line, note the reading of the needle, and make it agree with that given in the field notes of the former survey, by turning the compass circle about its centre by the pinion *a*.

Now, clamp the compass circle firmly by the clamp screw, and the number of degrees or minutes passed over by the vernier of the compass circle will be the change of variation in the interval between the two surveys.

TO SURVEY with this instrument, the operator should turn the south side of the compass face towards his person, and having brought the zeros of the limb and vernier plate in contact, clamp them, and proceed as directed in our account of the Plain Compass.

Of course it will be understood that lines can be run and angles measured by the divided limb and verniers, entirely independent of the needle, which, in localities where local attraction is manifested, is very serviceable.

The accuracy and minuteness of horizontal angles indicated by this instrument, together with its perfect adaptation to all the purposes to which the Vernier Compass can be applied, have brought it into use in many localities, where the land is so valuable as to require more careful surveys than are practicable with a needle instrument.

Weight of the Railroad Compass.

The average weight of this instrument, including the brass head of the jacob staff, is about $11\frac{1}{2}$ lbs.

Single Vernier Railroad Compass.

We have just introduced a new style of this instrument, essentially alike that already described, but of somewhat simpler construction in its sockets, and having but a single vernier to the limb.


This new instrument, though afforded at a price materially lower than the other, is still in every way accurate and reliable.

Sizes and Weights of the Railroad Compass.

We make two sizes of this instrument, viz.: five, and five and a half inch needle; the largest size, including the brass head of the jacob staff, weighing ten, and the five inch, nine pounds.

The Double Vernier Compass has a five and a half inch needle, and weighs, with ball and socket, about eleven pounds.

We invite especial attention to the different styles of our Railroad compasses, believing that in many respects they are very much superior to any other compass made, having a horizontal limb, and an arrangement by which the variation of the needle can be so readily set off and ascertained.

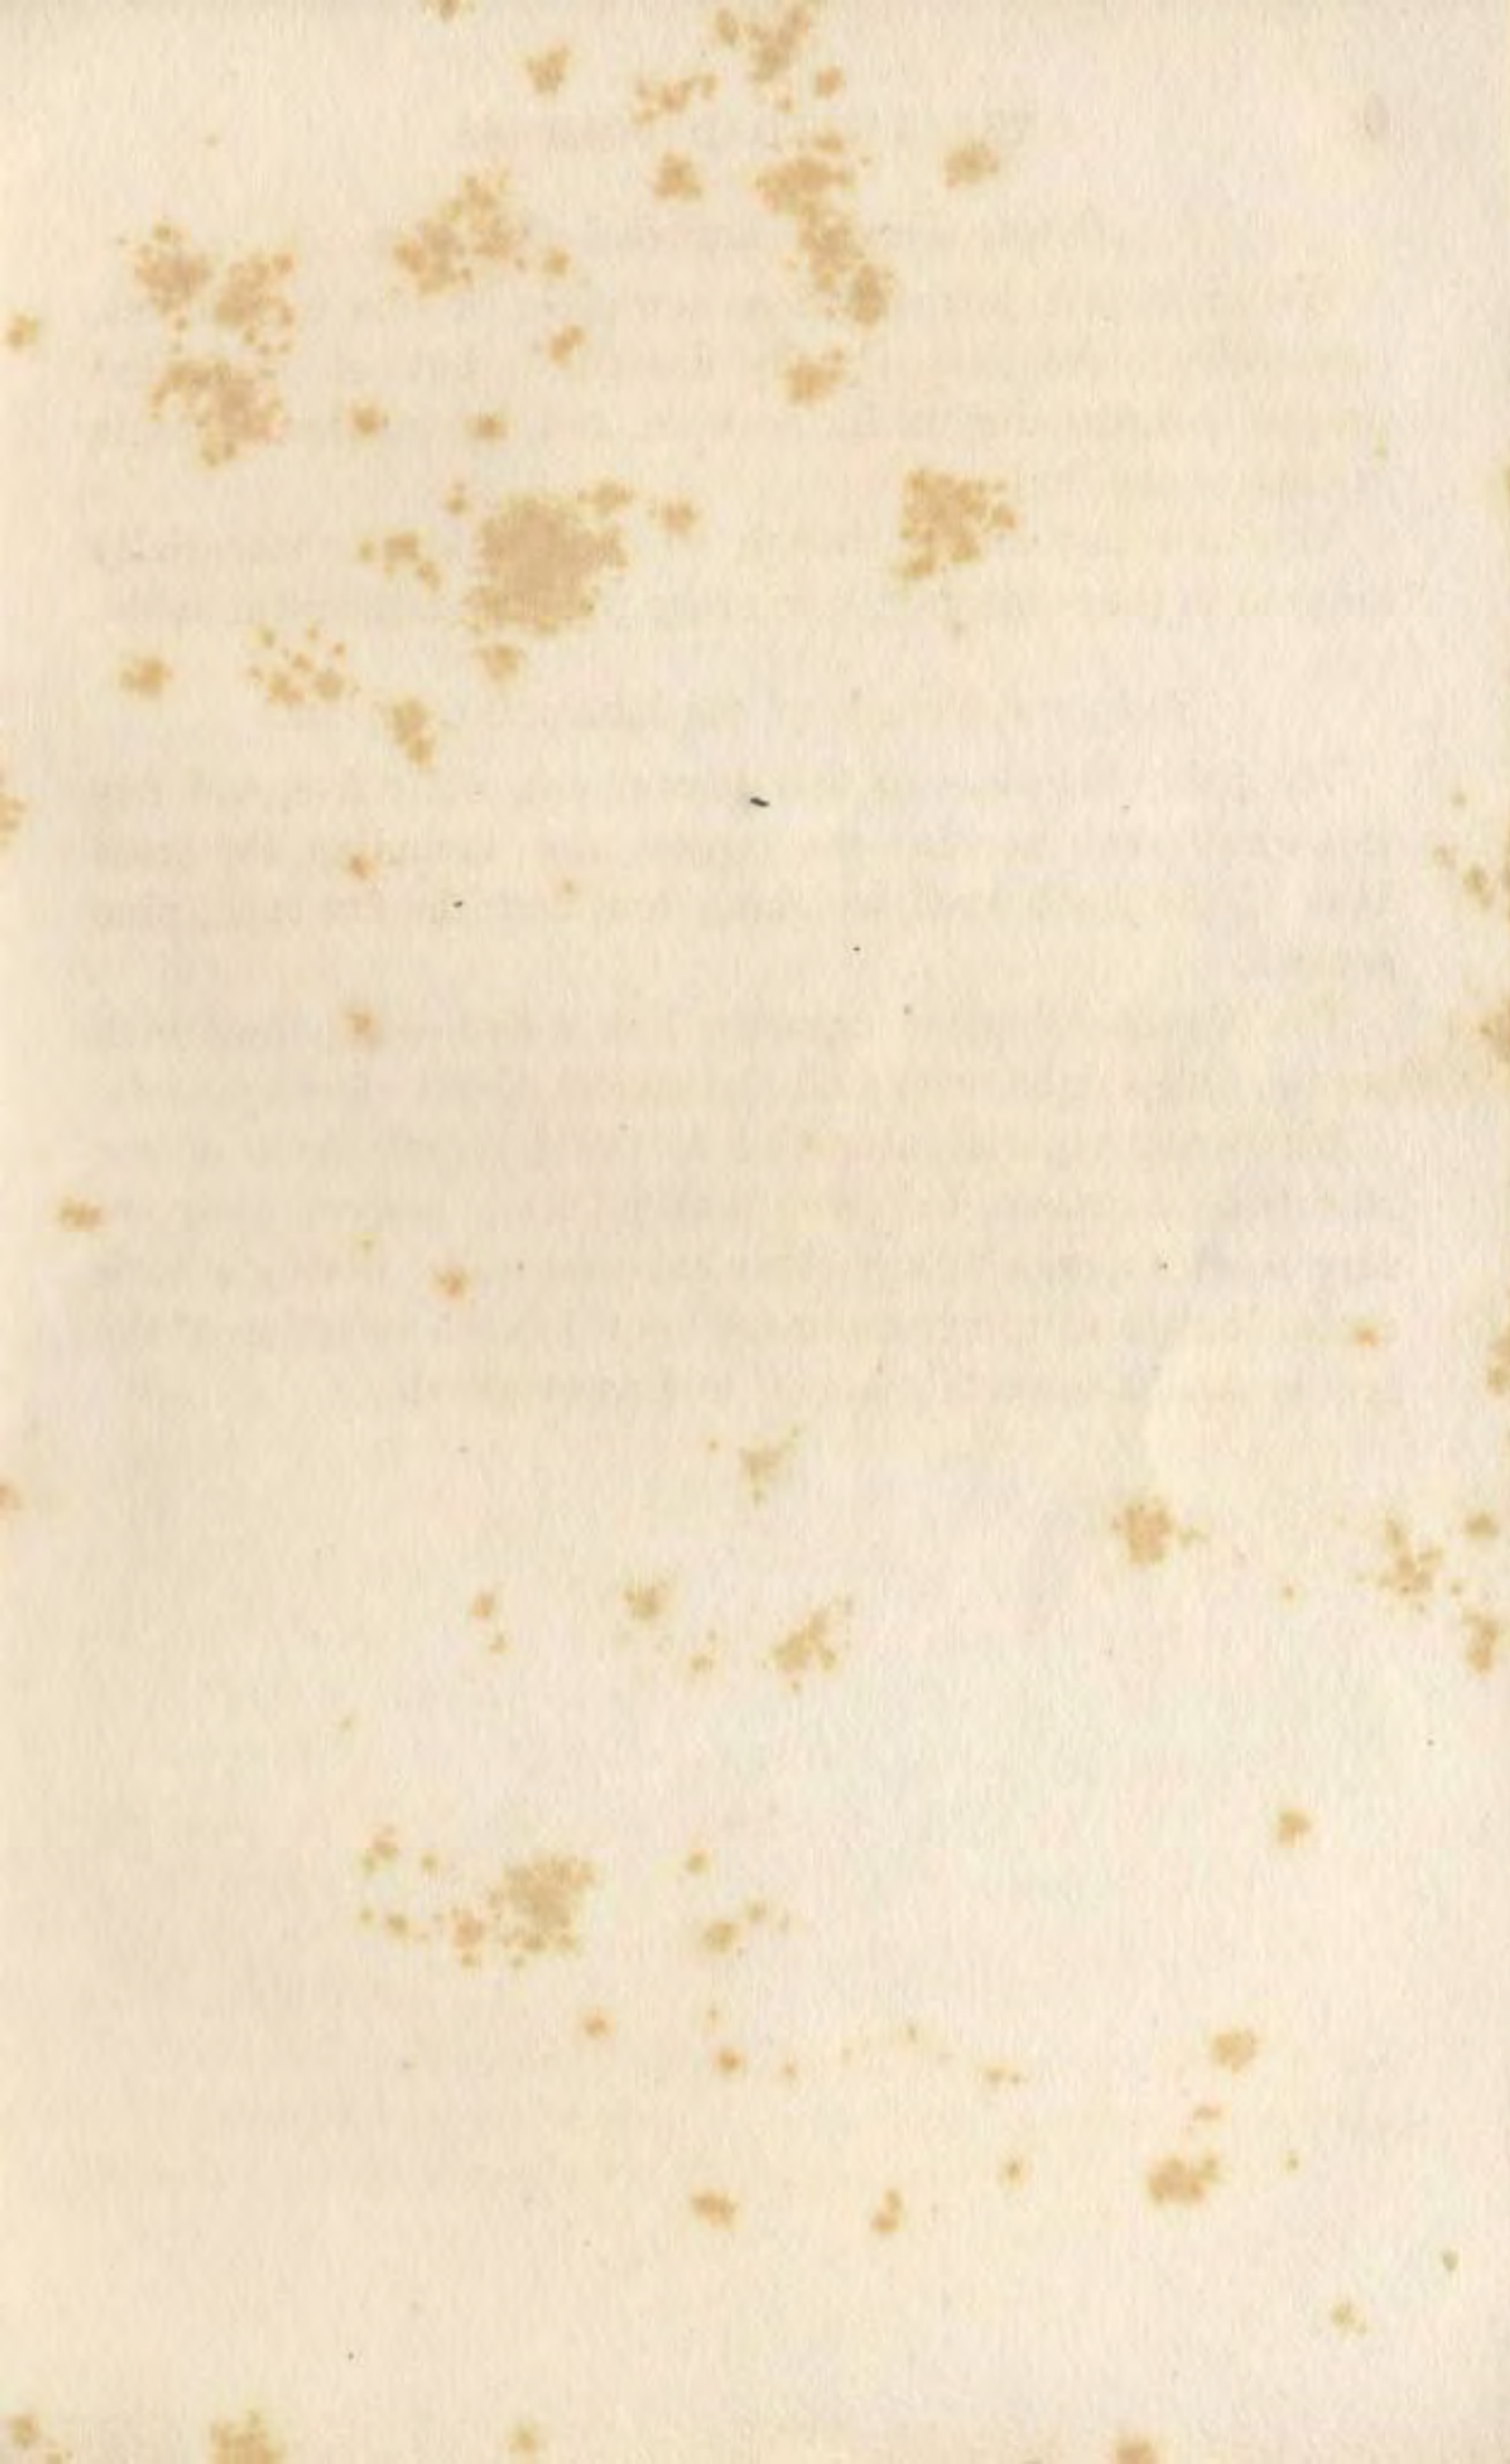

SURVEYOR'S TRANSIT.



Made by

W. & L. E. GURLEY,

TROY, N. Y.

SAVY & CO. ALBANY

THE SURVEYOR'S TRANSIT.

This instrument shown in the engraving on the opposite page, is in principle very similar to the instrument just described, differing from it mainly in the substitution of the telescope with its appendages, for the ordinary compass sights.

THE TELESCOPE is of somewhat finer quality than that used with the Vernier Transit; as here shown, it is furnished with a small level, having a ground bubble tube and a scale; and also a vertical circle connected with its axis.

THE STANDARDS are made precisely like those of the Vernier Transit, the bearings of the axis of the telescope being conical, and fitted with the utmost nicety; there is also in one of them the moveable piece for the adjustment of the wires to the tracing of a vertical line.

THE SPIRIT LEVELS are placed upon the upper surface of the vernier plate, one being fixed on the standard so as not to obstruct the light which falls on the vernier opening beneath.

Both levels are adjustable with the ordinary steel pin.

THE NEEDLE is like that of the previous instrument, but is only five inches long.

THE VERNIER PLATE, which carries the verniers and telescopes, is made to move with perfect ease and stability, around the graduated circle or limb, and horizontal angles are taken to single minutes; the variation of the needle is also set off by the pinion and clamp screw, as described in the account of the previous instrument.

THE VERNIERS, as in all our angular instruments, are double, reading either way from the centre mark, and to single minutes of a degree.

There are two verniers, placed on opposite sides of the instrument at right angles to the telescope; only one of these is shown in the cut.

THE DIVIDED CIRCLE, or limb, is graduated to half degrees, reads to minutes by the verniers, and is figured as described before.

THE CLAMP AND TANGENT movement of the vernier plate is the same as that of the Railroad Compass; it is well shown in the figure.

THE TRIPOD HEAD.—This instrument, as shown in the engraving, is generally used on a leveling tripod.

THE LIGHT LEVELING TRIPOD, used with the Surveyor's Transit, is well shown in the engraving. As there seen, there are nuts screwed in to the upper parallel plate, so as to give a long bearing for the four leveling screws.

The under plate supports the feet of the screws, and has beneath a cavity or bowl, in which moves a hemispherical nut screwed to the spindle of the tripod.

This nut serves both to connect the plates together, and as a pivot on which the upper plate is turned by the leveling screws.

The under parallel plate has also a screw on the under side, by which the tripod head may be disconnected from the legs, and packed in the box with the instrument.

The leveling screws are made of bell metal, have a large double milled head, and a deep screw of about forty threads to the inch; their ends set into little brass cups, so that the screws are worked without indenting the under plate. Sometimes a piece of leather is put in place of the cups.

The leveling screws are entirely covered above by little caps which screw over the upper side of the nut.

When the screws are loosened, the upper plate can be shifted around, so as to bring the leveling screws in any position, with reference to the plates and telescope of the instrument.

The clamp and tangent screws are seen on the upper plate of the tripod. In place of the single tangent screw, we have,

in all our instruments, substituted the double tangent movement, as shown in the engraving.

The spindle of the tripod head rises above the upper plate, and the instrument can be removed from it, by pulling out a little pin made to spring into a groove, and thus keep the instrument from falling, when the tripod is carried upon the shoulder.

In the lower end of the spindle and underneath the plates, is screwed the loop for attaching the string of the plumb-bob.

To LEVEL THE TRIPOD, the engineer takes hold of the opposite screw heads with the thumb and fore finger of each hand, and turning both thumbs in or out, as may be necessary, raises one side of the upper parallel plate and depresses the other, until the desired correction is made.

SHIFTING THE TRIPOD HEAD.—A simple arrangement by which an instrument can be easily set over a given point, is made by extending the stem of the tripod head below, through a large circular aperture in the centre of the plate to which the legs are attached, so as to connect by the hemispherical nut or pivot, with a little moveable piece bearing on the under surface of the plate. The leveling screws of course, rest directly on the upper surface of this plate, and when loosened, can be shifted nearly an inch from side to side in any direction; thus allowing the point of the plumb-bob, to be set directly over a given point on the ground.

This modification requires a larger tripod, and gives the surveyor a little more trouble when the tripod head is detached from the legs.

It is not so easily adapted to the Engineer's Transit, as to our other instruments, nor can so much movement be secured, but is made by us for any instrument whenever desired and without additional charge.

ADJUSTING SOCKET, a beautiful arrangement for occasional

use in place of the leveling tripod, in cases where greater lightness and rapidity of adjustment are desired, is shown in the adjusting socket, described in the account of the Solar Compass.

To adjust the Surveyor's Transit.

THE LEVELS are adjusted with a steel pin as those of the Vernier Transit, and it need only be added here, that in this, as well as other instruments having two plates, moving upon sockets independent of each other, the levels, when adjusted on one plate, should still keep their position when both are clamped together and turned upon a common socket.

Otherwise, however accurately the telescope might trace a vertical line, when revolved upon the socket of one plate, it would give a very different result as soon as the position of the other plate was changed.

THE NEEDLE and telescope with its other attachments being adjusted, as described in our account of the Vernier Transit, we shall here consider only that of the

LEVEL ON TELESCOPE.—For the adjustment of this attachment we shall give two methods, the first being that usually practiced by us.

1. First level the instrument carefully, and with the clamp and tangent movement to the axis, make the telescope horizontal as near as may be with the eye, then having the line of collimation previously adjusted, drive a stake at a convenient distance, say from one to three hundred feet, and note the height cut by the horizontal wire, upon a staff set on the top of the stake.

Fix another stake in the opposite direction, and at the same distance from the instrument, and without disturbing the telescope, turn the instrument upon its spindle, set the staff upon the stake, and drive in the ground, until the same height is indicated as in the first observation.

The top of the two stakes will then be in the same hori-

zontal line, however much the telescope may be out of level.

Now remove the instrument from fifty to one hundred feet to one side of either of the stakes, and in line with both; again level the instrument, clamp the telescope as nearly horizontal as may be, and note the heights indicated, upon the staff placed first upon the nearest, and then upon the most distant stake.

If both agree, the telescope is level; if not, with the tangent screw move the wire over nearly the whole error, as shown at the distant stake, and repeat the observation as just described. Proceed thus until the horizontal wire will indicate the same height at both stakes, when the telescope will be truly horizontal.

Taking care not to disturb its position, bring the bubble into the centre by the little leveling nuts at the end of the tube, when the adjustment will be completed.

2. Choose a piece of ground nearly level, and having set the instrument firmly, level the plates carefully, and bring the bubble of the telescope into the centre with the tangent screw. Measure in any direction from the instrument, from one to three hundred feet, and drive a stake, and on the stake set a staff and note the height cut by the horizontal wire, then take the same distance from the instrument in an opposite direction, and drive another stake.

On that stake set the staff and note the height cut by the wire when the telescope is turned in that direction.

The difference of the two observations is evidently the difference of level of the two stakes.

Set the instrument over the lowest stake, or that upon which the greatest height was indicated, and bring the levels on the plates and telescope into adjustment as at first.

Then with the staff, measure the perpendicular distance from the top of the stake to the centre of one of the horizontal

cross wire screw heads; from that distance subtract the difference of level between the two stakes and mark the point on the staff thus found; place the staff on the other stake, and with the tangent screw bring the horizontal wire to the mark just found, and the line will be level.

The telescope now being level, bring the bubble of the level into the centre, by turning the little nuts at the end of the tube, and noting again if the wires cut the point on the staff; screw up the nuts firmly and the adjustment will be completed.

With such a level carefully adjusted, the engineer, by taking equal fore and back sights, can run horizontal lines with great rapidity, and a good degree of accuracy.

To use the Surveyor's Transit.

In surveying with this instrument, the plates must be set so that the zeros of the circle and the verniers correspond, and firmly clamped together, the eye end of the telescope being placed over the south side of the compass circle, in the position shown in the engraving.

The surveyor may then proceed precisely as with the plain compass.

TO TURN OFF ANGLES.—When angles are to be measured independently of the needle, proceed precisely as directed in the description of the Railroad Compass.

THE VARIATION OF THE NEEDLE is also set off as mentioned in our account of that instrument.

Sizes of the Surveyor's Transit.

We make three sizes of this instrument, the weights and dimensions of limb of each being as follows:

4	inch	needle,	horizontal	limb,	6	in.	diameter,	weight	12	lbs.
5	"	"	"	"	6½	"	"	"	13	"
5½	"	"	"	"	7	"	"	"	14	"



SURVEYOR'S TRANSIT.

Single Vernier.



Made by

W. & L. E. GURLEY,

TROY, N. Y.

Single Vernier Surveyor's Transit.

We have just introduced a modification of this favorite instrument, by which, with a lighter socket and a single vernier to the limb, we furnish all the capabilities of the more costly instrument, at a material reduction in price.

We make three sizes of this transit, of the same dimensions as those having double verniers to the limb; the engraving opposite represents the one with five inch needle, having also a level attached to telescope, with clamp and tangent to axis.

This instrument may be used on the ball spindle and compass tripod, like the Vernier Transit, but like other transits should also be furnished with the usual leveling tripod.

The Single Vernier Surveyor's Transit, from its lightness, excellence and cheapness, will supply as we trust, a need long felt by engineers and surveyors, in furnishing an instrument suitable for accurate work at a very reasonable cost.

Merits of the Surveyor's Transit.

In this instrument, as just described, the surveyor will recognize advantages not possessed by any other instrument with which we are acquainted.

Combining the capabilities of a needle instrument, with a fine telescope, and the accuracy of a divided limb and verniers, and having also the means for turning off the variation of the needle; it is for a mixed practice of accurate surveying and engineering, such indeed as is required by most city engineers, the best instrument ever constructed.

The peculiar construction of the sockets and plates of this instrument is entirely our own invention, and we feel the utmost confidence in recommending it to all whose practice is such as to require the use of the needle combined with that of the divided circle and verniers.

THE SOLAR COMPASS.

This instrument, so ingeniously contrived for readily determining a true meridian or north and south line, was invented by WILLIAM A. BURT, of Michigan, and patented by him in 1836.

It has since come into general use in the surveys of U. S. public lands, the principal lines of which are required to be run with reference to the true meridian.

The invention having long since become the property of the public, we have given our attention to the manufacture of these instruments, and are now prepared to furnish them, with important improvements of our own devising, at greatly reduced prices.

Our improved Solar Compass, one form of which is shown in the engraving, has nearly the same arrangement of plates, with divided circles, verniers, and sockets, as the Railroad Compass.

The Solar Apparatus.

The Solar Apparatus is seen in the place of the needle, and in fact operates as its substitute in the field.

It consists mainly of three arcs of circles, by which can be set off the latitude of a place, the declination of the sun, and the hour of the day.

These arcs, designated in the cut by the letters *a*, *b*, and *c*, are therefore termed the latitude, the declination, and the hour arcs respectively.

THE LATITUDE ARC, *a*, has its centre of motion in two pivots one of which is seen at *d*, the other is concealed in the cut.

It is moved either up or down within a hollow arc, seen in the cut, by a tangent screw at *f*, and is securely fastened in any position by a clamp screw.


The Latitude arc is graduated to quarter degrees, and reads by its vernier, *e*, to single minutes; it has a range of about thirty-five degrees, so as to be adjustable to the latitude of any place in the United States.


SOLAR COMPASS,

Made by

W. & L. M. GUTHRIE,

PEROY, N. X.

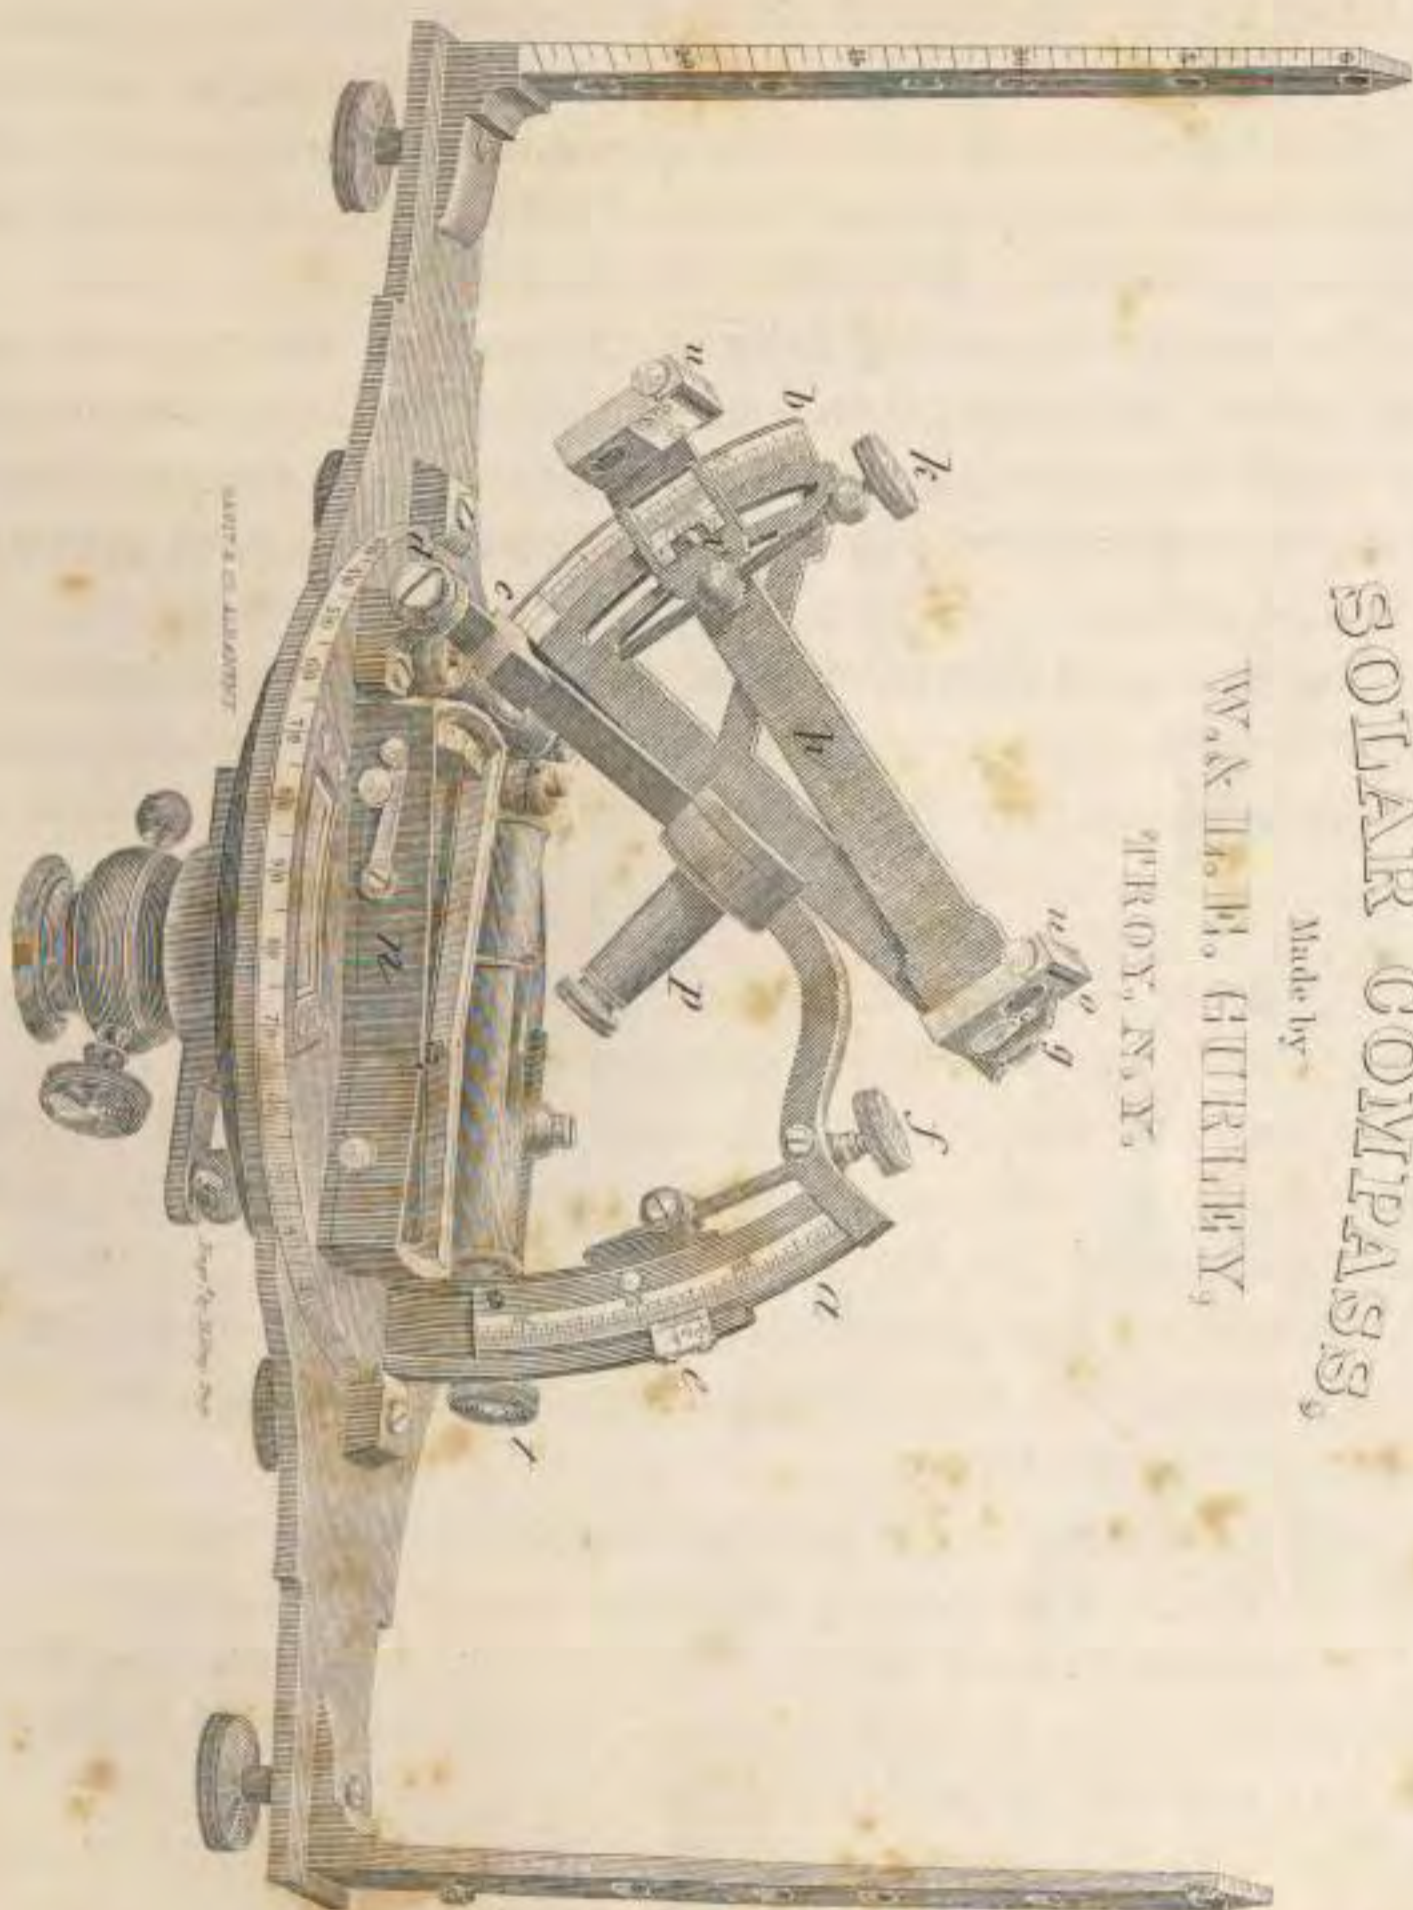

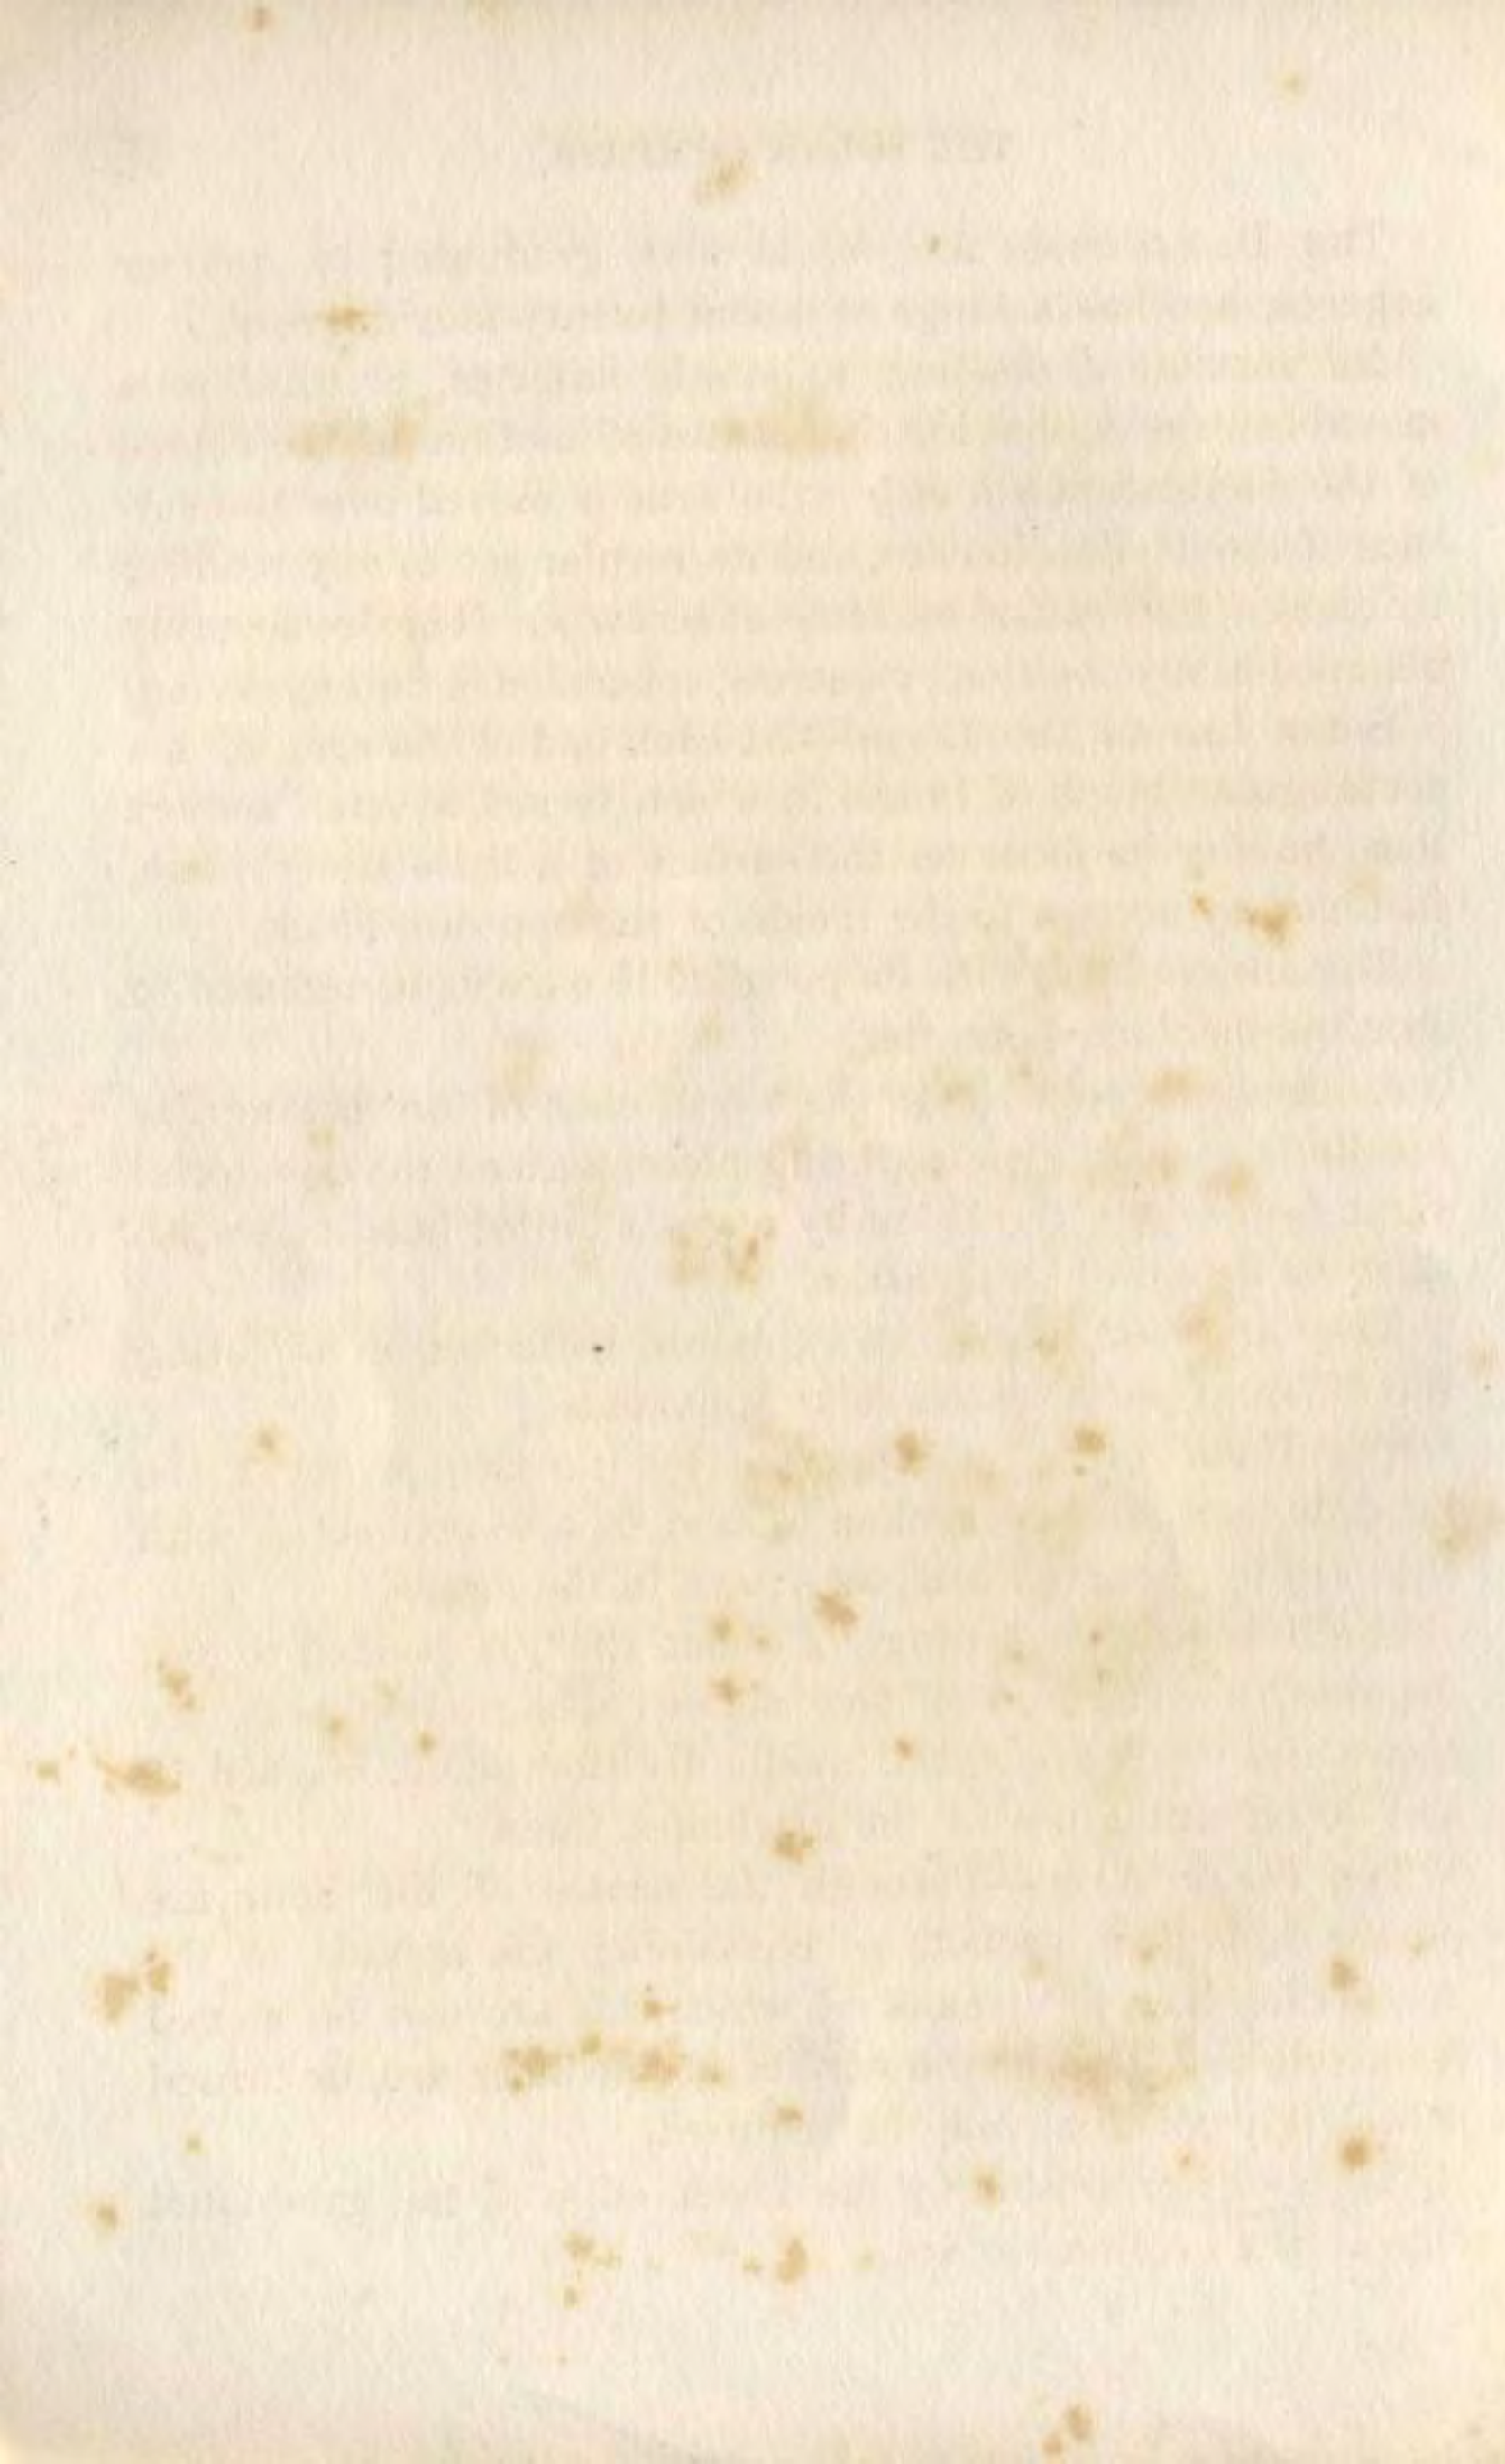

THE DECLINATION ARC, b , is also graduated to quarter degrees, and has a range of about twenty-four degrees.

Its vernier, v , reading to single minutes, is fixed to a movable arm, h , having its centre of motion in the centre of the declination arc at g ; the arm is moved over the surface of the declination arc, and its vernier set to any reading by turning the head of the tangent screw, k . It is also securely clamped in any position by a screw, concealed in the engraving.

SOLAR LENSES AND LINES.—At each end of the arm, h , is a rectangular block of brass, in which is set a small convex lens, having its focus on the surface of a little silver plate, fastened by screws to the inside of the opposite block.

The silver plate, with its peculiar lines, will be referred to more particularly hereafter.

EQUATORIAL SIGHTS.—On the top of each of the rectangular blocks is seen a little sighting piece, termed the equatorial sight fastened to the block by a small milled head screw, so as to be detached at pleasure.

They are used, as will be explained hereafter, in adjusting the different parts of the solar apparatus.

THE HOUR ARC, c , is supported by the two pivots of the latitude arc, already spoken of, and is also connected with that arc by a curved arm, as shown in the figure.

The hour arc has a range of about 120° , is divided to half degrees, and figured in two series; designating both the hours and the degrees, the middle division being marked 12 and 90 on either side of the graduated lines.

THE POLAR AXIS.—Through the centre of the hour arc passes a hollow socket, p , containing the spindle of the declination arc, by means of which this arc can be moved from side to side over the surface of the hour arc, or turned completely round as may be required.

The hour arc is read by the lower edge of the graduated side of the declination arc.

The axis of the declination arc, or indeed the whole socket, *p*, is appropriately termed the polar axis.

THE ADJUSTER.—Besides the parts shown in the cut, there is also an arm used in the adjustment of the instrument as described hereafter, but laid aside in the box when that is effected.

The parts just described constitute properly the solar apparatus.

Besides these, however, are seen the needle box, *n*, with its arc and tangent screw, *t*, and the spirit levels, for bringing the whole instrument to a horizontal position.

THE NEEDLE BOX, *n*, has an arc of about 36° in extent, divided to half degrees, and figured from the centre or zero mark on either side.

The needle, which is made as in other instruments, except that the arms are of unequal lengths, is raised or lowered by a lever shown in the cut.

The needle box is attached by a projecting arm to a tangent screw, *t*, by which it is moved about its centre, and its needle set to any variation.

This variation is also read off by the vernier on the end of the projecting arm, reading to single minutes a graduated arc, attached to the plate of the compass.

THE LEVELS seen with the solar apparatus, have ground glass vials, and are adjustable at their ends like those of our other instruments.

The edge of the circular plate on which the solar work is placed, is divided and figured at intervals of ten degrees, and numbered, as shown, from 0 to 90 on each side of the line of sight.

These graduations are used in connection with a little brass pin, seen in the centre of the plate, to obtain approximate bearings of lines, which are not important enough to require a close observation.

LINES OF REFRACTION.—The inside faces of the sights are also graduated and figured, to indicate the amount of refraction to be allowed when the sun is near the horizon. These are not shown in the cut.

THE HORIZONTAL LIMB in all our Solar Compasses is divided upon silver, and reads by two opposite verniers to single minutes of a degree, the number of minutes being counted off in the same direction in which the vernier moves.

Definition of Astronomical Terms.

Before proceeding to describe the principles and adjustments of this instrument, a brief statement of the terms employed may here be appropriately made.

THE SUN is the centre of the solar system, remaining constantly fixed in its position, though, for the sake of convenience, often spoken of as in motion around the earth.

THE EARTH makes a complete revolution around the sun in 365 days, 6 hours, very nearly.

It also rotates about an imaginary line passing through its centre, and termed its *axis*, once in twenty-four hours, turning from west to east.

THE POLES are the extremities of the axis; that in our own hemisphere, known as the north pole, if produced indefinitely towards the concave surface of the heavens, would reach a point situated near the polar star, and called the north pole of the heavens.

THE EQUATOR is an imaginary line passing around the earth equi-distant from the poles, and at right angles with them.

If the plane of the equator is produced to the heavens, it forms what is termed the equator of the heavens.

THE ORBIT of the earth is the path in which it moves in making its yearly revolution.

If the plane of this orbit were extended to the heavens, it would form the *ecliptic* or the sun's apparent path in the heavens.

As we shall see hereafter, it is by this method that we obtain the latitude of any place by the Solar Compass.

TIME.—A solar day is the interval of time between the departure of the sun from the meridian of a place, and its succeeding return to the same position.

The length of the solar day, by reason of the varying velocities of the earth in its orbit, and the inclination of its axis, is continually changing.

In order to have a uniform measure of time, we have recourse to what is termed a *mean solar day*, the length of which is equal to the mean or average of all the solar days in a year.

The time thus given is termed *mean time*, and is that to which clocks and watches are adjusted for the ordinary business of life.

The sun is sometimes faster, and sometimes slower, than the clock, the difference being termed the *equation of time*.

The moment when the sun is on the meridian of any place is termed *apparent noon*, and this being ascertained, we can, by referring to the equation of time for the given day, and adding to, or subtracting from, apparent noon, according as the sun is slow or fast, obtain the time of *mean noon*, by which to set the watch or chronometer.

DIFFERENCE OF LONGITUDE.—As the earth makes a complete rotation upon its axis once a day, every point on its surface must pass over 360° in 24 hours, or 15° in one hour, and so on in the same proportion.

And as the rotation is from west to east, the sun would come to the meridian of every place 15° west of Greenwich, just one hour later than the time given in the Almanac, for apparent noon at that place.

To an observer situated at Troy, N. Y., the longitude of which is in time 4 hours 54 minutes, 40 sec., the sun would come to the meridian nearly five hours later than at Green-

wich, and thus when it was 12 M. at that place, it would be but about 7 o'clock A. M. in Troy.

REFRACTION.—By reason of the increasing density of the atmosphere from its upper regions to the earth's surface, the rays of light from the sun are bent out of their course, so as to make his altitude appear greater than is actually the case.

The amount of refraction varies, according to the altitude of the body observed; being 0 when it is in the zenith, about one minute when midway from the horizon to the zenith, and almost 34' when in the horizon.

To indicate the amount of refraction to be allowed in observations with the solar compass, the sights have on their inside faces a number of lines, marked at intervals, and figured so as to read off the degree of refraction of the sun or other body, when seen directly over the top of one sight, by the eye placed on the other at the height marked by the line of refraction.

EFFECT OF INCIDENTAL REFRACTION.—It will be seen by referring to the instrument, that the effect of the ordinary refraction, which to distinguish from meridional refraction, we will term *incidental*, upon the position of the sun's image with reference to the equatorial lines, which, in fact, are the only ones to be regarded in running lines with the Solar Compass, is continually changing, not only with the change of latitude, but also with that of the sun's declination from hour to hour, and the motion of the revolving arm as it follows the sun in its daily revolution.

If the equatorial lines were always in the same vertical plane with the sun, as would be the case at the equator at the time of the equinoxes, it is evident that refraction would have no effect upon the position of the image between these lines, and therefore would not be of any importance to the surveyor.

But as we proceed further north, and as the sun's declina-

tion to the south increases, the refraction also increases, and must now be taken into account.

Again the angle which the equatorial lines make with the horizon is continually changing as the arm is made to follow the motion of the sun during the course of a day.

Thus in the morning and evening they are more or less inclined to the horizon, while at noon they are exactly parallel to it.

And thus it follows that the excess of refraction at morning and evening is in some measure balanced by the fact that the position of the sun's image with reference to the equatorial lines is then less affected by it, on account of the greater inclination of the lines to the horizon.

Besides the causes already mentioned as modifying the effect of refraction, we may add that of the numerous changes in the atmosphere; and when all these are considered, it will be seen that any idea of calculating the amount and influence of refraction with certainty may well be abandoned.

The best that can be done, is to estimate and allow for it as a little experience will suggest during morning and evening, and disregard it entirely for the rest of the day.

We shall give the practice of government surveyors in allowing for refraction, when we come to speak of the manner in which the Solar Compass is used.

THE MERIDIONAL REFRACTION of the sun is that by which his position is affected when on the meridian.

It varies of course, with the varying meridional altitudes of the sun, and in all places in north latitude must be added to the declination when it is north, and subtracted when it is south, in order to obtain the true declination for the given day.

This is done for the starting hour as will be hereafter described, and is carried through the other hours of the day without further addition.

To obtain the meridional refraction of the sun for a given

day and place, we first ascertain the meridional altitude of the sun on that day, and then refer to the table of refractions given in the Almanac a few pages beyond the ephemeris of the sun, and find the amount of refraction corresponding to the angle thus obtained, which will be the meridional refraction required.

Thus to obtain the meridional refraction of the sun for April 16th, 1868, at Troy, N. Y., proceed as follows :

Latitude of Troy	42° 44'
	90—42° 44' = 47° 16'
Declination April 16, which is north or +	10° 19' 22"

Gives a meridional altitude of 57° 35' 22"

Referring now to the table of refractions we find the amount corresponding to the angle thus found to be 38'', which is the meridional refraction for the given day, and is to be added to the declination, as will hereafter be seen.

Again, let it be required to obtain the meridional refraction at the same place, Oct. 15, 1868, the declination now being in the contrary direction.

Latitude of Troy	42° 44'
	90—42° 44' = 47° 16'
Declination for Oct. 16, which is south or —	9° 5' 40"

Gives a meridional altitude of 38° 10' 20"

Referring again to the table, we find the refraction for the meridional altitude just found to be 1' 14'', which is now to be subtracted from the declination for the given day, when it is set off upon the declination arc.


As will be seen by both examples, the meridional refraction, though affecting the sun's declination by a constant quantity through the whole day, is yet of comparatively small amount, and in practice is often entirely disregarded, except by those surveyors engaged in running the great standard meridians and parallels of latitude, or in testing their instruments.

Principles of the Solar Compass.

We are now prepared, to proceed to the explanation of the peculiar construction of the instrument we are considering.

The little silver plate before referred to, is shown in detail in fig. 13. On its surface are marked two sets of lines inter-

Fig. 13.

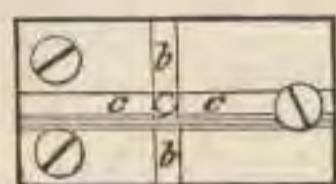

secting each other at right angles; of these, $b\ b$ are termed the hour lines, and $c\ c$ the equatorial lines, as having reference respectively, to the hour of the day and the position of the sun, in relation to the equator.

Below the equatorial lines are also marked three other lines, which are five minutes apart, and are of service in making allowance for refraction, as will be hereafter explained.

The interval between the two lines c, c , as well as between b, b , is just sufficient to include the circular image of the sun, as formed by the solar lens, on the opposite end of the revolving arm.

When, therefore, the instrument is made perfectly horizontal, the equatorial lines and the opposite lenses being accurately adjusted to each other by a previous operation, and the sun's image brought within the equatorial lines, his position in the heavens, with reference to the horizon, will be defined with precision.

Suppose the observation to be made at the time of one of the equinoxes; the arm h , set at zero on the declination arc b , and the polar axis p , placed exactly parallel to the axis of the earth.

Then the motion of the arm h , if revolved on the spindle of the declination arc around the hour circle c , will exactly correspond with the motion of the sun in the heavens, on the given day and at the place of observation; so that if the sun's image was brought between the lines $c\ c$, in the morning, it would continue in the same position, passing neither

above nor below the lines, as the arm was made to revolve in imitation of the motion of the sun about the earth.

In the morning as the sun rises from the horizon, the arm h will be in a position nearly at right angles to that shown in the cut, the lens being turned towards the sun, and the silver plate on which his image is thrown directly opposite.

As the sun ascends, the arm must be moved around, until when he has reached the meridian, the graduated side of the declination arc will indicate 12 on the hour circle, and the arm h , the declination arc b , and the latitude arc a , will be in the same plane.

As the sun declines from the meridian the arm h must be moved in the same direction, until at sunset its position will be the exact reverse of that it occupied in the morning.

ALLOWANCE FOR DECLINATION.—Let us now suppose the observation made when the sun has passed the equinoctial point, and when his position is affected by declination.

By referring to the Almanac, and setting off on the arc his declination for the given day and hour, we are still able to determine his position with the same certainty as if he remained on the equator.

When the sun's declination is south, that is from the 22d of September to the 20th of March in each year, the arc b is turned towards the plates of the compass, as shown in the engraving, and the solar lens, o , with the silver plate opposite, are made use of in the surveys.

The remainder of the year, the arc is turned from the plates, and the other lens and plate employed.

When the Solar Compass is accurately adjusted, and its plates made perfectly horizontal, the latitude of the place, and the declination of the sun for the given day and hour, being also set off on the respective arcs, *the image of the sun cannot be brought between the equatorial lines until the polar axis is placed in the plane of the meridian of the place, or*

in a position parallel to the axis of the earth. The slightest deviation from this position will cause the image to pass above or below the lines, and thus discover the error.

We thus, from the position of the sun in the solar system, obtain a certain direction absolutely unchangeable, from which to run our lines, and measure the horizontal angles required.

This simple principle is not only the basis of the construction of the Solar Compass, but the sole cause of its superiority to the ordinary or magnetic instrument. For in a needle instrument, as before stated in this work, the accuracy of the horizontal angles indicated, and therefore of all the observations made, depends upon "the delicacy of the needle, and the constancy with which it assumes a certain direction, termed the magnetic meridian."

The principal causes of error in the needle as briefly stated, are the dulling of the pivot, the loss of polarity in the needle, the influence of local attraction, and the effect of the sun's rays, producing the diurnal variation.

From all these imperfections the solar instrument is free.

The sights and the graduated limb being adjusted to the solar apparatus, and the latitude of the place, and the declination of the sun also set off upon the respective arcs, we are able, not only to run the true meridian, or a due east and west course, but also to set off the horizontal angles with minuteness and accuracy from a direction which never changes, and is unaffected by attraction of any kind.

To adjust the Solar Compass.

The adjustments of this instrument, with which the surveyor will have to do, are simple and few in number, and will now be given in order.

1st, **TO ADJUST THE LEVELS.**—Proceed precisely as directed in the account of the other instruments we have described, by bringing the bubbles into the centre of the tubes by the leveling screws of the tripod, and then reversing the instru-

ment upon its spindle, and raising or lowering the ends of the tubes, until the bubbles will remain in the centre during a complete revolution of the instrument.

2d, To ADJUST THE EQUATORIAL LINES AND SOLAR LENSES.—First detach the arm *h* from the declination arc by withdrawing the screws shown in the cut from the ends of the posts of the tangent screw, *k*, and also the clamp screw, and the conical pivot with its small screws by which the arm and declination arc are connected.

The arm, *h*, being thus removed, attach the adjuster in its place by replacing the conical pivot and screws, and insert the clamp screw so as to clamp the adjuster at any point on the declination arc.

Now level the instrument, place the arm *h* on the adjuster, with the same side resting against the surface of the declination arc as before it was detached. Turn the instrument on its spindle so as to bring the solar lens to be adjusted in the direction of the sun, and raise or lower the adjuster on the declination arc, until it can be clamped in such a position, as to bring the sun's image as near as may be between the equatorial lines on the opposite silver plate, and bring the image precisely into position, by the tangent of the latitude arc, or the leveling screws of the tripod. Then carefully turn the arm half way over, until it rests upon the adjuster by the opposite faces of the rectangular blocks, and again observe the position of the sun's image.

If it remains between the lines as before, the lens and plate are in adjustment; if not, loosen the three screws which confine the plate to the block, and move the plate under their heads, until one half the error in the position of the sun's image is removed.

Again bring the image between the lines, and repeat the operation until it will remain in the same situation, in both positions of the arm, when the adjustment will be completed.

To adjust the other lens and plate, reverse the arm end for end on the adjuster, and proceed precisely as in the former case, until the same result is attained.

In tightening the screws over the silver plate, care must be taken not to move the plate.

This adjustment now being complete, the adjuster should be removed, and the arm, *h*, with its attachments, replaced as before.

3d, To ADJUST THE VERNIER OF THE DECLINATION ARC.—Having leveled the instrument, and turned its lens in the direction of the sun, clamp to the spindle, and set the vernier, *v*, of the declination arc, at zero, by means of the tangent screw, at *k*, and clamp to the arc.

See that the spindle moves easily and yet truly in the socket, or polar axis, and raise or lower the latitude arc by turning the tangent screw, *f*, until the sun's image is brought between the equatorial lines on one of the plates. Clamp the latitude arc by the screw, and bring the image precisely into position by the leveling screws of the tripod or socket, and without disturbing the instrument, carefully revolve the arm *h*, until the opposite lens and plate are brought in the direction of the sun, and note if the sun's image comes between the lines as before.

If it does, there is no index error of the declination arc; if not with the tangent screw, *k*, move the arm until the sun's image passes over half the error; again bring the image between the lines, and repeat the operation as before, until the image will occupy the same position on both the plates.

We shall now find, however, that the zero marks on the arc and the vernier do not correspond, and to remedy this error, the little flat head screws above the vernier must be loosened until it can be moved so as to make the zeros coincide, when the operation will be completed.

4th, TO ADJUST THE SOLAR APPARATUS TO THE COMPASS SIGHTS.—First level the instrument, and with the clamp and tangent screws set the main plate at 90° by the verniers and horizontal limb. Then remove the clamp screw, and raise the latitude arc until the polar axis is by estimation very nearly horizontal, and if necessary, tighten the screws on the pivots of the arc, so as to retain it in this position.

Fix the vernier of the declination arc at zero, and direct the equatorial sights to some distant and well marked object, and observe the same through the compass sights. If the same object is seen through both, and the verniers read to 90° on the limb, the adjustment is complete; if not, the correction must be made by moving the sights or changing the position of the verniers.

In that form of this instrument, described hereafter as the Solar Compass proper, the solar work is attached permanently to the sockets, and this adjustment once made by the maker, will need no further attention at the hands of the surveyor, unless in case of severe accidents.

In the second form, termed the Solar Telescope Compass, the socket of the telescope is made so as to be adjustable horizontally, and thus set to the solar apparatus and divided limb with certainty and ease.

OTHER ADJUSTMENTS.—We should perhaps here say, that the above adjustments, as well as the others with which the surveyor ordinarily will have no concern, are all made by us, in the process of constructing and finishing our instruments, and are liable to very little derangement in the ordinary use of the Solar Compass.

Tripods, &c.

The Solar Compass should always be used on a tripod provided with some means by which it may be leveled with ease and accuracy.

A tangent motion to the whole instrument about its spindle,

in addition to that of the limb already spoken of, is also of very great value.

These requirements are, we think, best supplied in our Adjusting Socket, with compound tangent ball as shown in fig. 14.

The socket is attached to the legs of an ordinary compass tripod, and rests upon the knob, *a*, of an interior stem, shown by the dotted line of the cut.

The instrument is approximately leveled by the ball and socket joint, and finally made perfectly horizontal by the leveling screws at *b*.

Fig. 14.



It also revolves upon the spindle as upon the ordinary compass ball, but can be clamped at pleasure to the socket, and then by its sights or telescope directed precisely to any object by the tangent screw at *c*.

The ordinary adjusting tripod head with leveling screws, and clamp and tangent movement, as shown with our Surveyor's Transit, is also used with this instrument, but is heavier and less capable of rapid adjustment.

Of course when a single or jacob staff is preferred to the tripod, for this or any other of our compasses, the adjusting socket, with either a simple or compound ball, can be placed upon the stem, *a*, fixed firmly to the top of the staff and adjusted as just described.

In all cases where either a leveling tripod, or the adjusting socket, with compound ball is furnished with this instrument, a simple ball is also supplied, upon which the compass can be placed whenever desired.

The simple ball is furnished with an extra cap for the socket, or in case of the leveling tripod, with an adopter, fitting to the top of the tripod, so that the substitution can be made by the surveyor himself without any difficulty.

PRICES OF THE SOCKET.—As the adjusting socket may often be used to advantage with the other instruments described in this work, we will here insert its prices with its various modifications.

With tripod and compound ball as in fig. 14 ..	\$18 00
“ “ simple “	12 00
“ Jacob staff and compound ball.....	12 00
“ “ simple “	6 00

To use the Solar Compass.

Before this instrument can be used at any given place it is necessary to set off upon its arcs both the declination of the sun as affected by its meridional refraction for the given day, and the latitude of the place where the observation is made.

TO SET OFF THE DECLINATION.—The declination of the sun, given in the Ephemeris of the Nautical Almanac, from year to year, is calculated for apparent noon at Greenwich, England.

To determine it for any other hour at a place in the U. S., reference must be had, not only to the difference of time arising from the longitude, but also to the change of declination from day to day.

The longitude of the place, and therefore its difference in time, if not given directly in the tables of the Almanac, can be ascertained very nearly by reference to that of other places given, which are situated on, or very nearly on, the same meridian.

It is the practice of surveyors in the States east of the Mississippi to allow a difference of *six* hours for the difference in longitude, calling the declination given in the Almanac for 12 M., that of 6 A. M., at the place of observation.

Beyond the parallel of Santa Fe, the allowance would be about *seven* hours, and in California, Oregon, and Washington Territory about *eight* hours.

Having thus the difference of time, we very readily obtain the declination for a certain hour in the morning, which would be earlier or later as the longitude was greater or less, and the same as that of apparent noon at Greenwich on the given day. Thus suppose the observation made at a place, say, five hours later than Greenwich, then the declination given in the Almanac for the given day at noon, affected by the meridional refraction, would be the declination at the place of observation for 7 o'clock, A. M.; this gives us the starting point.

To obtain the declination for the other hours of the day take from the Almanac, the declination for apparent noon of the given day, and also that of the day following, subtract one from the other, as it may have increased or decreased, and we have the change of declination for 24 hours, divide this by 24, and we obtain the change of declination for a single hour, which is to be added to, or subtracted from that of the starting hour, according as the declination is increasing or decreasing between the two days taken.

To make this more plain we will give an example. Suppose it was required to obtain the declination for the different hours of April 16th, 1868, at Troy, N. Y.

The longitude in time is 4 hrs. 54 min. 40 sec., or practically 5 hours, so that the declination given in the Almanac for the given day at Greenwich would be that of 7 A. M. at Troy.

To obtain the hourly change.

Say declination at Greenwich, April 17..10° 40' 28"

“ “ “ 16..10 19 22

Change for 24 hours..... 21 06

Reduce to seconds, and divide by 24, and we have an hourly change of 50 seconds, which, as the declination is increasing, is to be added every hour after 7 A. M.

Hence, sun's declination at Greenwich noon as by the table

	being.....	10° 19' 22"			
	Add meridional refraction.		38		
		10 20		=Dec. for 7 A. M.	
	Add hourly change.....		50		
		10 20 50		" 8 "	
"	"		50		
		10 21 40		" 9 "	
"	"		50		
		10 22 30		" 10 "	
"	"		50		
		10 23 20		" 11 "	
"	"		50		
		10 24 10		" 12 M.	
"	"		50		
		10 25		" 1 P. M.	
"	"		50		
		10 25 50		" 2 "	
"	"		50		
		10 26 40		" 3 "	
"	"		50		
		10 27 30		" 4 "	
"	"		50		
		10 28 20		" 5 "	

	10° 28' 20'' = Dec. for 5 P.M.	
Add hourly change.....	50	
	10 29 10	“ 6 “
“ “	50	
	10 30	“ 7 “

In the case taken the declination is increasing from day to day, and therefore the hourly change is added; if, on the contrary, the declination was decreasing, the hourly change should be subtracted.

The calculation of the declination for the different hours of the day, should of course be made and noted before the surveyor commences his work, that he may lay off the change from hour to hour, from a table prepared as above described.

It is considered sufficiently accurate by most government surveyors, to set off the declination only three or four times in the day, at intervals of two or three hours as required.

TO SET OFF THE LATITUDE.—Find the declination of the sun for the given day at noon, at the place of observation as just described, and with the tangent screw set it off upon the declination arc, and clamp the arm firmly to the arc.

Observe in the almanac the equation of time for the given day, in order to know about the time the sun will reach the meridian.

Then, about fifteen or twenty minutes before this time, set up the instrument, level it carefully, fix the divided surface of the declination arc at 12 on the hour circle, and turn the instrument upon its spindle until the solar lens is brought into the direction of the sun.

Loosen the clamp screw of the latitude arc, and with the tangent crew raise or lower this arc until the image of the sun is brought precisely between the equatorial lines, and turn the instrument from time to time so as to keep the image also between the hour lines on the plate.

As the sun ascends, its image will move below the lines, and the arc must be moved to follow it. Continue thus keeping it between the two sets of lines until its image begins to pass above the equatorial lines, which is also the moment of its passing the meridian.

Now read off the vernier of the arc, and we have the latitude of the place, which is always to be set off on the arc when the compass is used at the given place.

It is the practice of surveyors using the Solar Compass to set off, in the manner just described, the latitude of the point where the survey begins, and to repeat the observation and correction of the latitude arc every day when the weather is favorable, there being also nearly an hour at mid-day when the sun is so near the meridian as not to give the direction of lines with the certainty required.

TO RUN LINES WITH THE SOLAR COMPASS.—Having set off in the manner just given the latitude and declination upon their respective arcs, the instrument being also in adjustment, the surveyor is ready to run lines by the sun.

To do this, the instrument is set over the station and carefully leveled, the plates clamped at zero on the horizontal limb, and the sights directed north and south, the direction being given, when unknown, approximately by the needle.

The solar lens is then turned to the sun, and with one hand on the instrument, and the other on the revolving arm, both are moved from side to side, until the sun's image is made to appear on the silver plate; when by carefully continuing the operation, it may be brought precisely between the equatorial lines.

Allowance being now made for refraction, the line of sights will indicate the true meridian; the observation may now be made, and the flag-man put in position.

When a due east and west line is to be run, the verniers

of the horizontal limb are set at 90° , and the sun's image kept between the lines as before.

The Solar Compass being so constructed that when the sun's image is in position the limb must be clamped at 0 in order to run a true meridian line, it will be evident that the bearing of any line from the meridian, may be read by the verniers of the limb precisely as in the ordinary magnetic compass, the bearing of lines are read from the ends of the needle.

ALLOWANCE FOR REFRACTION.—From what has been before stated, it will be seen that no precise calculation can be made for the effect of incidental refraction.

The practice of the Government surveyor in this matter is, to keep the image square between the equatorial lines during most of the day, but at morning and evening, when the sun is near the horizon, to run the image full and flush upon the lower line, and pay no regard to the other.

When the sun is near the horizon, the image is less bright and clearly defined than during the rest of the day, and in keeping the brightest part fully on the lower equatorial line, as we have said, the hazy edge of the image will overlap one or two of the graduated spaces below, and thus fully compensate for the effect of refraction.

A little practice with the instrument will soon enable the inexperienced surveyor to supply the correction thus approximately given, so as to make the proper allowance for incidental refraction with more accuracy, than if a precise calculation had been attempted.

USE OF THE NEEDLE.—In running lines, the magnetic needle is always kept with the sun; that is, the point of the needle is made to indicate 0 on the arc of the compass box, by turning the tangent screw connected with its arm on the opposite side of the plate. By this means the lines can be run by the needle alone in case of the temporary disappear

ance of the sun ; but, of course, in such cases the surveyor must be sure that no local attraction is exerted.

The variation of the needle, which is noted at every station, is read off in degrees and minutes on the arc, by the edge of which the vernier of the needle box moves.

ALLOWANCE FOR THE EARTH'S CURVATURE.—When long lines are run by the Solar Compass, either by the true meridian, or due east and west, allowance must be made for the curvature of the earth.

Thus, in running north or south, the latitude changes about one minute for every distance of 92 chains, 30 links, and the side of a township requires a change on the latitude arc of $5' 12''$, the township, of course, being six miles square.

This allowance is of constant use where the surveyor fails to get an observation on the sun at noon, and is a very close approximation to the truth.

In running due east and west, as in tracing the standard parallels of latitude, the sights are set at 90° on the limb, and the line is run at right angles to the meridian.

If no allowance were made for the earth's curvature, these lines would, if sufficiently produced, reach the equator, to which they are constantly tending.

Of course, in running short lines either east or west, the variation from the parallel, would be so small as to be of no practical importance, but when long sights are taken, the correction should be made by taking fore and back sights at every station, noticing the error on the back sight, and setting off one half of it on the fore sight on the side towards the pole.

TIME OF DAY BY THE SUN.—The time of day is best ascertained by the Solar Compass when the sun is on the meridian, as at the time of making the observation for latitude.

The time thus given is that of apparent noon, and can be reduced to mean time, by merely applying the equation of

time as directed in the Almanac, and adding or subtracting as the sun is slow or fast.

The time, of course, can also be taken before or after noon, by bringing the sun's image between the hour lines, and noticing the position of the divided edge of the revolving arm, with reference to the graduations of the hour circle, allowing four minutes of time for each degree of the arc, and thus obtaining apparent time, which must be corrected by the equation of time as just described.

CAUTION AS TO THE FALSE IMAGE.—In using the compass upon the sun, if the revolving arm be turned a little one side of its proper position, a false or reflected image of the sun will appear on the silver plate in nearly the same place as that occupied by the true one. It is caused by the reflection of the true image from the surface of the arm, and is a fruitful source of error to the inexperienced surveyor. It can, however, be readily distinguished from the real image by being much less bright, and not so clearly defined.

APPROXIMATE BEARINGS.—When the bearings of lines, such as the course of a stream, or the boundaries of a forest, are not desired with the certainty given by the verniers and horizontal limb, a rough approximation of the angle they make with the true meridian, is obtained by the divisions on the outside of the circular plate.

In this operation, a pencil, or thin straight edge of any sort, is held perpendicularly against the circular edge of the plate, and moved around until it is in range with the eye, the brass centre pin, and the object observed.

The bearing of the line is then read off at the point where the pencil is placed.

Time for using the Solar Compass.

The Solar Compass, like the ordinary instrument, can be used at all seasons of the year, the most favorable time


being, of course, in the summer, when the declination is north, and the days are long, and more generally fair.

It is best not to take the sun at morning and evening, when it is within half-an-hour of the horizon, nor at noon, as we have before stated, for about the same interval, before and after it passes the meridian.

Telescope and Micrometer.

It is often desirable to use a telescope in connection with the Solar Compass, both for ranging lines and measuring distances, where the chain cannot be conveniently employed.

Fig. 15.

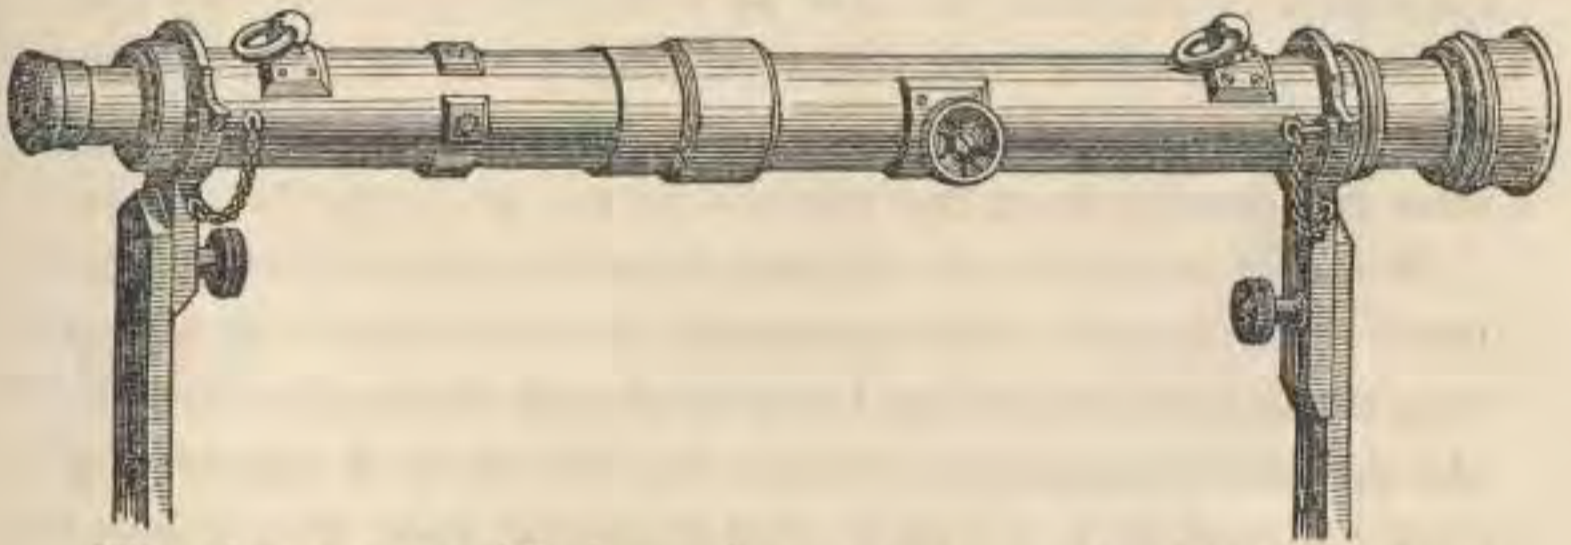

The above cut will show the arrangement which we have commonly made for this purpose, and which is intended to use with that form of the instrument provided with the ordinary sights.

The telescope is from 17 to 20 inches in length, and furnished with the same glasses as those of the best leveling instruments.

It has, of course, the ordinary cross-wires, with screws for their adjustment; the centering ring for the eye-piece, the screws and washers of which are shown at the eye end; and a pinion for bringing the object glass into focus upon near and distant objects.

The tube of the telescope is placed in Y pieces like those of the leveling instrument, so that it can be revolved at

pleasure on loosening the pins which confine it, or entirely removed from the wyes, and carried on the person of the surveyor, by a cord suspended from the little rings shown on its upper surface.

The wye piece on the forward sight has a slote as shown, so as to allow the telescope to move up or down a short distance, and to be clamped at pleasure at any point within the range.

The cross-wire screws are concealed under a little thin brass ferule, placed on the enlarged part of the tube, which can be slipped off, whenever the adjustment of the wires is required.

The cross-wires are adjusted like those of the ordinary level, by revolving the tube in the wyes, and bringing each wire to reverse upon the same object.

When thus adjusted, the telescope is turned in the wyes, until the pinion is in the position shown in the cut, and the wires made respectively horizontal and vertical, when it is clamped by the pins, and the telescope moved up or down at the forward end, and finally clamped upon the sights, so that the vertical wire and the compass sights bisect the same object observed.

The telescope can then be used in place of the sights, and long lines over surfaces nearly horizontal be run with nearly the same accuracy and ease as with the Transit.

When packed in the instrument case, the tube of the telescope takes apart by unscrewing in the middle, there being also little caps supplied to screw on the open ends, and keep out the dust and moisture from the interior of the tube.

THE CHEAPER TELESCOPE.—In place of the telescope we have just described, a much cheaper one is sometimes made by adapting the ordinary spy-glass to the sights, and supplying the cross wires.

This telescope, however, cannot be adjusted with certainty, or used with satisfaction, nor can it be recommended where accuracy of observation is required.

MICROMETER.—In this telescope there are three horizontal cross wires, the centre one being fixed as usual, while the others, one on either side, can be adjusted at any distance from each other, and thus made to cover a certain interval upon a rod placed at a specified distance from the telescope.

When these wires are thus adjusted to include a certain interval, as a foot for instance, upon a rod placed at a distance of 100 feet, it is found that they will cover half a foot at one half that distance, or two feet at a distance of 200 feet, and so on in very nearly the same proportion.

By this means the distance of the rod from the instrument can be measured or set off, without the use of a chain, and with astonishing accuracy and ease.

Indeed, we have been frequently assured that with a powerful telescope, such as we have often placed on our transit instruments, or such as we are now describing, distances can be measured with even greater accuracy than by a chain, especially when the surface of the ground is broken or intersected by deep ravines.

The two small screws by which the movable wires are adjusted, have their heads upon the outside of the washers of the cross wire screws, and can thus be moved by the surveyor with a simple screw driver, one being slackened and the other tightened, until the interval between the wires is made precisely as desired, when the little movable ferule is slipped over all, and the wires protected from any derangement.

When measurements are to be recorded in chains and links, the wires should be made to cover a foot at a distance of 66 feet, if recorded in feet, they should cover the same interval at a distance of 100 feet.

The rod used with the micrometer should be graduated to feet and decimals of a foot, and provided with two targets, the upper one being fixed at some definite point, while the lower one can be moved as the surveyor requires, the distance between the two targets being accurately read off by the vernier of the movable one.


In using the micrometer, the upper wire is brought by the leveling screws of the tripod precisely upon the upper or stationary target, while the lower target is moved up or down until the lower wire exactly bisects its centre line, when the rod is read, and the distance recorded.

Different Forms of the Solar Compass.

We manufacture two different forms of this instrument, of which we will now proceed to give a detailed description, beginning with that of which we have already spoken.

THE SOLAR COMPASS.

Fig. 16.

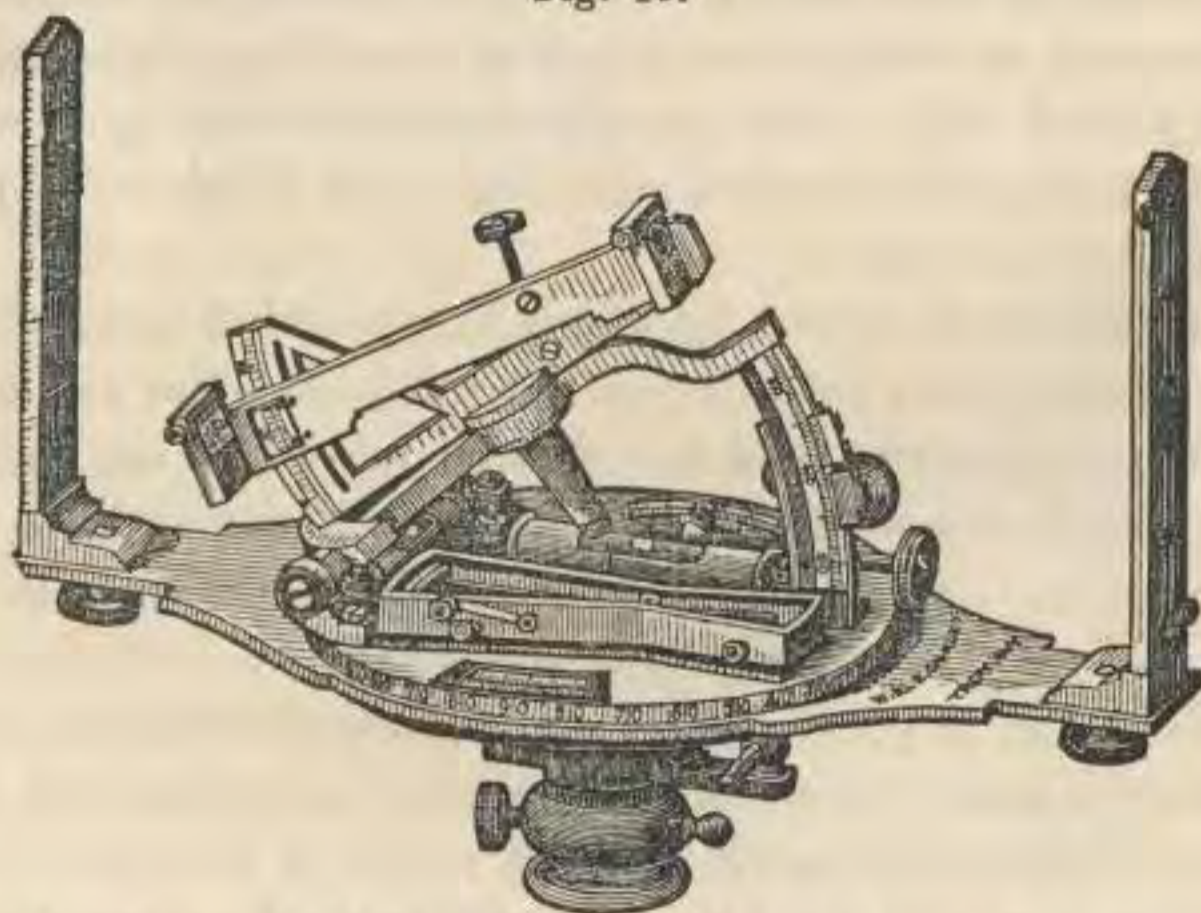

The first form of this instrument, and that which is most commonly used by the government surveyor, is shown in fig, 16, and still better in the engraving at the opening of this article.

As there seen, the main plate which carries the sights, &c., is but a trifle larger than the circular one on which the solar work is placed.

The solar apparatus, which is of the usual form and size, is permanently attached to the sockets of the instrument by a screw, the head of which may be seen in the inside of the socket when the instrument is removed from the ball.

THE SOCKETS are very strong, and the whole instrument is exceedingly compact, light, and substantial.

THE TANGENT MOVEMENT between the plates is partly shown in the figure, the clamp screw, however, is concealed.

THE CLAMP SCREW, by which the instrument is fastened to the spindle, is shown on the side of the socket.

THE SPRING CATCH, of which the knob is shown opposite the head of the clamp screw, prevents the instrument from falling from the spindle when carried on the shoulder, without being previously clamped.

The lines of refraction are shown on one of the sights, but as we have previously remarked, are very seldom used in practice.

THE TANGENT SCALE for angles of elevation and depression is also seen upon the sights, and is sometimes of service in reducing an inclined to a horizontal surface in chaining.


THE GRADUATIONS of this instrument are made upon silver plate, and figured as usual, the arcs and circles being read to single minutes by their respective verniers.

THE SOLAR APPARATUS has the same adjustments and appliances as have been previously described.

This form of the Solar Compass is generally used upon the adjusting socket shown in fig. 14, but may also be placed upon the leveling tripod if desired.

THE SOLAR TELESCOPE COMPASS.

[Fig. 17.]

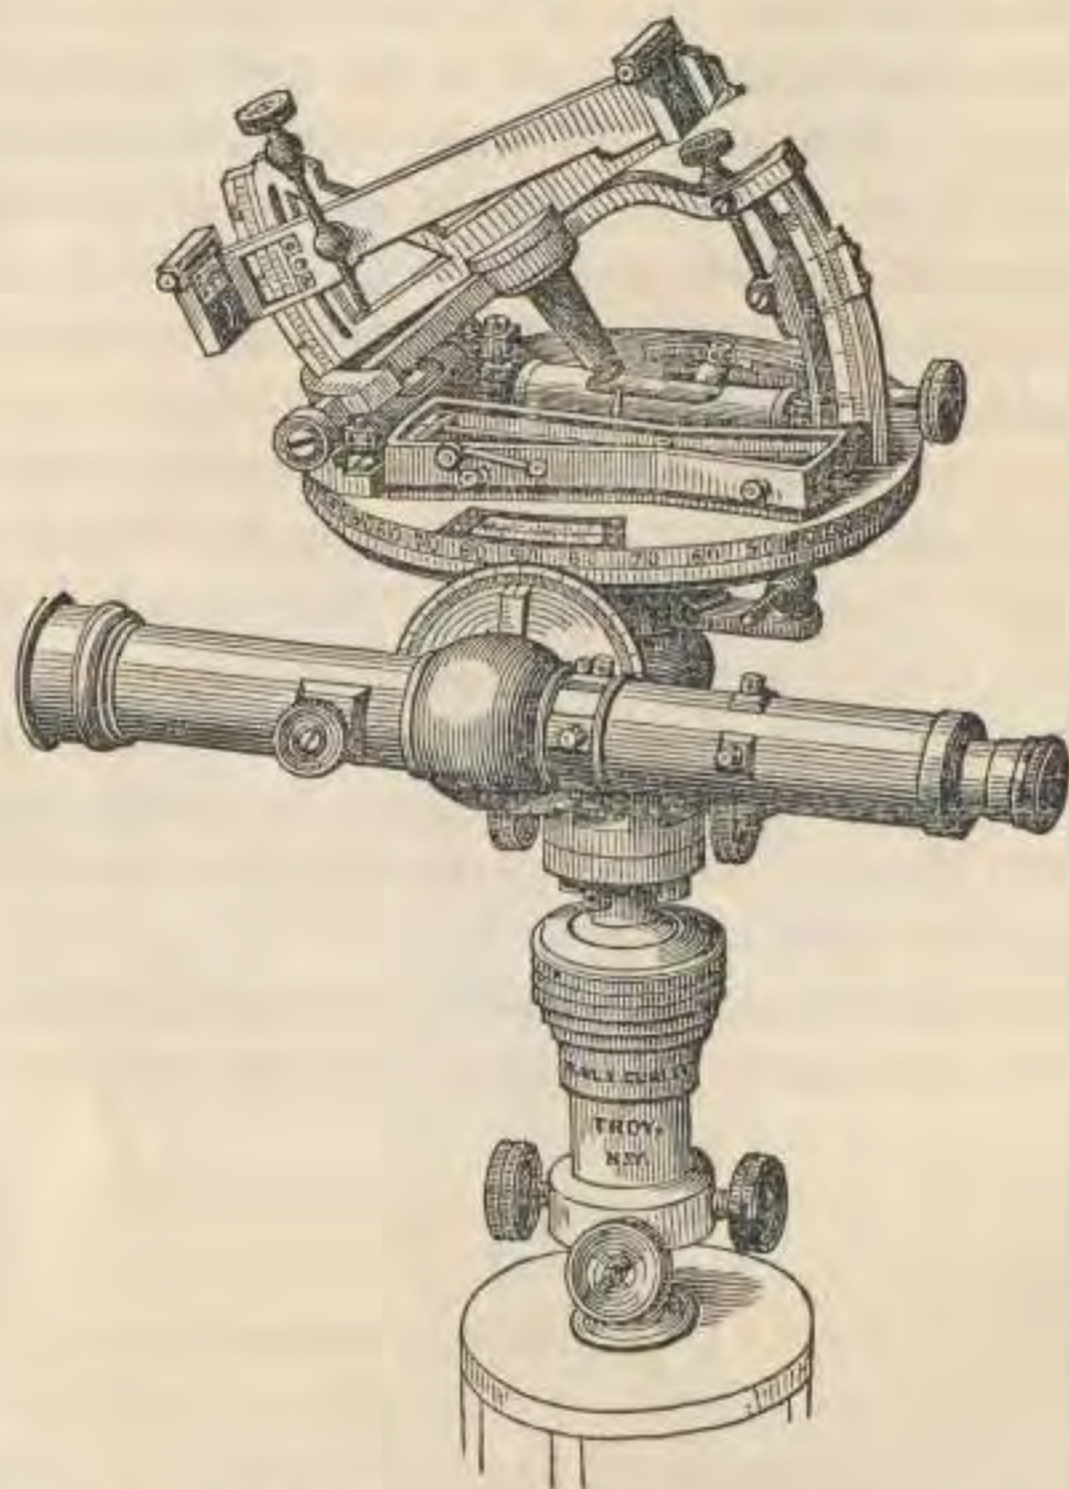

In this, the second form of our improved Solar Compass, the solar apparatus and the arrangement of the socket, &c., is precisely like that of the instrument just described.

The main or lower plate, however, is now made circular, the sights being dispensed with, and a telescope substituted in their stead.

The telescope is from ten to twelve inches long, furnished with cross wires, &c., and turns by its projecting spindle within a socket attached to the lower plate of the instrument,

so as to revolve in either direction, as in taking fore and back sights, or to run lines up or down steep ascents or descents, with the same ease as that of the ordinary Transit.

Attached to the ball of the telescope, and turning with it, is also shown an index, which moving over a graduated circle, enables the surveyor to take angles of elevation and depression with great facility.

The telescope is also furnished with the micrometer wires already described, the movable wire being adjusted by the small screw heads shown above and below to one side of those which effect the ordinary adjustment of the wires.

The socket in which the spindle of the telescope turns, is moved at one end a short distance in a horizontal direction by butting screws pressing upon either side, thus adjusting the cross wires of the telescope, precisely to the equatorial sights of the solar apparatus, as described in our 4th adjustment of the Solar Compass.

The instrument is shown placed upon the adjusting socket previously referred to, by which it can be leveled and directed to any object desired.

To use the Solar Telescope Compass.

As the construction of this form of the Solar Compass is somewhat peculiar, on account of the telescope, and its position on the instrument, a brief explanation of its use may here be appropriately made.

The fact that in this instrument the telescope is placed at one side, may at first occasion some question as to the accuracy and convenience of its observation.

A very simple contrivance adapted to the flagstaff used with the instrument, will however, we think, obviate any difficulty in both respects.


This is shown in fig. 18, and is merely a small peg or offset fastened near the foot of the staff, its extremity being precisely the same distance from the centre of the staff, as

the centre of the telescope is from that of the instrument itself.

The staff is therefore held so that the offset is at right angles to the direction of the line run, and being put in position by the telescope, the pin or stake is set at the extremity of the offset, and is therefore in the true line.

When the instrument is brought up to the point thus found, its centre is set over the stake, and another observation made in precisely the same manner, the staff, and the centre of the telescope, being thus always to one side of the true line, while the centre of the instrument, and the extremity of the offset pin, are directly upon it.

Fig. 18.

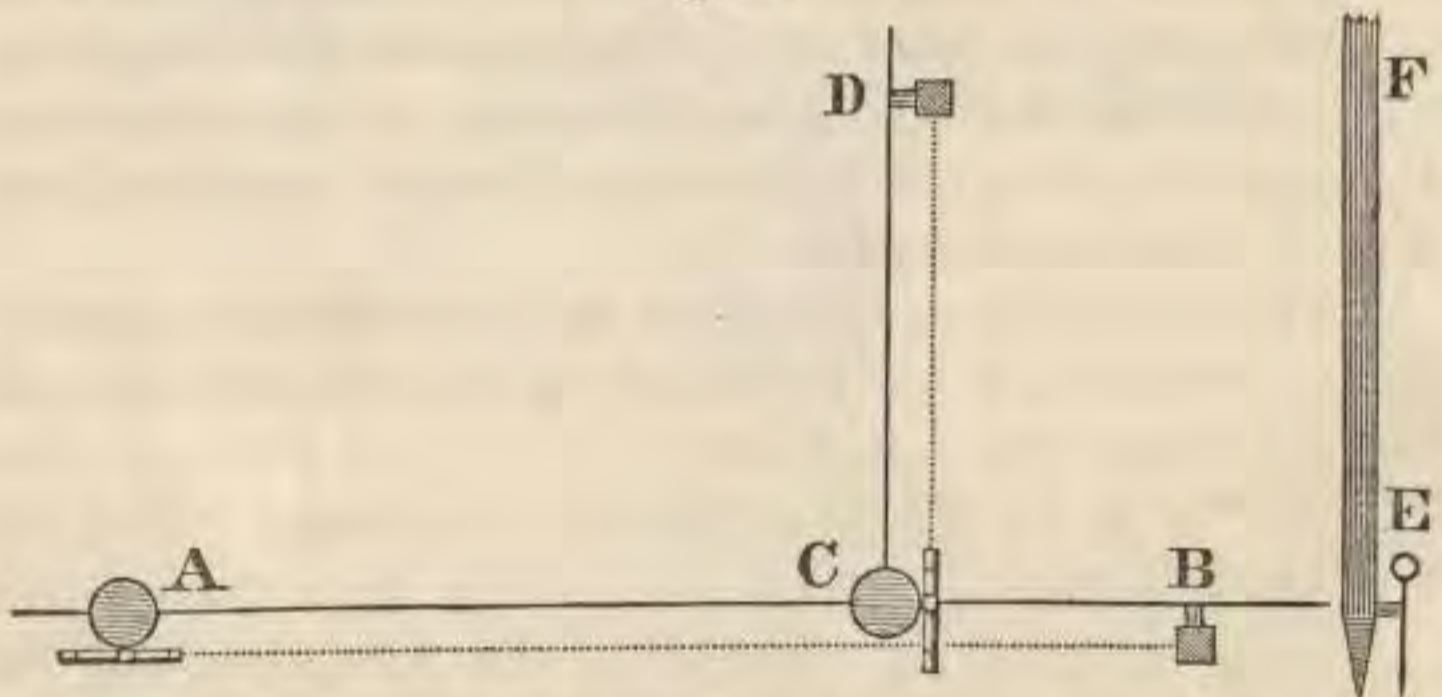

Thus, in fig. 18, E F represents a portion of the staff, showing the offset pin at its base, and the accompanying diagram illustrates the manner of running lines.

Suppose the instrument set at A, and it is required to run the line A B; the telescope represented at the side of the circle will locate the position of the staff at the end of the line, just as far to one side, as it is itself to one side of the centre of the instrument.

But the end of the offset pin is now precisely in the true line, as shown at the point B, and the result is precisely the

same as if the telescope was placed over the centre of the instrument, and the rod without an offset.

If it is required to set off another line C D at a given point C, at any given angle with the line A B, the instrument is set over C, the rod held with the end of the offset towards the line, and the observation made in the same manner as before.

TO ADJUST THE TELESCOPE.—The line of collimation is most conveniently adjusted by the second method given in our account of the Vernier Transit, and which we will here repeat. The instrument is set up in a position commanding a long sight in the same direction, and carefully leveled.

The plates and socket are then securely clamped, and with the telescope and offset staff above described, three points, which we will term A B C, are located in the same direction at distances from the instrument of about one, two, and three hundred feet respectively.

These points, which may be marked by setting a marking pin, or driving in a stake, will all be in the same straight line, however much the wires are out of adjustment, since the position of the telescope remains unchanged during the whole operation.

The instrument is now moved to B, its centre set carefully over it by a plumb ball, again leveled and clamped, and the telescope directed to the offset staff set at A or C, and revolved in the opposite direction.

If the vertical wire strikes the opposite point, the telescope is in adjustment, if not, with the screws bring the wire half way over the error, and again observe the same points as before, when, if the proper correction has been made, the wire will bisect the staff at both, and the telescope will be in adjustment.

The screws which centre the eye-piece are shown nearest

the eye end of the tube, and are used precisely like those of the Transit.

The telescope is readily adjusted to the solar apparatus as before described, by bringing it to the same side of the instrument as that on which the equatorial sights are placed in the 4th adjustment, and then the plates being previously clamped at 90° , and the arm at 0° on the declination arc; directing the sights to some well marked and distant object, which the vertical wire of the telescope must also be made to bisect, by the two butting screws, which press on opposite sides of the socket.

When the adjustment is completed, the screws should be brought firmly against the socket to make it permanent.

Superiority of our Solar Compasses.

The Solar Compass as hitherto made, though planned with great ingenuity in its general arrangement, was still extremely rude in its mechanical details and adjustments. Some of these defects, which are apparent on inspection of any instrument, as hitherto made by other manufacturers, and which must have frequently occurred to the surveyor, we will now enumerate.

The motion of the plates over each other was accompanied with so much friction, that in turning the verniers around the limb, the whole instrument would often be moved about its spindle.

Again, the verniers must be set, and the sights directed to an object by the hand alone, a matter of no little difficulty when single minutes of a degree were to be set off, and accurate observations were required.

The latitude and declination arcs must also be moved by hand, and the verniers set to single minutes in the same manner.

The points in which we claim the superiority of our Solar Compass over any hitherto manufactured, and by means of

which the defects just enumerated are entirely removed, are partially shown in the various cuts already given, and will now be stated in detail.

1. A motion of the horizontal plates almost entirely free from friction, combined with perfect solidity.

2. A fine clamp and tangent movement to the divided limb, as shown in the figures under the plate.

3. A tangent movement with clamp, for the declination arc, as shown at *l*.

4. A tangent movement with clamp to the latitude arc, as shown at *f*.

5. A tangent motion for the whole instrument about its sockets, as shown in our Adjusting Socket.

6. The employment of a telescope in place of sights, as in our second form of the instrument.

7. Greater facility of adjustment, and, in consequence, an important saving of time.

8. An important reduction in price, while still furnishing an article greatly improved.

Weight of the Solar Compass.

The average weights of the different forms of this instrument which we manufacture are as follows :

Solar Compass <i>proper</i> , with adjusting socket.	12 lbs.
Solar Telescope compass, " " as in fig. 17,	12 lbs.

Advantages of the Solar Compass in Surveying.

It will readily occur to all who have read the preceding description of the Solar Compass, that while it is indispensable in the surveys of public lands, it also possesses important advantages over the magnetic compass, when used in the ordinary surveys of farms, &c.

For not only can lines be run and angles be measured without regard to the diurnal variation, or the effect of local

attraction, but the bearings being taken from the true meridian, will remain unchanged for all time.

The constant uncertainty caused by the variation of the needle, and the litigation to which it so often gives rise, may thus be entirely prevented by the use of the Solar Compass in this kind of work.

It is also said by those familiar with the use of this instrument, that in favorable weather, surveys can be more rapidly made with it, than with the ordinary needle instrument; there being no time consumed in waiting for the needle to settle, or in avoiding the errors of local attraction.

When the sun is obscured, the lines may be run by the needle alone, it being always kept with the sun, or at 0 on its arc, and thus indicating the direction of the true meridian.


The sun, however, must ever be regarded as the most reliable guide, and should, if possible, be taken at every station.

It is with the design of making the principles and use of the Solar Compass intelligible to the ordinary surveyor, that we have given a more extended account of this instrument than of the others previously mentioned, believing that when its merits become better understood, it will come into more general use.

For much valuable information as to the details of this instrument, as well as the practice of government surveyors in the field, we are indebted to our friend JAMES L. INGALLSBE, late U. S. Deputy Surveyor in Iowa, Kansas and Nebraska.



ENGINEER'S TRANSIT.

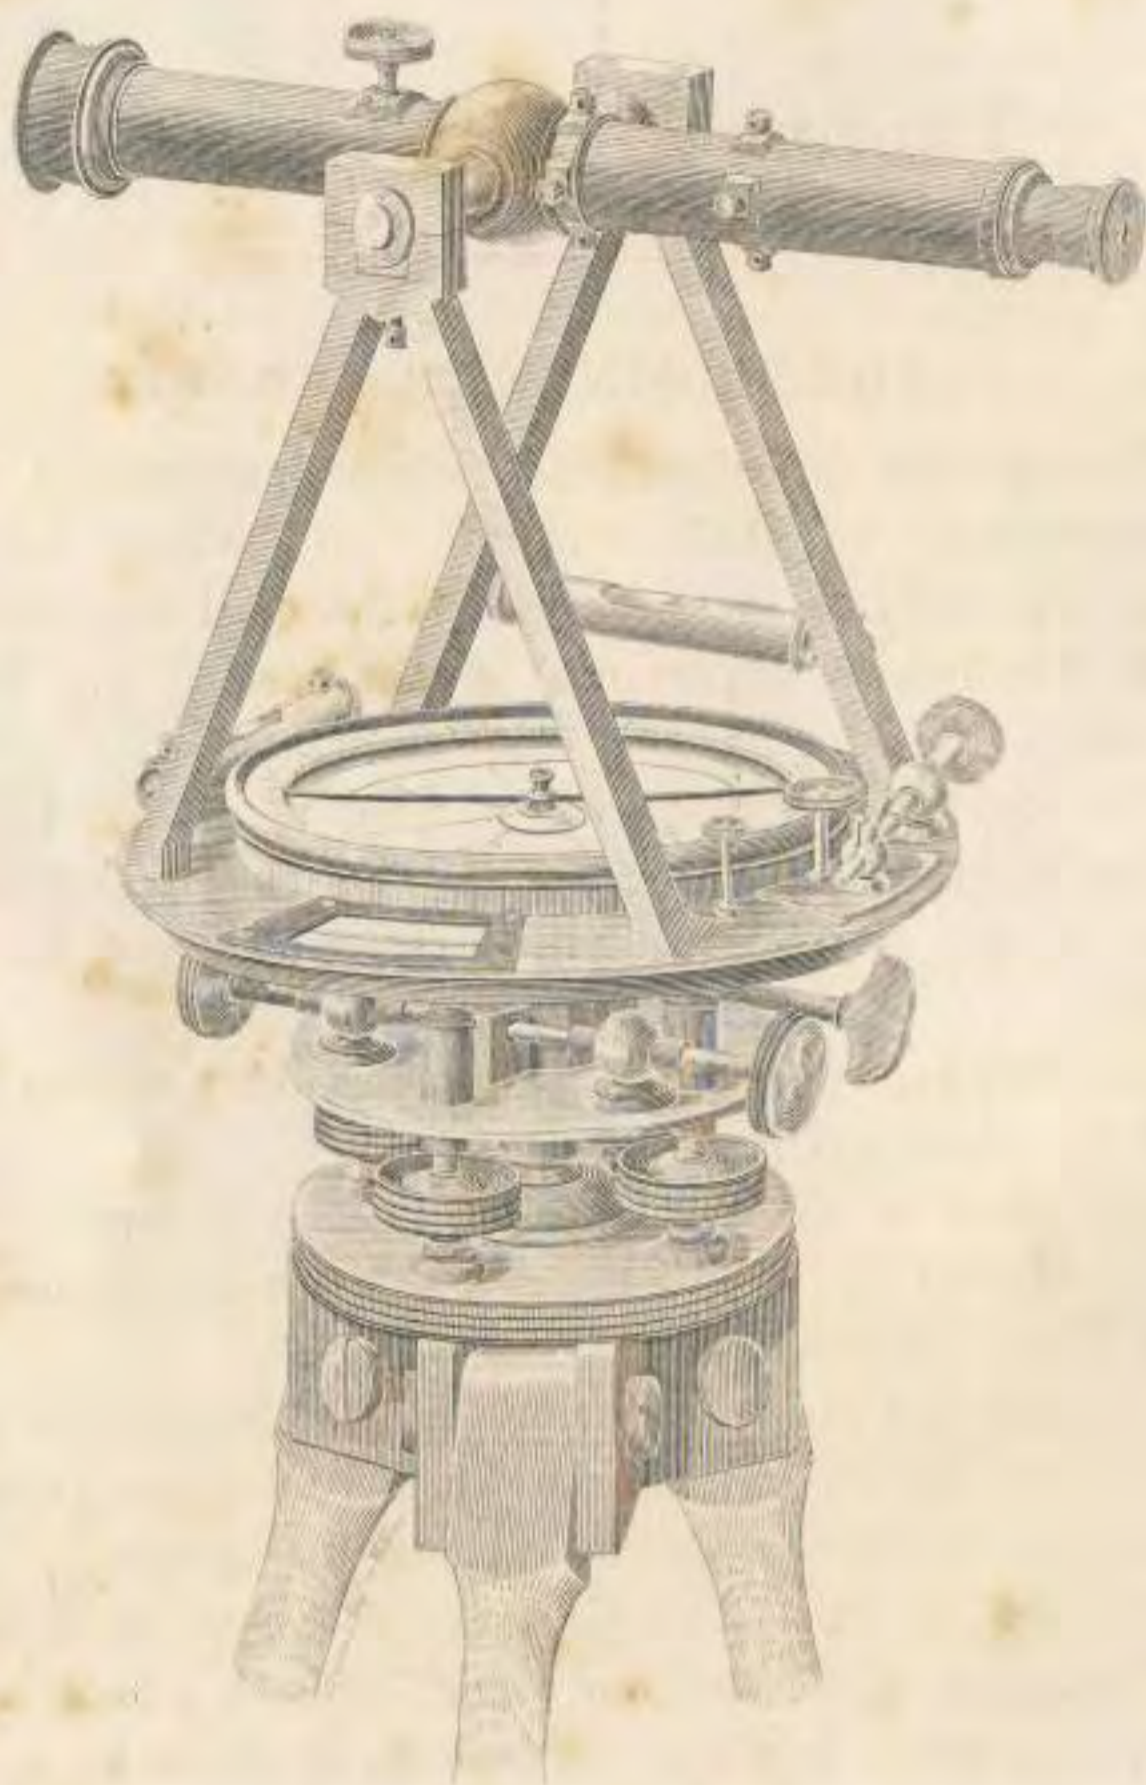

Made by

W. & L. E. GURLEY,

TROY, N. Y.

WENTZ & CO. ALBANY, N. Y.

Engineers' Instruments.

THE ENGINEER'S TRANSIT.

Having now described the various instruments employed in surveying, we shall consider those whose use belongs more especially to the practice of the civil engineer, and of these the first in importance is that termed the Engineer's Transit.

The engraving will convey a good idea of our latest improved Engineer's Transit, and to this the reader will please refer in the following detailed description of its different parts.

THE TELESCOPE is from eleven to twelve inches long, and is of the finest quality.

Like those of our other instruments, it is capable of reversion always at the eye end, and we now most commonly make both ends to reverse.

The rack and pinion movement of the object-glass is usually placed, as shown, on the side of the telescope tube, though sometimes on the top, as the engineer may prefer.

PINION TO THE EYE-GLASS.—We have often adapted to the eye-piece of this and our other Transits, a rack and pinion movement which is placed on the side of the tube, and is very excellent in bringing the cross-wires precisely into focus.

THE SHADE.—A short piece of thin tube called the shade, is always made to accompany this and the previous instruments, and is used to protect the object-glass from the glare

of the sun, or from moisture ; it must be removed whenever the telescope is reversed, unless the telescope is made to reverse at the eye-end, as is generally desired.

The interior construction of the telescope is similar to those already described.

THE STANDARDS are made of well-hammered brass, firm and strong.

On one of them will be seen the little movable box with the capstan head screw underneath, by which the cross-wires are adjusted to trace a vertical line, as described on page 42 in our account of the Vernier Transit.

THE LIMB or divided circle is seven inches in diameter, graduated to half degrees, and read by two opposite verniers to single minutes.

THE VERNIERS are double, reading both ways from the centre, and are placed on the sides of the plate at right angles to the telescope.

THE NEEDLE is five inches long, and is raised by a milled screw head shown in the cut, placed above the plate.

THE CLAMP AND TANGENT SCREWS are also above, so as to be very accessible, and out of the reach of ordinary accidents. The clamping of the limb is effected in the interior, the aperture being covered with a washer to exclude the dust and moisture.

THE LEVELS, as shown in the cut, are above ; they are both adjustable with the ordinary steel pin.

The glass vials used in the levels of this and the Surveyor's Transit, are ground on their upper interior surface, so that the bubble moves very evenly and with great sensitiveness.

THE TRIPOD HEAD of this instrument is made considerably heavier than that of the Surveyor's Transit.

The upper plate is about five inches diameter, made thick and of well hammered brass ; into this are screwed the long

nuts or sockets for the leveling screws, and on the upper surface is seen the clamp, with the two butting tangent screws.

With these the movement is made very slowly, and much more firmly than is possible with a single tangent screw.

The leveling screws are of bell metal, and have a broad three milled head; they rest on the lower plate, in the little cups spoken of in our account of the previous instrument.

In the engraving it will also be seen that the screws are entirely covered above the plate, by little brass caps which protect the threads from dust and corrosion.

The lower plate is a little smaller than the upper, milled on the edge, and made to connect by a screw, with the tripod legs.

This tripod head is attached to the sockets of the limb and vernier plate, and is removed with them, when the instrument is packed in the box for transportation.

The loop for the plumb-bob is connected by a screw to the spindle of the vernier plate, so that it is always suspended from the exact centre of the instrument.

The Attachments of the Transit.

The engraving of the Surveyor's Transit shows the vertical circle of four and a half inches diameter, which is read by a double vernier to minutes, and also the clamp and tangent movement to the axis of the telescope.

These, with the addition of a level on the telescope, are often used with this instrument, though the majority of engineers prefer an instrument with "plain telescope," like that shown in the engraving.

Micrometer.

It is sometimes very convenient in the use of both the Transit and Leveling Instrument, to employ some simple

method of ascertaining the distances of objects without resorting to actual measurements.

This is well effected by what is termed a "Micrometer," by the French called "Stadia," the construction and use of which we have already given on pages 89 — 91, in our account of the Solar Compass.

The two small screws which adjust the movable wire, are placed on opposite sides of the telescope, and to one side of the ordinary cross-wire screws, precisely as shown in fig. 17, and the wire is moved by alternately loosening one and tightening the other, until the two horizontal wires are made to cover the interval desired.

The micrometer wire is furnished, whenever desired, with any of our transits, and without additional charge.

To adjust the Transit.

The adjustments of this instrument and its attachments have been described in our account of those previously considered.

To use the Engineer's Transit.

But little need be added to what has been already given in the previous pages.

THE NEEDLE is of service principally as a rough check upon the readings of the verniers in the measurement of horizontal angles, any glaring mistake being detected, by noticing the angles indicated by both, in the different positions of the telescope.

It may also be used as in the compass, to give the direction in which the lines are run, but its employment is only subsidiary to the general purposes of the Transit.

Size of the Engineer's Transit.

We make two different sizes of this instrument, viz :

THE FIVE-INCH TRANSIT just described, which, exclusive of the tripod legs, weighs about $13\frac{1}{2}$ lbs., and the

FOUR-INCH TRANSIT, precisely similar in style, but about one-fourth smaller and lighter in all its parts.

It has a telescope of about ten inches long, a four-inch needle, and a divided limb of six inches diameter.

Weight of the Attachments.

As it may sometimes be desirable to know the weights of the different extras or attachments, often used in this and the other Transits previously described, we here add them in detail.

Ground level tube, with vial complete... 7½ oz.

Vertical circle, with vernier 6 oz.

Clamp and tangent to axis..... 4 oz.

Besides the simple form of the Engineer's Transit, we also make important modifications, which may be desired by the engineer; a few of these we shall now enumerate.

The Watch Telescope.

A telescope is sometimes attached to a socket, moving in a hollow cylinder which surrounds the lengthened socket of the limb, and is thus capable of moving around under the plates, and of a short vertical motion.

The cylinder which supports it, may be clamped firmly to the limb, and the wires of the telescope thus fixed upon any object, by the tangent movement of the tripod head.

The object of the watch telescope, is to guard against, and detect any inaccuracy arising from the disturbance of the limb, during the progress of an observation, or the measurement of angles.

Thus, if the wires of both telescopes are fixed upon the same object, and the watch telescope kept still upon it, while the vernier plate is unclamped, and the upper telescope shifted to the second point, a reference to the watch telescope will immediately betray any disturbance in the position of the limb.

But, in spite of its excellencies in cases where great nicety is required, the additional weight and complication of the watch telescope, have caused it to be regarded by most American engineers as an incumbrance, rather than an advantage to the Transit.

The Theodolite Axis.

In place of the ordinary axis of the telescope represented in our engraving, we sometimes make one resembling the Y axis of the English Theodolite.

This modification is desirable, in cases where this instrument is intended to subserve the purposes of both level and transit.

In such an arrangement, the telescope is confined in the axis with clips, by loosening which, it may be revolved in the wyes, or taken out and reversed end for end, precisely like that of the leveling instrument.

The standards also allow its transit, or complete revolution in a vertical direction.

In such an instrument, the adjustment of the wires, and level of the telescope, is effected in the same manner as those of the leveling instrument, the tangent movement of the axis serving, instead of the leveling screws, to bring the bubble and wires into position.


With this modification of the Transit, we have also frequently added, that of a small level bar, wyes, &c., into which the telescope may be transferred, making thus a miniature leveling instrument.

This may be placed upon the socket and tripod head of the transit, and thus made capable of taking levels with a good degree of accuracy.

When desirable, a vertical wheel may be placed on the axis of the telescope of this instrument, and thus all the properties of the English Theodolite united with those of the American Transit



20 INCHI Y LEVEL,
Made by
W. & L. E. GURLEY,
TROY, N. Y.

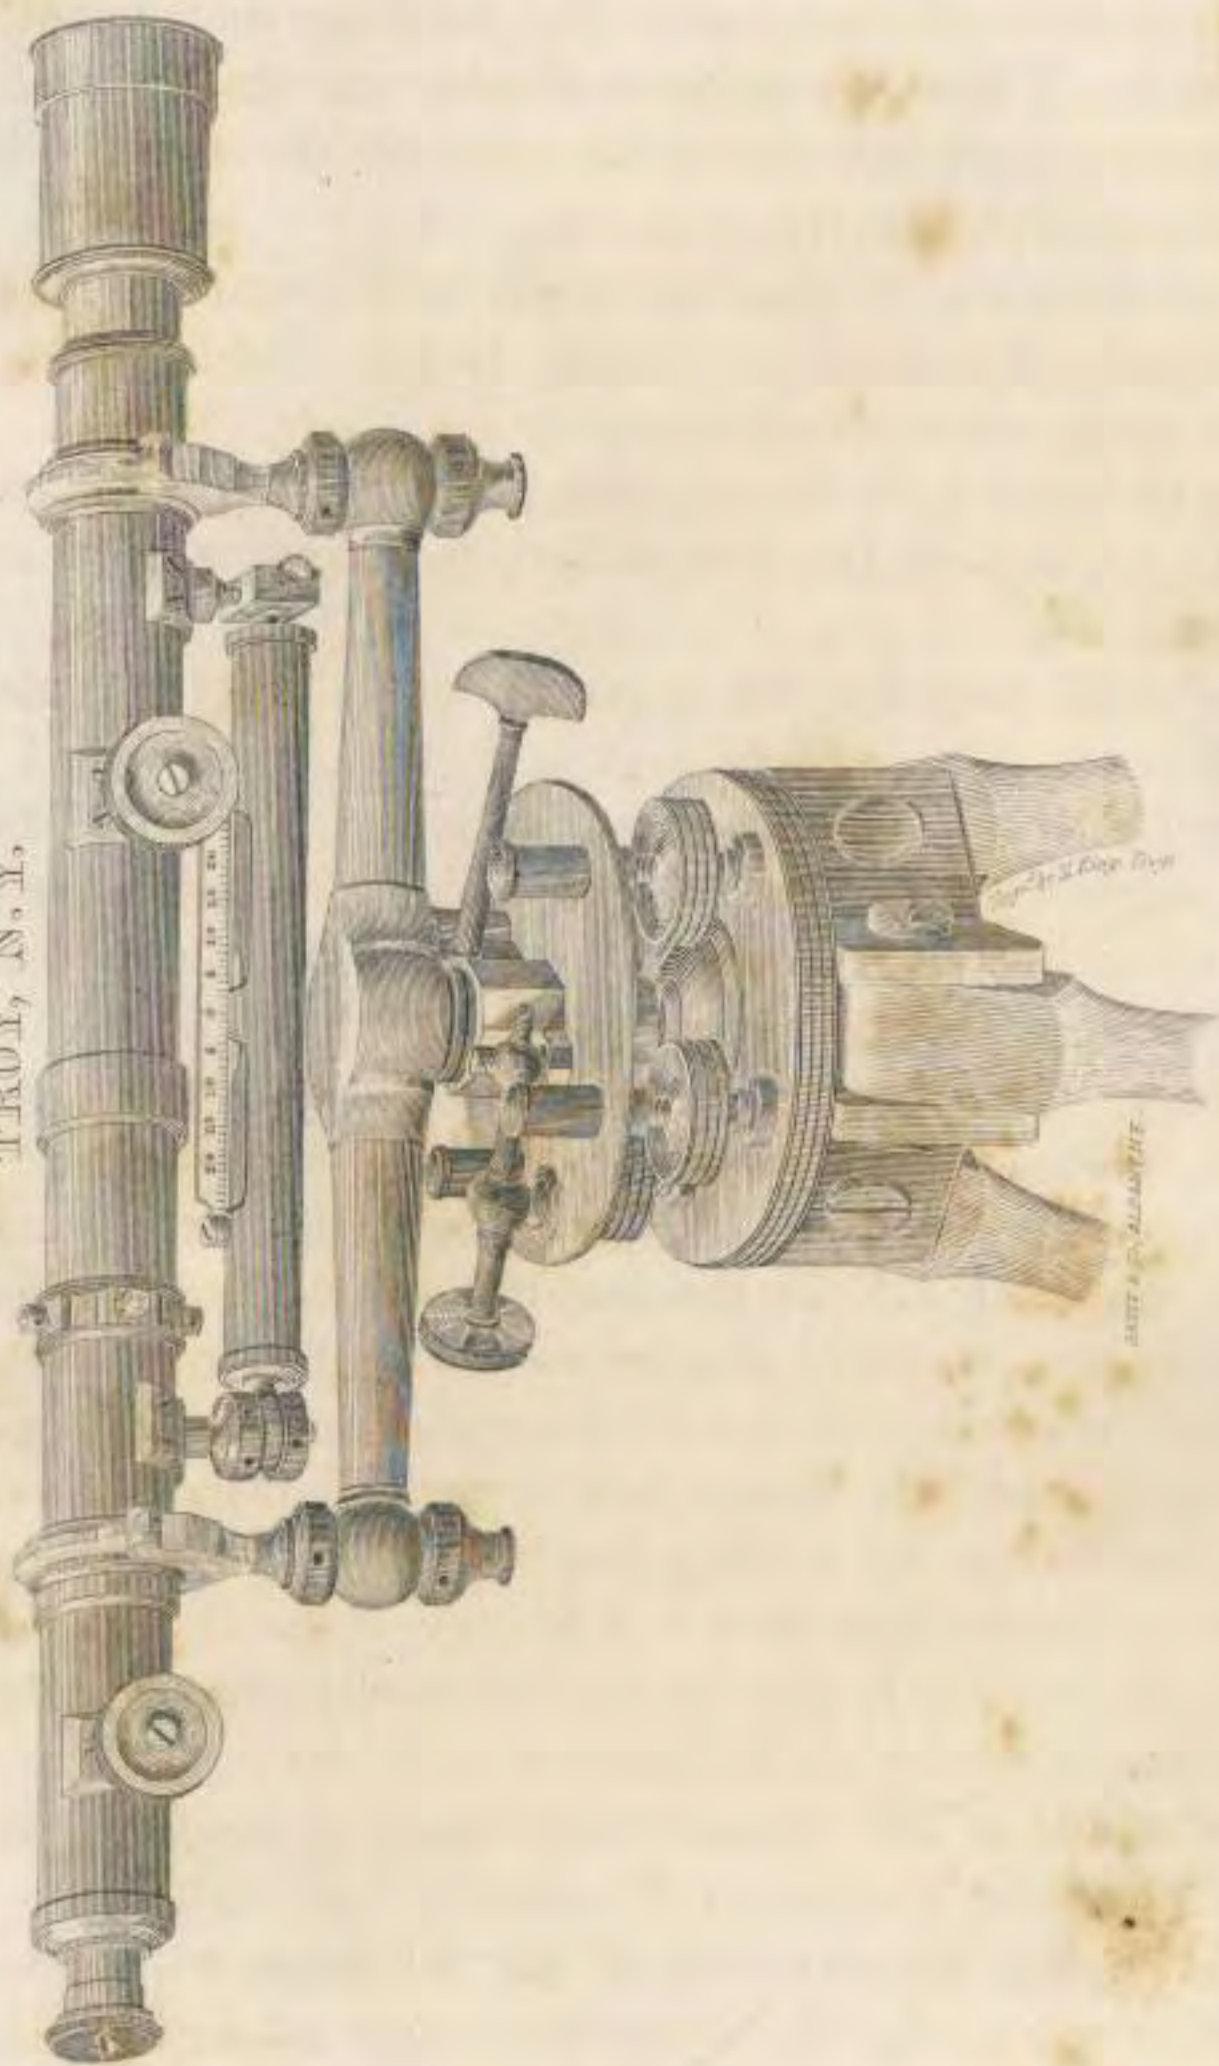

MADE BY ALBANY, N. Y.

W. & L. E. GURLEY

THE LEVELING INSTRUMENT.

Of the different varieties of the leveling instrument, that termed the Y Level, has been almost universally preferred by American engineers, on account of the facility of its adjustment and superior accuracy.

Of these levels we manufacture four different sizes, having telescopes of sixteen, eighteen, twenty, and twenty-two inches long, respectively.

The engraving on the opposite page represents our twenty inch Level, that of the sixteen inch telescope will be shown beyond.

We shall consider the several parts of the instrument in detail :

THE TELESCOPE has at each end a ring of bell-metal, turned very truly and both of exactly the same diameter ; by these it revolves in the wyes, or can be at pleasure clamped in any position when the clips of the wyes are brought down upon the rings, by pushing in the tapering pins.

The telescope has a rack and pinion movement to both object and eye-glasses, an adjustment for centering the eye-piece, shown at A A, in the longitudinal section of the telescope, (page 105,) and another seen at C, C, for ensuring the accurate projection of the object-glass, in a straight line.

Both of these are completely concealed from observation and disturbance by a thin ring which slides over them.

The telescope has also a shade over the object-glass, so made, that whilst it may be readily moved on its slide over the glass, it cannot be dropped off and lost.

The shade of our sixteen inch level, is made to take off, like that of the Engineer's Transit.

The interior construction of the telescope will be readily understood from fig. 21, which represents a longitudinal section, and exhibits the adjustment which ensures the accurate projection of the object-glass slide.


As this is peculiar to our instruments, and is always made by the maker so permanently as to need no further attention at the hands of the engineer, we shall here describe the means by which it is effected, somewhat in detail.

The necessity for such an adjustment will appear, when we state, that it is almost impossible to make a telescope tube, so that it shall be perfectly straight on its interior surface.

Such being the case, it is evident that the object-glass slide which is fitted to this surface, and moves in it, must partake of its irregularity, so that the glass and the line of collimation depending upon it, though adjusted in one position of the slide will be thrown out when the slide is moved to a different point.

To prove this, let any level be selected which is constructed in the usual manner, and the line of collimation adjusted upon an object taken as near as the range of the slide will allow; then let another be selected, as distant as may be clearly seen; upon this revolve the wires, and they will almost invariably be found out of adjustment, sometimes to an amount fatal to any confidence in the accuracy of the instrument. The arrangement adopted by us to correct this imperfection, and which so perfectly accomplishes its purpose, is shown in the adjoining cut, fig. 21.

Here are seen the two bearings of the

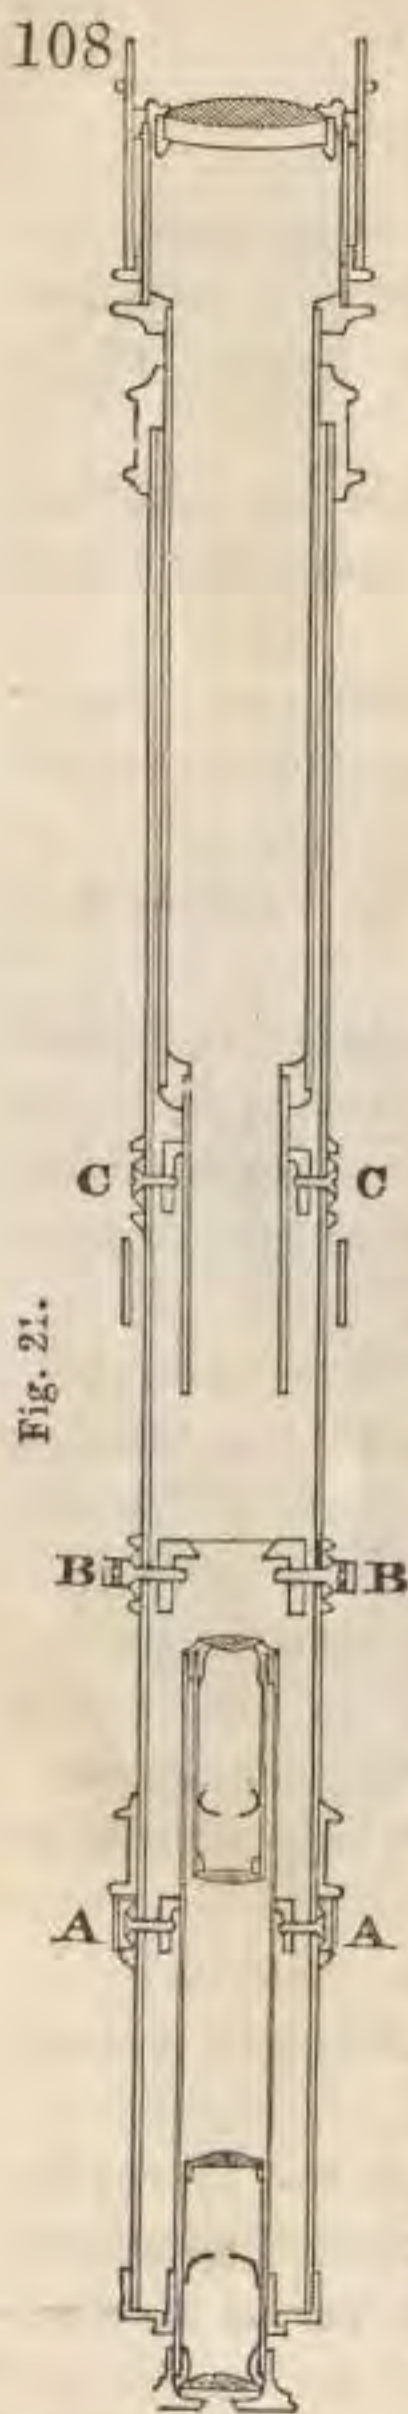

object-glass slide, one being in the narrow bell-metal ring, which slightly contracts the diameter of the main tube, the other in the small adjustable ring, also of bell-metal, shown at C C, and suspended by four screws in the middle of the telescope.

Advantage is here taken of the fact, that the rays of light are converged by the object-glass, so that none are obstructed by the contraction of the slide, except those which diverge, and which ought always to be intercepted, and absorbed in the blackened surface of the interior of the slide.

Now, in such a telescope, the perfection of movement of the slide, depends entirely upon its exterior surfaces, at the points of the two bearings.

These surfaces are easily and accurately turned, concentric, and parallel with each other, and being fitted to the rings, it only remains necessary to adjust the position of the smaller ring, so that its centre will coincide with that of the optical axis of the object-glass.

When this has been once well done, no further correction will be necessary, unless the telescope should be seriously injured.

The manner in which the adjustment of the object-glass slide is effected, will be considered when we come to speak of the other adjustments.

RACK AND PINION.—As seen in the engraving, our Level telescopes are usually furnished with the ordinary rack and pinion movement to both object and eye tubes.

The advantages of an eye-piece pinion, are, that the eye-piece can be shifted without danger of disturbing the telescope, and that the wires are more certainly brought into distinct view, so as to avoid effectually any error of observation, arising from what is termed the instrumental parallax.

The position of the pinion on the tube is varied in different instruments according to the choice of the engineer.

We usually place our object slide pinion on the side—both of Transit telescopes, and of those of the Level. The pinion of the eye tube is always placed on the side of the telescope.

THE LEVEL or ground bubble tube is attached to the under side of the telescope, and furnished at the different ends with the usual movements, in both horizontal and vertical directions.

The aperture of the tube, through which the glass vial appears, is about five and one-fourth inches long, being crossed at the centre by a small rib or bridge, which greatly strengthens the tube.

The level scale which extends over the whole length, is graduated into spaces a little coarser than tenths of an inch, and figured at every fifth division, counting from zero at the centre of the bridge; the scale is set close to the glass.

The bubble vial is made of thick glass tube, selected so as to have an even bore from end to end, and finely ground on its upper interior surface, that the run of the air bubble may be uniform throughout its whole range.

The sensitiveness of a ground level, is determined best by an instrument called a level tester, having at one end two Y's to hold the tube, and at the other a micrometer wheel divided into hundredths, and attached to the top of a fine threaded screw which raises the end of the tester very gradually.

The number of divisions passed over on the perimeter of the wheel, in carrying the bubble over a tenth of the scale, is the index of the delicacy of the level. In the tester which we use, a movement of the wheel ten divisions to one of the scale, indicates the degree of delicacy generally preferred for railroad engineering.

For canal work practice, a more sensitive bubble is often

desired, as for instance, one of seven or eight divisions of the wheel, to one of the scale.

THE WYES of our levels are made large and strong, of the best bell-metal, and each have two nuts, both being adjustable with the ordinary steel pin.

The clips are brought down on the rings of the telescope tube by the Y pins, which are made tapering, so as to clamp the rings very firmly.

THE LEVEL BAR is made round, of well hammered brass, and shaped, so as to possess the greatest strength in the parts most subject to sudden strains.

Connected with the level bar is the head of the tripod socket.

THE TRIPOD SOCKET is compound; the interior spindle, upon which the whole instrument is supported, is made of steel, and nicely ground, so as to turn evenly and firmly in a hollow cylinder of bell-metal; this again, has its exterior surface fitted and ground to the main socket of the tripod head.

The bronze cylinder is held upon the spindle by a washer and screw, the head of this having a hole in its centre, through which the string of the plumb bob is passed.

The upper part of the instrument, with the socket, may thus be detached from the tripod head; and this, also, as in the case of all our instruments, can be unscrewed from the legs, so that both may be conveniently packed in the box.

A little under the upper parallel plate of the tripod head, and in the main socket, is a screw which can be moved into a corresponding crease, turned on the outside of the hollow cylinder, and thus made to hold the instrument in the tripod, when it is carried upon the shoulders.

It will be seen from the engraving, that the arrangement just described allows long sockets, and yet brings the whole instrument down as closely as possible to the tripod head, both objects of great importance in the construction of any instrument.


THE TRIPOD HEAD has the same plates and leveling screws, as that described in the account of the Engineer's Transit; the tangent screw, however, is commonly single.

For our sixteen inch level we make a smaller tripod head, resembling that used with the lighter Engineer's Transit.

THE Y LEVEL.

SIXTEEN INCH TELESCOPE.

Fig. 22.

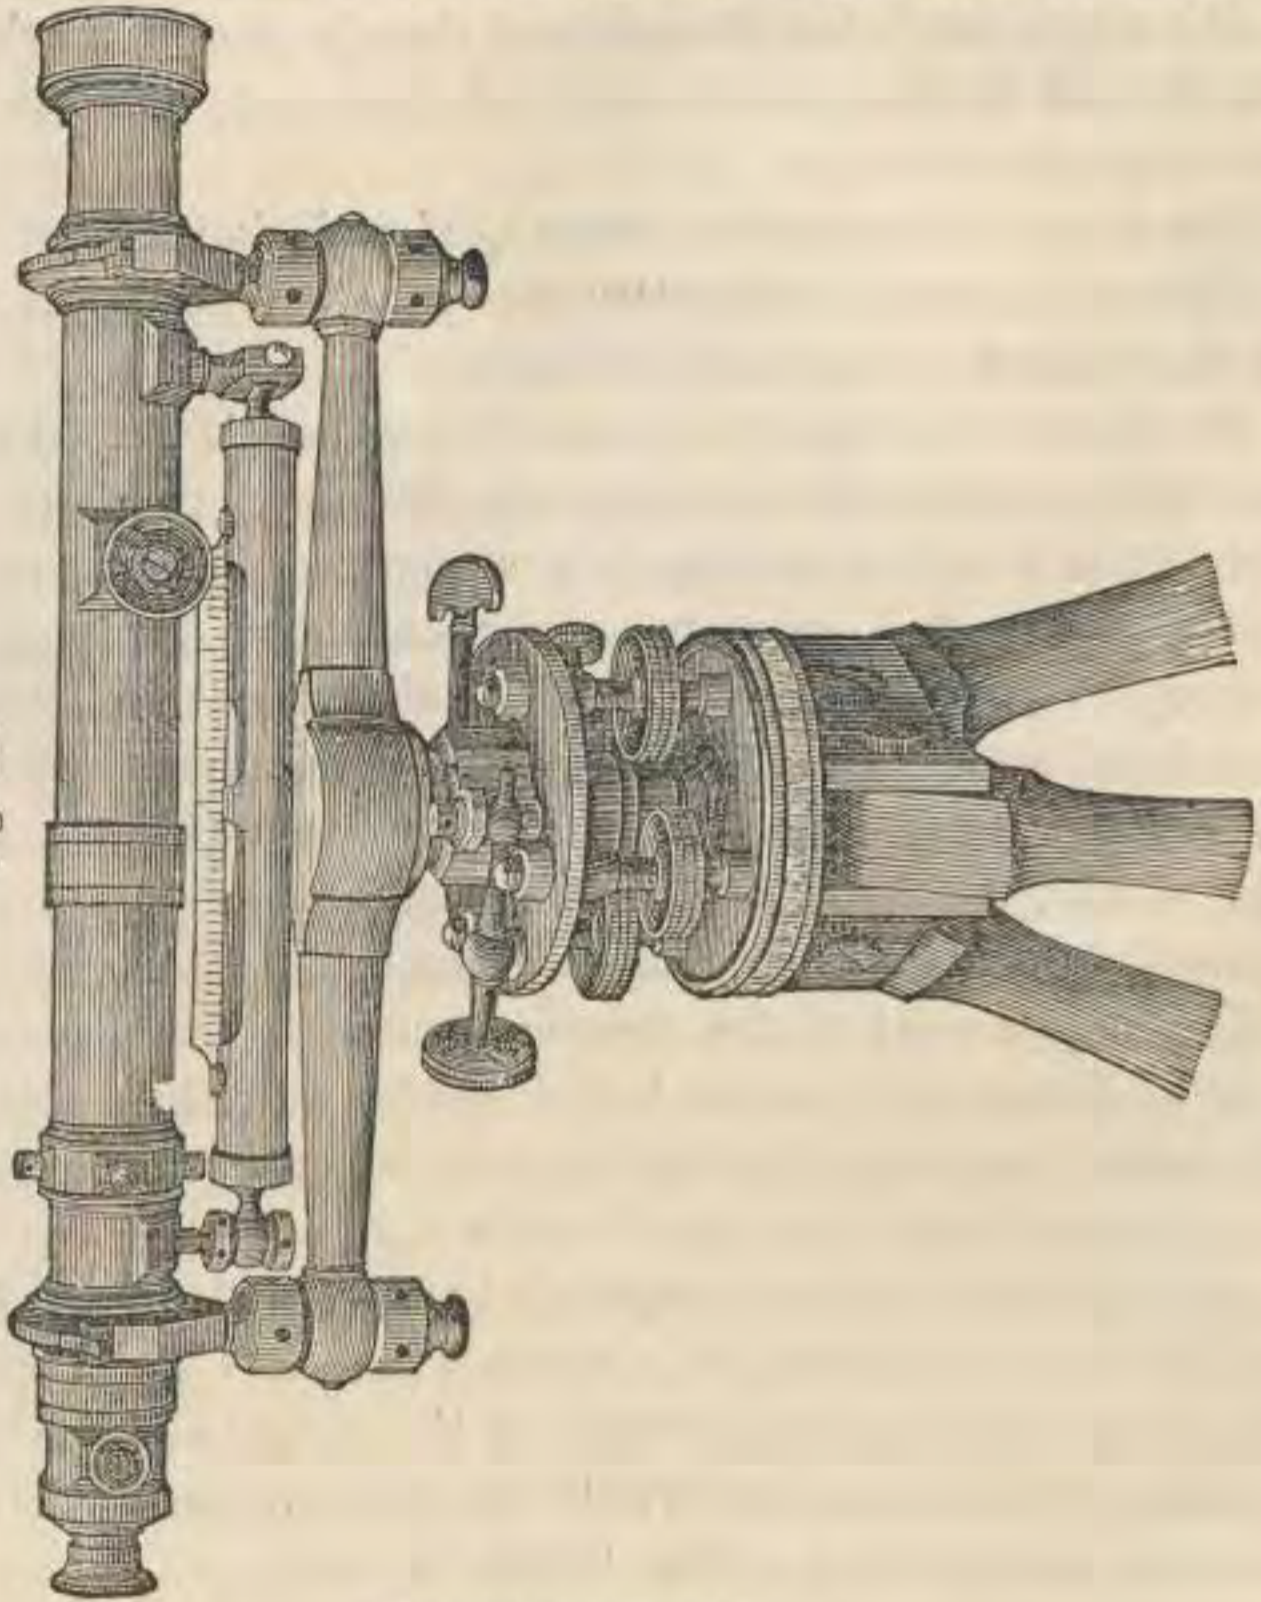

The Adjustments

Having now completed the description of the different parts of the Leveling Instrument, we are ready to proceed with their adjustments, and shall begin with that of the object-slide, which, although always made by the maker, so

permanently as to need no further attention at the hands of the engineer, unless in cases of derangement by accident, is yet peculiar to our instruments and therefore not familiar to many engineers.

TO ADJUST THE OBJECT SLIDE.—The maker selects an object as distant as may be distinctly observed, and upon it adjusts the line of collimation, in the manner hereafter described, making the centre of the wires to revolve without passing either above or below the point or line assumed.

In this position, the slide will be drawn in nearly as far as the telescope tube will allow.

He then, with the pinion head, moves out the slide until an object, distant about ten or fifteen feet, is brought clearly into view; again revolving the telescope in the Y's, he observes whether the wires will reverse upon this second object.

Should this happen to be the case, he will assume, that as the line of collimation is in adjustment for these two distances, it will be so for all intermediate ones, since the bearings of the slide are supposed to be true, and their planes parallel with each other.

If however, as is most probable, either or both wires fail to reverse upon the second point, he must then, by estimation, remove half the error by the screws C C, (fig. 21,) at right angles to the hair sought to be corrected, remembering at the same time, that on account of the inversion of the eye-piece, he must move the slide in the direction which apparently increases the error. When both wires have thus been treated in succession, the line of collimation is adjusted on the near object, and the telescope again brought upon the most distant point; here the tube is again revolved, the reversion of the wires upon the object once more tested, and the correction, if necessary, made in precisely the same manner.

He proceeds thus, until the wires will reverse upon both objects in succession; the line of collimation will then be in adjustment at these and all intermediate points, and by bringing the screw heads, in the course of the operation, to a firm bearing upon the washers beneath them, the adjustable ring will be fastened so as for many years to need no further adjustment.

When this has been completed, the thin brass ferule is slipped over the outside ring, concealing the screw heads, and avoiding the danger of their disturbance by an inexperienced operator.

In effecting this adjustment it is always best to bring the wires into the centre of the field of view, by moving the little screws A A (fig. 21,) working in the ring which embraces the eye-piece tube.

Should the engineer desire to make this adjustment, it will be necessary to remove the bubble tube, in order that the small screw immediately above its scale may be operated upon with the screw driver.

The adjustment we have now given is preparatory to those which follow, and are common to all leveling instruments of recent construction, and are all that the engineer will have to do with in using our own instruments. What is still necessary then is—

1. *To adjust the line of collimation*, or in other words, to bring both wires into the optical axis, so that their point of intersection will remain on any given point, during an entire revolution of the telescope.

2. *To bring the level bubble parallel* with the bearings of the Y rings, and with the longitudinal axis of the telescope.

3. *To adjust the wyes*, or to bring the bubble into a position at right angles to the vertical axis of the instrument.

To ADJUST THE LINE OF COLLIMATION, set the tripod firmly, remove the Y pins from the clips, so as to allow the tele-

scope to turn freely, clamp the instrument to the tripod head, and by the leveling and tangent screws, bring either of the wires upon a clearly marked edge of some object, distant from one to five hundred feet.

Then with the hand carefully turn the telescope half way around, so that the same wire is compared with the object assumed.

Should it be found above or below, bring it half way back by moving the capstan head screws at right angles to it, remembering always the inverting property of the eye-piece; now bring the wire again upon the object and repeat the first operation until it will reverse correctly.

Proceed in the same manner with the other wire until the adjustment is completed.

Should both wires be much out, it will be well to bring them nearly correct before either is entirely adjusted.

When this is effected, slip off the covering of the eye-piece centering screws, shown in the sectional view (fig. 21) at A A, and move each pair in succession with a small screw driver, until the wires are brought into the centre of the field of view.

The inversion of the eye-piece does not affect this operation, and the screws are moved direct

To test the correctness of the centering, revolve the telescope, and observe whether it appears to shift the position of an object.

Should any movement be perceived, the centering is not perfectly effected.

It may here be repeated, that in all telescopes the position and adjustment of the line of collimation depends upon that of the object-glass; and therefore, that the movement of the eye-piece does not effect the adjustment of the wires in any respect.

When the centering has been once effected it remains per-

the tripod head, the bubble will reverse over each pair of screws in any position.

Should the engineer be unable to make it perform correctly, he should examine the outside socket carefully to see that it sets securely in the main socket, and also notice that the clamp does not bear upon the ring which it encircles.

When these are correct, and the error is still manifested, it will, probably, be in the imperfection of the interior spindle.

After the adjustments of the level have been effected, and the bubble remains in the centre, in any position of the socket, the engineer should carefully turn the telescope in the wyes, and sighting upon the end of the level, which has the horizontal adjustments along each side of the wye, make the tube as nearly vertical as possible.

When this has been secured, he may observe, through the telescope, the vertical edge of a building, noticing if the vertical hair is parallel to it; if not, he should loosen two of the crosswire screws at right angles to each other, and with the hand on these, turn the ring inside, until the hair is made vertical; the line of collimation must then be corrected again, and the adjustments of the level will be complete

To use the Level.

When using the instrument the legs must be set firmly into the ground, and neither the hands nor person of the operator be allowed to touch them, the bubble should then be brought over each pair of leveling screws successively, and leveled in each position, any correction being made in the adjustments that may appear necessary.

Care should be taken to bring the wires precisely in focus, and the object distinctly in view, so that all errors of parallax may be avoided.

This error is seen when the eye of an observer is moved to either side of the centre of the eye-piece of a telescope, in which the foci of the object and eye-glasses, are not brought precisely upon the cross-wires and object; in such a case, the wires will appear to move over the surface, and the observation will be liable to inaccuracy.

In all instances the wires and object, should be brought into view so perfectly, that the spider lines will appear to be fastened to the surface, and will remain in that position however the eye is moved.

If the socket of the instrument becomes so firmly set in the tripod head as to be difficult of removal in the ordinary way, the engineer should place the palm of his hand under the wye nuts at each end of the bar, and give a sudden upward shock to the bar, taking care also to hold his hands so as to grasp it the moment it is free.

Weight of Leveling Instruments.

The average weights of the different sizes of this instrument, exclusive of the tripod legs, are as follows :

16-inch telescope.....	11½ lbs
18-inch do	12 do
20-inch do	12½ do
22-inch do	13 do

THE BUILDER'S LEVEL.

This instrument, shown in the engraving, is of much more simple and compact construction than those already described.

It has a telescope of from eleven to twelve inches long, provided with the usual facilities for adjustment, resting upon the ends of the bar by two similar faces of the octagonal shaped prisms, which surround the tube at either end.

The telescope is held on the bar by a stout screw at each end; the heads of these screws are shown on the under side of the bar, and are bored to admit the usual adjusting pin.

A strong spiral spring is placed in a recess in the upper side of each end of the bar, and serves in connection with the screws, to effect the third adjustment of the Level.

These springs are of course removed, while the other adjustments are in progress, and the telescope allowed to rest directly upon the bar.

The level is placed above the telescope and adjustable at either end by two nuts, as shown.

The instrument is best used upon the adjusting tripod, as represented, but may also be placed upon a simple ball spindle and used in connection with the leveling socket, shown in our account of the Solar Compass.


The adjustments of this instrument are made in the same order, and almost precisely in the same manner, as those of the Engineers' Level, described on pages 114-118, and need but a brief description.

(1.) The line of collimation is adjusted, by making the wires reverse upon any given point, when the telescope is turned half-way around, so as to rest upon opposite faces of the prisms.

(2.) The Level is adjusted, by turning the telescope end for end upon the bar, the bubble being made to come to the centre in both positions.

(3.) The bubble is brought into a position at right angles

BUILDER'S LEVEL.

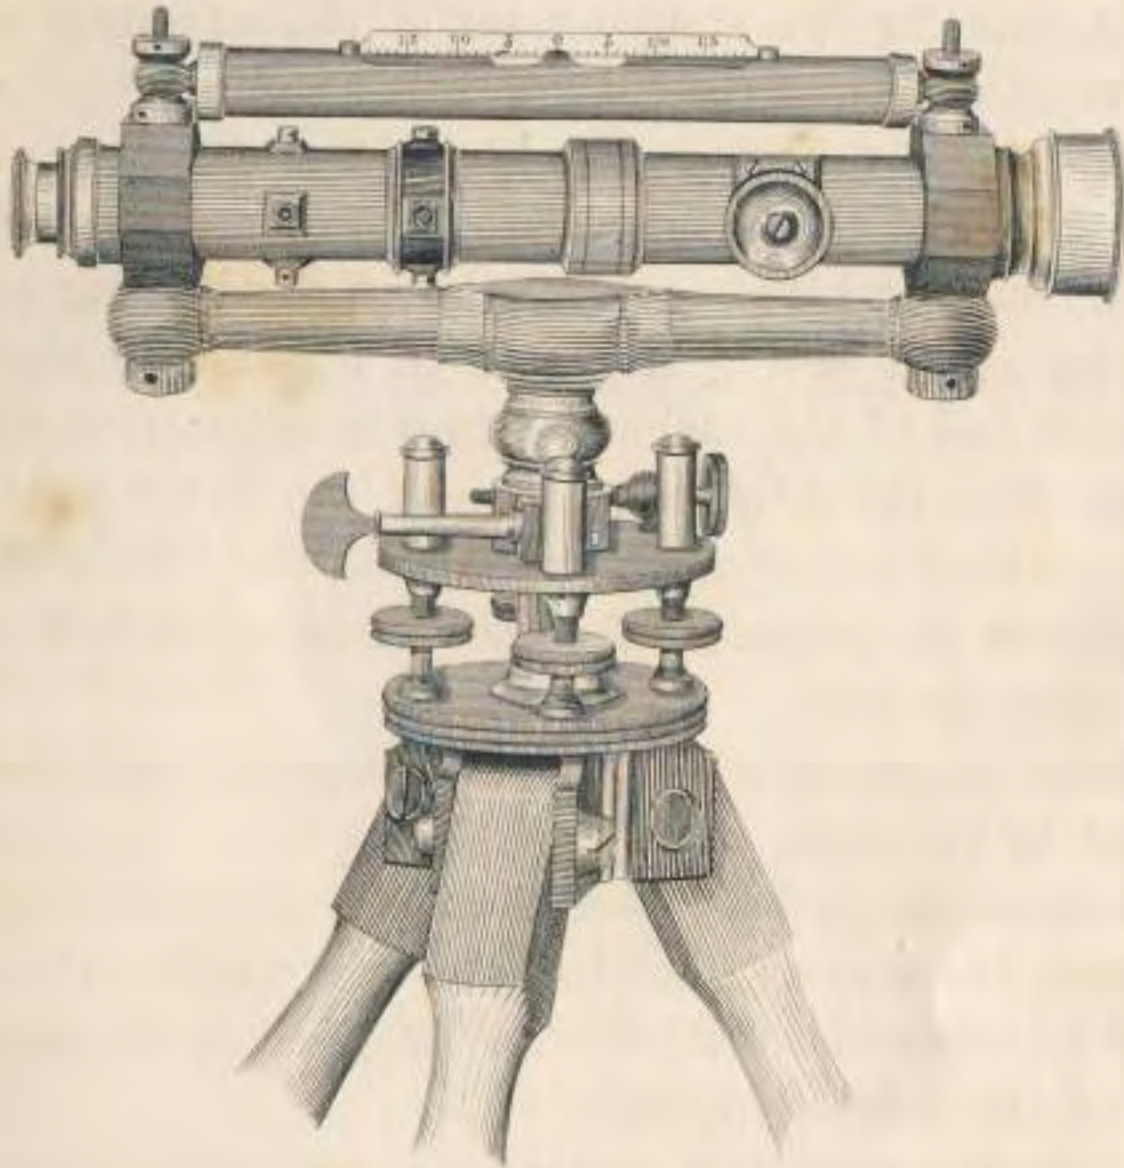


Made by

W. & L. E. GURLEY,

TROY, N. Y.

GAVTY & CO. ALBANY, N. Y.

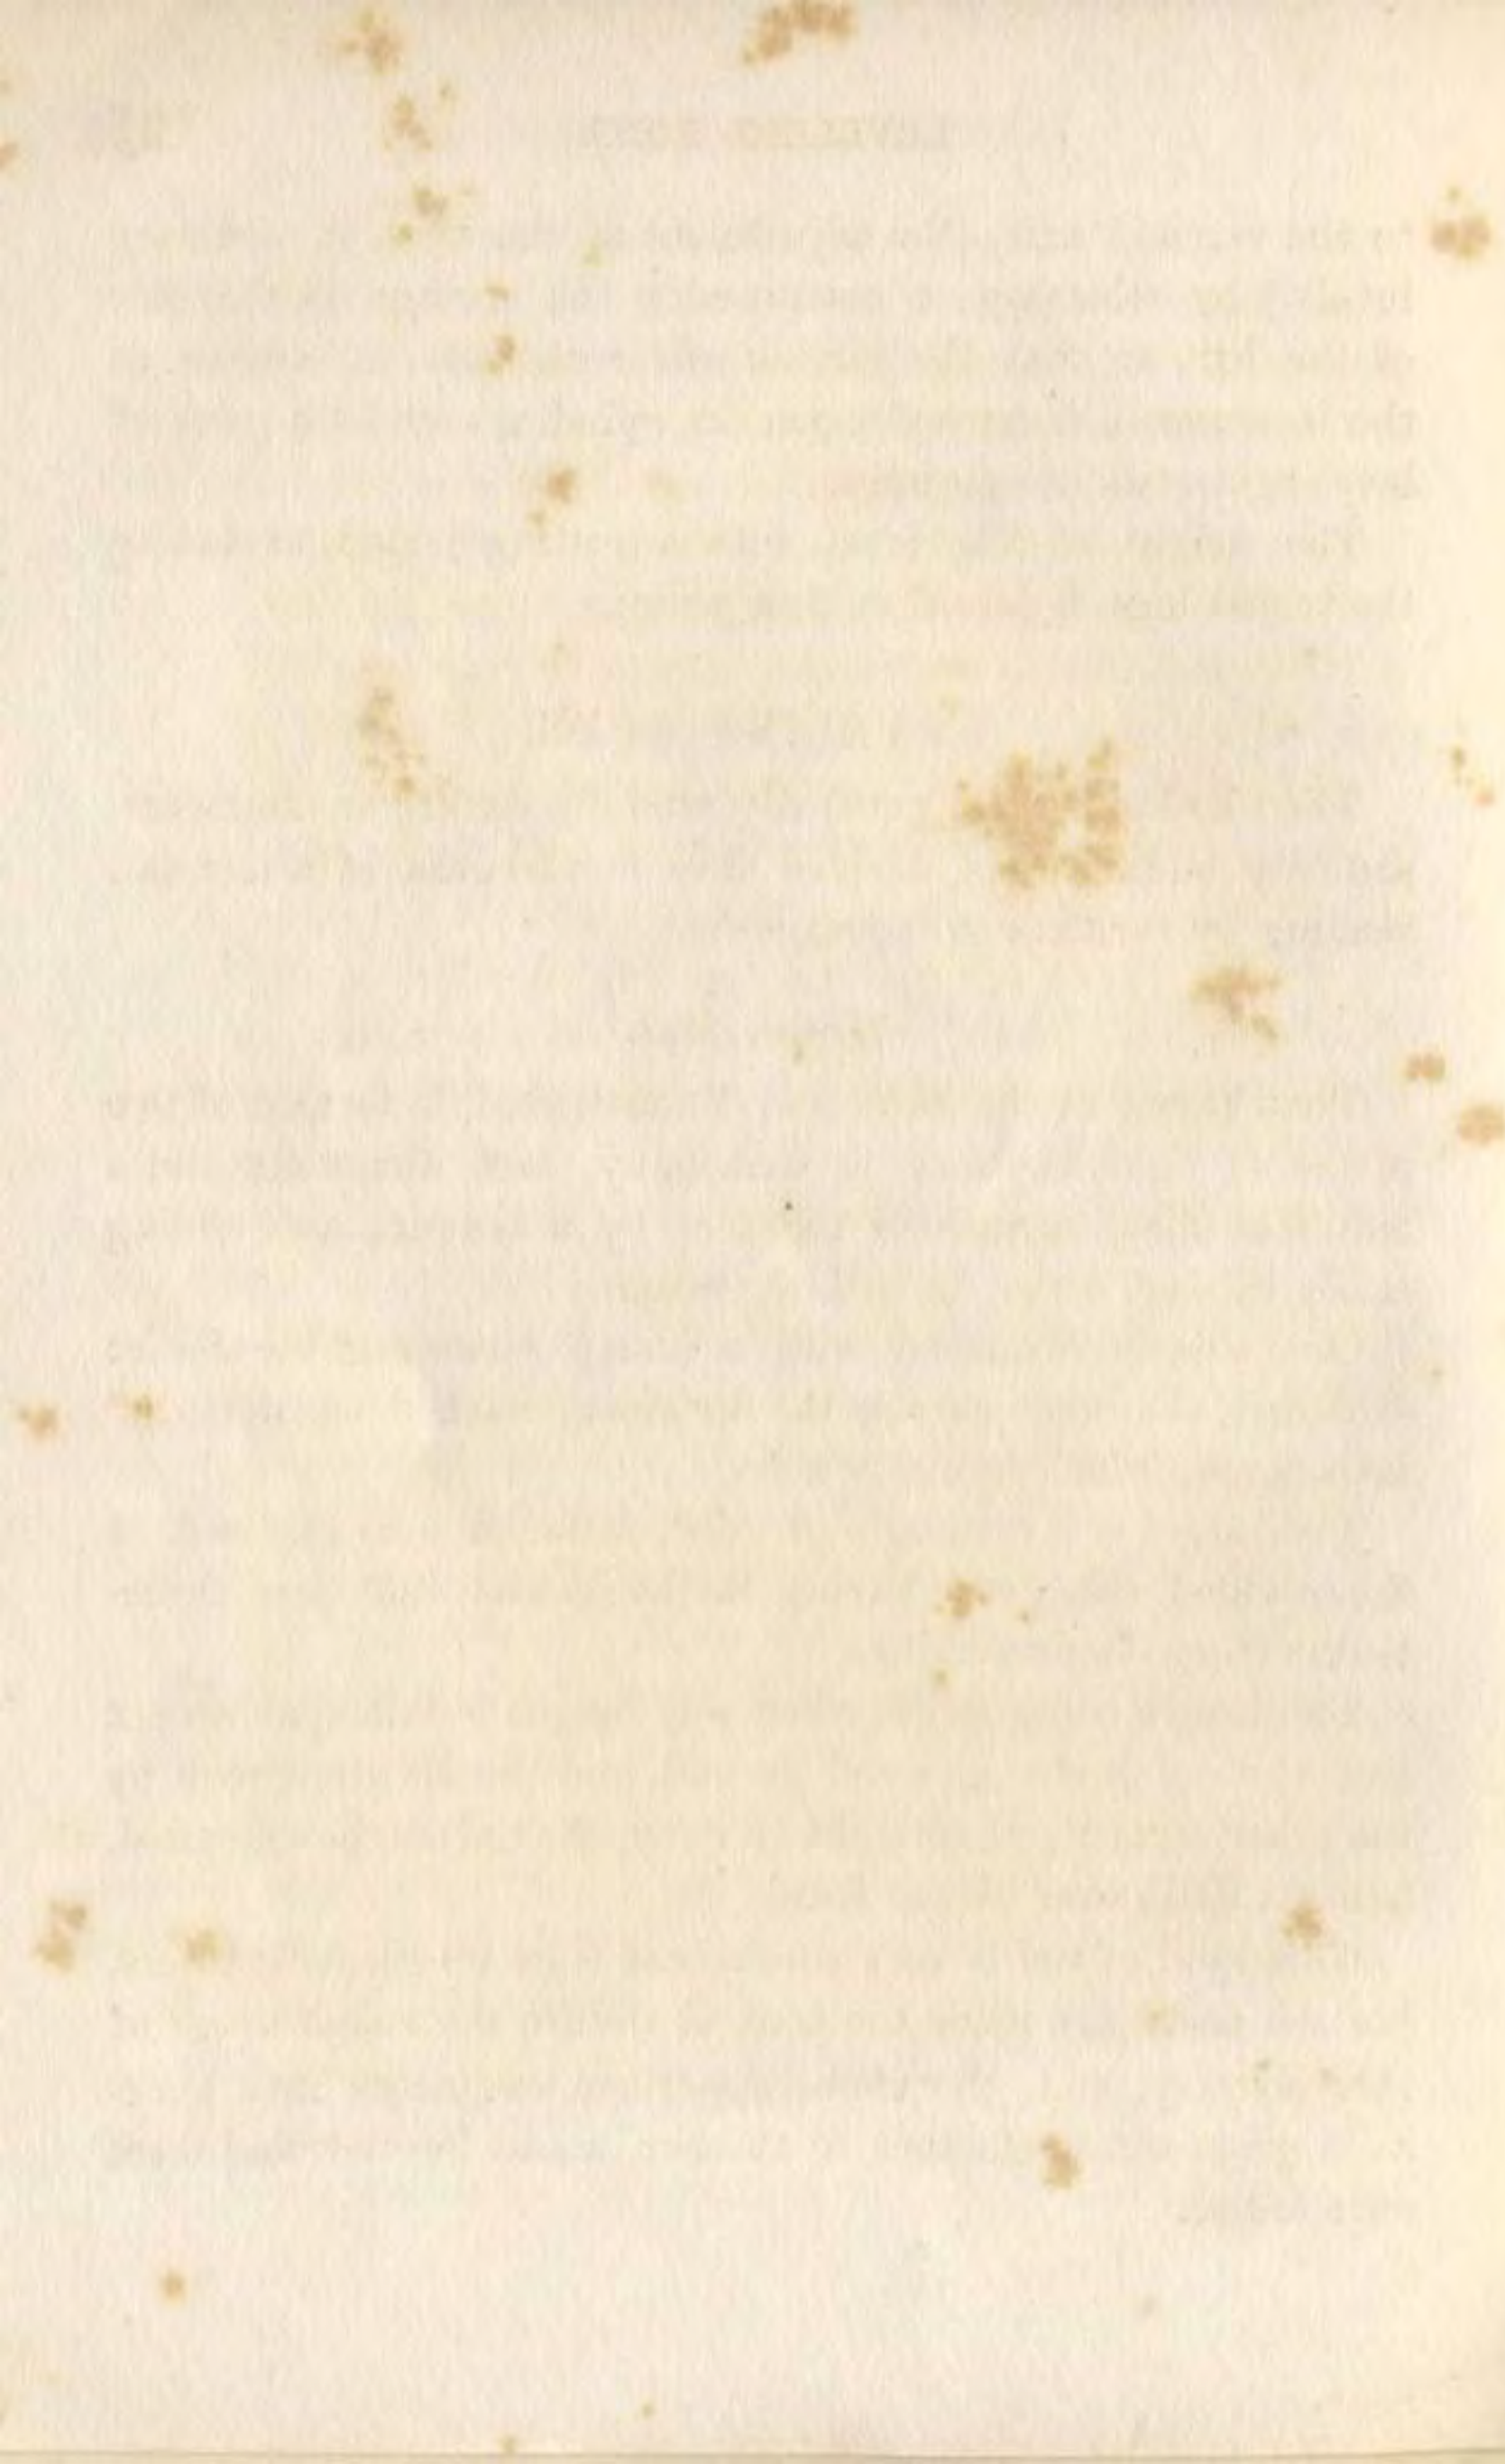

to the vertical axis, (the adjustment of the wyes in ordinary levels,) by releasing or compressing the springs at the ends of the bar, so that the bubble will come into the centre, as the instrument is turned upon its spindle, over both pairs of leveling screws in succession.

The weight of this level, with adjusting tripod, excluding the tripod legs, is less than four pounds.

LEVELING RODS.

The two kinds most generally used by American engineers, are both sliding rods, divided into hundredths of a foot and reading by verniers to thousandths.

Boston Rod.

That known as the Boston or Yankee Rod, is formed of two pieces of light baywood or mahogany, each about six and a half feet long, connected together by a tongue, and sliding easily by each other, in both directions.

One side is furnished with a clamp screw and vernier at each end, the other carries the divisions, marked on strips of satin wood, inlaid on either side.

The target is a rectangle of wood, fastened near one end of the divided side, and having its horizontal line just three-tenths from the extremity.

The target being fixed, when any height is taken above six feet, the rod is changed end for end, and the divisions read by the other vernier; the height to which the rod can be extended, being a little over eleven feet.

This kind of rod is very convenient from its great lightness, but the parts are made too frail to endure the rough usage of this country, and, therefore, American engineers have generally given the preference to another, made heavier and more substantial.

The New York Rod.

This rod, which is shown in the engraving, as cut in two, so that the ends may be exhibited, is made of satin wood, in two pieces like the former, but sliding one from the other, the same end being always held on the ground, and the graduations starting from that point.

The graduations are made to tenths and hundredths of a foot, the tenth figures being black, and the feet marked with a large red figure.

The front surface, on which the target moves, reads to six and a half feet; when a greater height is required, the horizontal line of the target is fixed at that point, and the upper half of the rod, carrying the target, is moved out of the lower, the reading being now obtained by a vernier on the graduated side, up to an elevation of twelve feet.


The mountings of this rod are differently made by different manufacturers. We shall give those which we have adopted.

The target is round, made of thick brass, having, to strengthen it still more, a rib raised on the edge, which also protects the paint from being defaced.

The target moves easily on the rod, being kept in any position by the friction of the two flat plates of brass which are pressed against two alternative sides, by small spiral springs, working in little thimbles attached to the band which surrounds the rod.

There is also a clamp screw on the back, by which it may be securely fastened to any part of the rod.

Fig. 24.

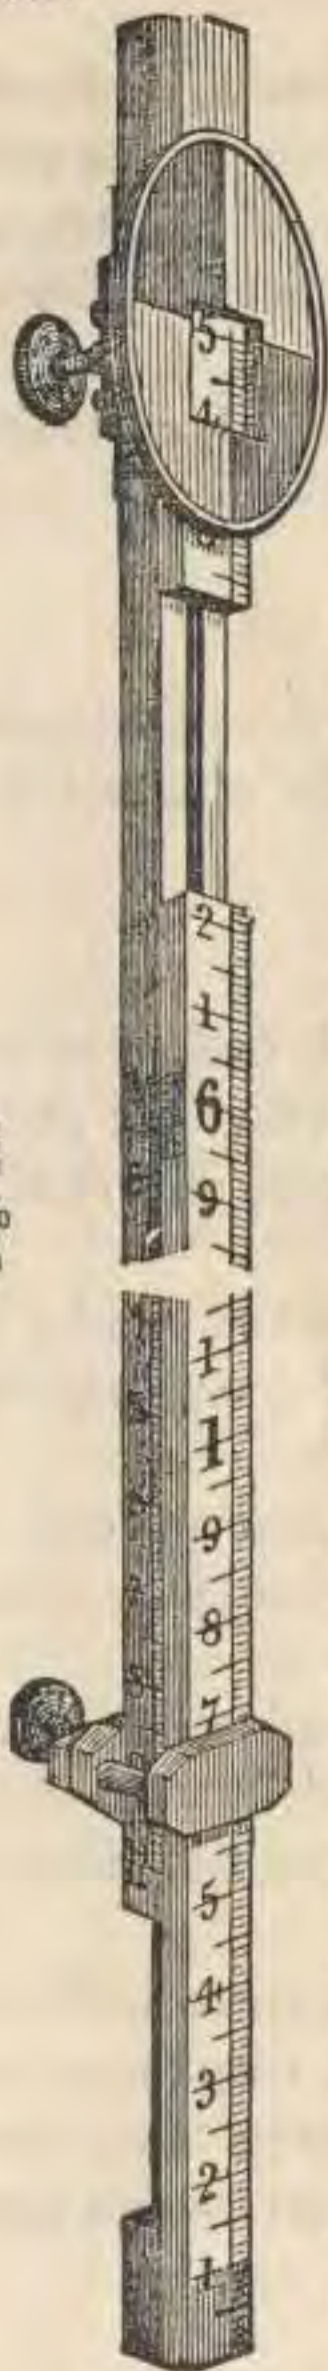

The face of the target is divided into quadrants, by horizontal and vertical diameters, which are also the boundaries of the alternate colors with which it is painted.

The colors usually preferred are white and red: sometimes white and black.

The opening in the face of the target is a little more than a tenth of a foot long, so that in any position a tenth or a foot figure, can be seen on the surface of the rod.

The right edge of the opening is chamfered, and divided into ten equal spaces, corresponding with nine hundredths on the rod; the divisions start from the horizontal line which separates the colors of the face.

The vernier like that on the other side of the rod, reads to thousandths of a foot.

The clamp, which is screwed fast to the lower end of the upper sliding piece, has a movable part which can be brought by the clamp screw firmly against the front surface of the lower half of the rod, and thus the two parts immovably fastened to each other without marring the divided face of the rod.

THE MINER'S COMPASS.

Fig. 25.



Consists essentially of a dipping needle, about $2\frac{1}{2}$ inches long, which inclines towards any mass of iron and thus discovers its position.

When used for tracing ore, the observer should hold the ring in his hand, and keep the needle north and south, standing with his face to the west.

If held horizontal, it serves, of course, as a Pocket Compass, having also a brass cover not shown in the cut.

IMPROVED MINER'S COMPASS.—A much more desirable style of this instrument, having a three inch needle suspended in jewel centres, and with glass on both sides, has almost entirely superseded the compass shown in the cut. We have also added a stop by which the needle can be checked in its vibrations and secured when the compass is carried.

The Improved Miner's Compass is placed in a mahogany case, and used in the manner above described.

THE POCKET COMPASS.

Fig. 26.



This little instrument, shown with jacob-staff socket in fig. 26, though not used in extensive surveys like the larger compasses we have described, is found very convenient in making explorations, or in retracing the lines of government surveys, as in locating land warrants, &c.

The sights are made with a slote and a hair, on opposite sides; they also have joints near the base, so as to fold over

each other above the glass, when the compass is packed in its case.

The circle is graduated to degrees, and figured from 0 to 90 each way, as in larger instruments.

The needle is suspended upon a jeweled centre, and is raised by the lifter shown in the cut.

The jacob-staff socket is often used with the compass, being screwed to the under side, and detached at pleasure.

The mountings are all that are furnished, the staff itself being easily made out of a common walking stick.

We make two sizes of the pocket compass, differing mainly in the needle, which in one is two and a half, in the other three and a half inches long.

The larger size is also sometimes provided with two small levels, let into the face of the compass; these are not shown in the cut.

VERNIER POCKET COMPASS.—This instrument has also a three and a half inch needle, and is furnished with a vernier outside, reading to five minutes, by which the sights can be placed at any desired angle with the line of zeros, so as to set off the variation of the needle, as with the Vernier Compass.

The compass is furnished with jacob-staff mountings; sometimes, if desired, with a very light tripod; has two levels, and is neatly packed in a mahogany case.

It makes a most excellent and portable little instrument in locations, and is especially useful for the surveyor of government lands.

General Matters.

TRIPODS.

In the tripods of all our instruments, the upper part of the leg, is flattened, and fitted closely in the surfaces of the brass cheek pieces.

The cheeks are made very broad, and give a firm hold upon the leg, which may be tightened at any time by screwing up the bolts which pass through the top of the legs; this is especially necessary after the surface of the wood has been much worn.

The legs are round, and taper in each direction from a swell, turned about one-third the way down, from the head to the point.

The point, or shoe, is a tapering brass ferule, having an iron end; it is cemented, and riveted firmly to the wood.

The legs of all our tripods are about four feet eight inches long, from head to point. We make three sizes of tripods, which we will now separately describe.

1. THE COMPASS TRIPOD, seen in part in the cut of the vernier transit, and having the brass plate to which the cheeks are attached, three and three-fourth inches in diameter, and legs which are about one inch at the top, one and three-eighths at the swell, and seven-eighths at the bottom.

The legs are usually made of cherry, sometimes of mahogany, and the tripod is used with the various kinds of compasses, and with the vernier transit.

2. THE MEDIUM SIZED TRIPOD, shown with the surveyor's transit, and having a plate of same diameter as above, but

with the cheeks made considerably broader, by curving at each end; the legs being also about an eighth of an inch larger throughout.

This tripod has mahogany legs, and is used with the surveyor's transit, the light engineer's transit, and the sixteen inch level.

3. THE HEAVY TRIPOD, shown with the engineer's transit, having a brass plate of four and one-fourth inches diameter, with extended cheek pieces, and with legs one and three-eighths of an inch at the top, one and three-fourths at the swell, and one and an eighth at the point.

The heavy size has also mahogany legs, and is used with the engineer's transit, and larger leveling instruments.

Lacquering.

All instruments are covered with a thin varnish, made by dissolving gum shellac in alcohol, and applied when the work is heated.

As long as this varnish remains, the brass surface will be kept from tarnishing, and the engineer, by taking care not to rub his instrument with a dusty cloth, or to expose it to the friction of his clothes, can preserve its original freshness for a long time.

Bronze Finish.

Instead of the ordinary brass finish, some engineers prefer instruments blackened or bronzed. This is done with an acid preparation, after the work has been polished, and gives the instrument a very showy appearance, besides being thought advantageous on account of not reflecting the rays of the sun as much as the ordinary finish.

When well lacquered, the bronzing will last a considerable time, but as soon as it becomes a little worn the appearance of the instrument is much worse than one finished in the usual style.

CHAINS.

Surveyors' Chains.

FOUR POLE CHAINS.—The ordinary surveyor's chain is sixty-six feet, or four poles long, composed of one hundred links, each connected to the other by two rings, and furnished with tally marks at the end of every ten links.

In all the chains we manufacture, the rings are oval, are sawed, and well closed, the ends of the wire forming the hook being also filed and bent close to the link, so as to avoid the danger of "kinking."

A link in measurement includes a ring at each end.

The handles are of brass, and each forms part of the end links, to which it is connected by a nut, by which also the length of the chain is adjusted.

The tallies are also of brass, and have one, two, three, or four, notches, as they are ten, twenty, thirty, or forty, links, from either end; the fiftieth link is rounded, so as to distinguish it from the others.

TWO POLE CHAINS.—In place of the four pole chain just described, many surveyors prefer one of two rods or thirty-three feet long, having but fifty links, and counted by its tallies from one end in a single direction.

SNAP FOR ALTERING CHAINS.—We often make four pole chains so arranged, that by detaching a steel snap in the middle, the two parts can be separated, and then one of the handles being removed in the same manner, and transferred to the forty-ninth link, a two pole chain is readily obtained. This modification is made whenever desired, and without any additional charge.

SIZES OF WIRE.—Our surveyors' chains are made of the best refined iron wire, of sizes No. 8 or 10, as may be preferred; the diameter of No. 10 wire being about one-eighth of an inch, and that of No. 8 wire nearly a sixteenth larger.

Engineers' Chains

Differ from the preceding, in that the links are each 12 inches long; the wire, also, is usually much stronger.

They are either fifty or one hundred feet long, and are furnished with handles, tallies, &c., and sometimes with a swivel in the middle to avoid being twisted in use.

In place of the round rings commonly made, we have substituted in these, and our other chains, rings of an oval form, and find them almost one-third stronger, though made of the same kind of wire.

SIZES OF WIRE.—The wire used for these chains is commonly of No. 5 or 6; the first being nearly one-fourth of an inch in diameter, while No. 6 wire is about one-sixteenth smaller.

The wire is of the first quality, and the whole chain is made in the most accurate and substantial manner.

Steel Chains.

Chains made of steel wire, though more costly than those which we have just described, are yet often preferred on account of their greater lightness and strength.

They are made of any desired size or length, generally of No. 10, rarely of No. 8 wire, and are very stiff and strong.

BRAZED STEEL CHAINS.—A very portable and excellent measure is made, by a light steel chain, each link and ring of which is securely *brazed*, after being united together and tested the wire is also tempered.

Supplement to Manual.

DRAWING INSTRUMENTS.

To guide the surveyor and engineer in the selection of Drawing Instruments, we here add a detailed description, with illustrations and prices of the separate pieces, and cases of the different kinds in general use.

Those we shall first mention are of Swiss manufacture, and are of the finest quality and finish.

The Brass Instruments are used in Schools and elementary practice.

The fine German Silver Instruments are of the best German make, intended for Engineers, Architects and Machinists :

SWISS DRAWING INSTRUMENTS,

OF GERMAN SILVER, EXTRA FINE FINISHED.


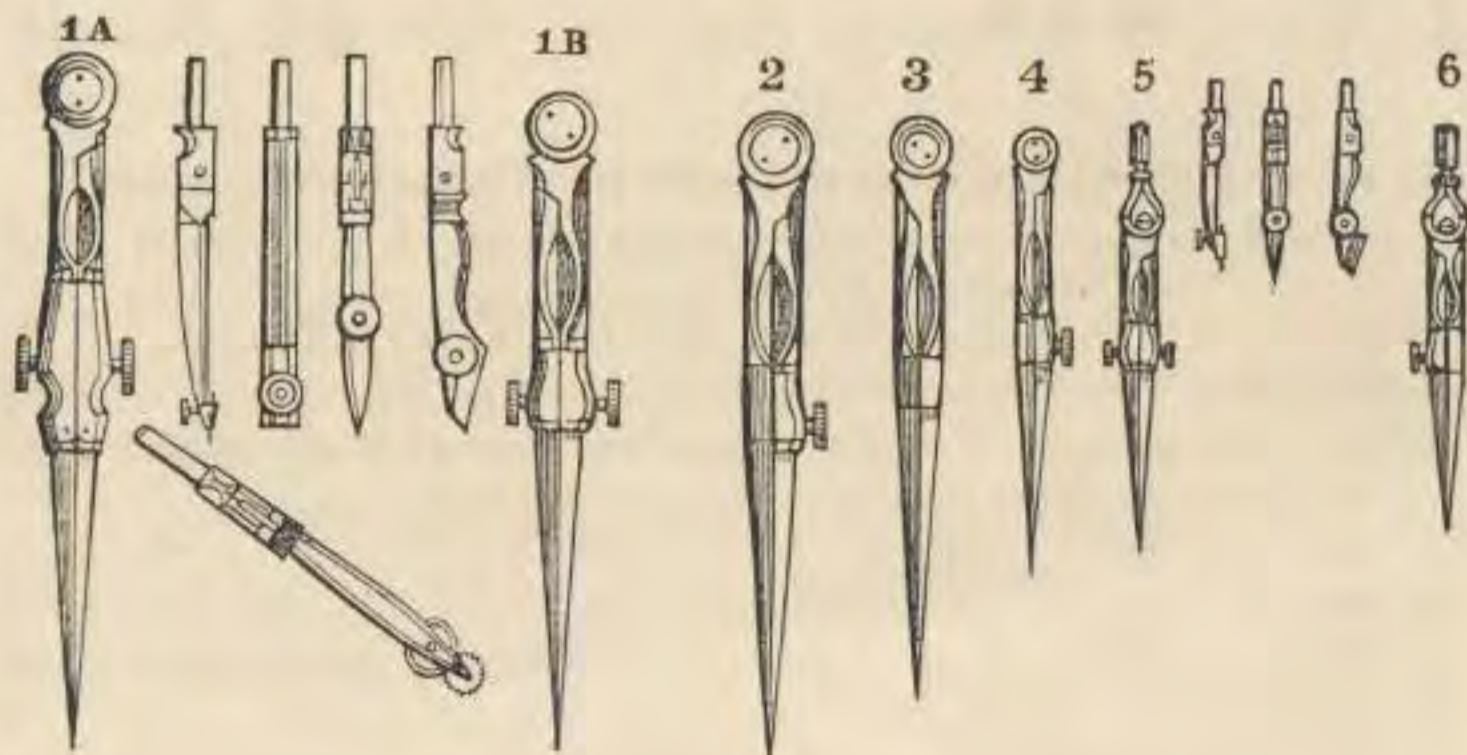


Figure No.	Price.
1 A. Drawing Compass, joints in legs, $6\frac{1}{2}$ to 7 inches long, with pen, pencil-holder, needle-point, lengthening bar and dot. pen....	\$10 50
1 B. Drawing Compass, 6 inches long, with pen, pencil-holder, lengthening bar and needle point.....	8 50
2. Hair Spring Dividers, 5-6 inch	3 25
3. Plain Dividers, $4\frac{1}{2}$ inch.....	2 00
3. Plain Dividers, 5-6 inch.....	2 50
4. Hair Dividers, $4\frac{1}{2}$ inch	2 75



5. Drawing Compass, 4 inch, with pen, pencil-holder, and needle point	6 00
6. Proportional Compass, with rack.....	11 00
7. Proportional Compass, with full divisions for lines and circles..	13 00
7. The same, with Micrometer screw.....	14 00
8. Beam Compass, 19-20 inches long, in two German Silver bars...	13 25
8. The same, 20 inches long, in 3 German Silver bars	15 00
8. The same, 36 do 4 do	18 00
8. The same, 54 do 4 do	22 00
9. Triangular Compass.....	4 80
10. Dotting Pen.....	2 60
11. Road Pen, \$2.60 to ..	3 75

Figure No.	Price.
12. Pocket Dividers	\$2 50
13. Whole and Half Dividers	4 00
14 A. Universal Compass, with points to shift.....	7 75
14 B. Universal Compass, with points to TURN.....	8 50

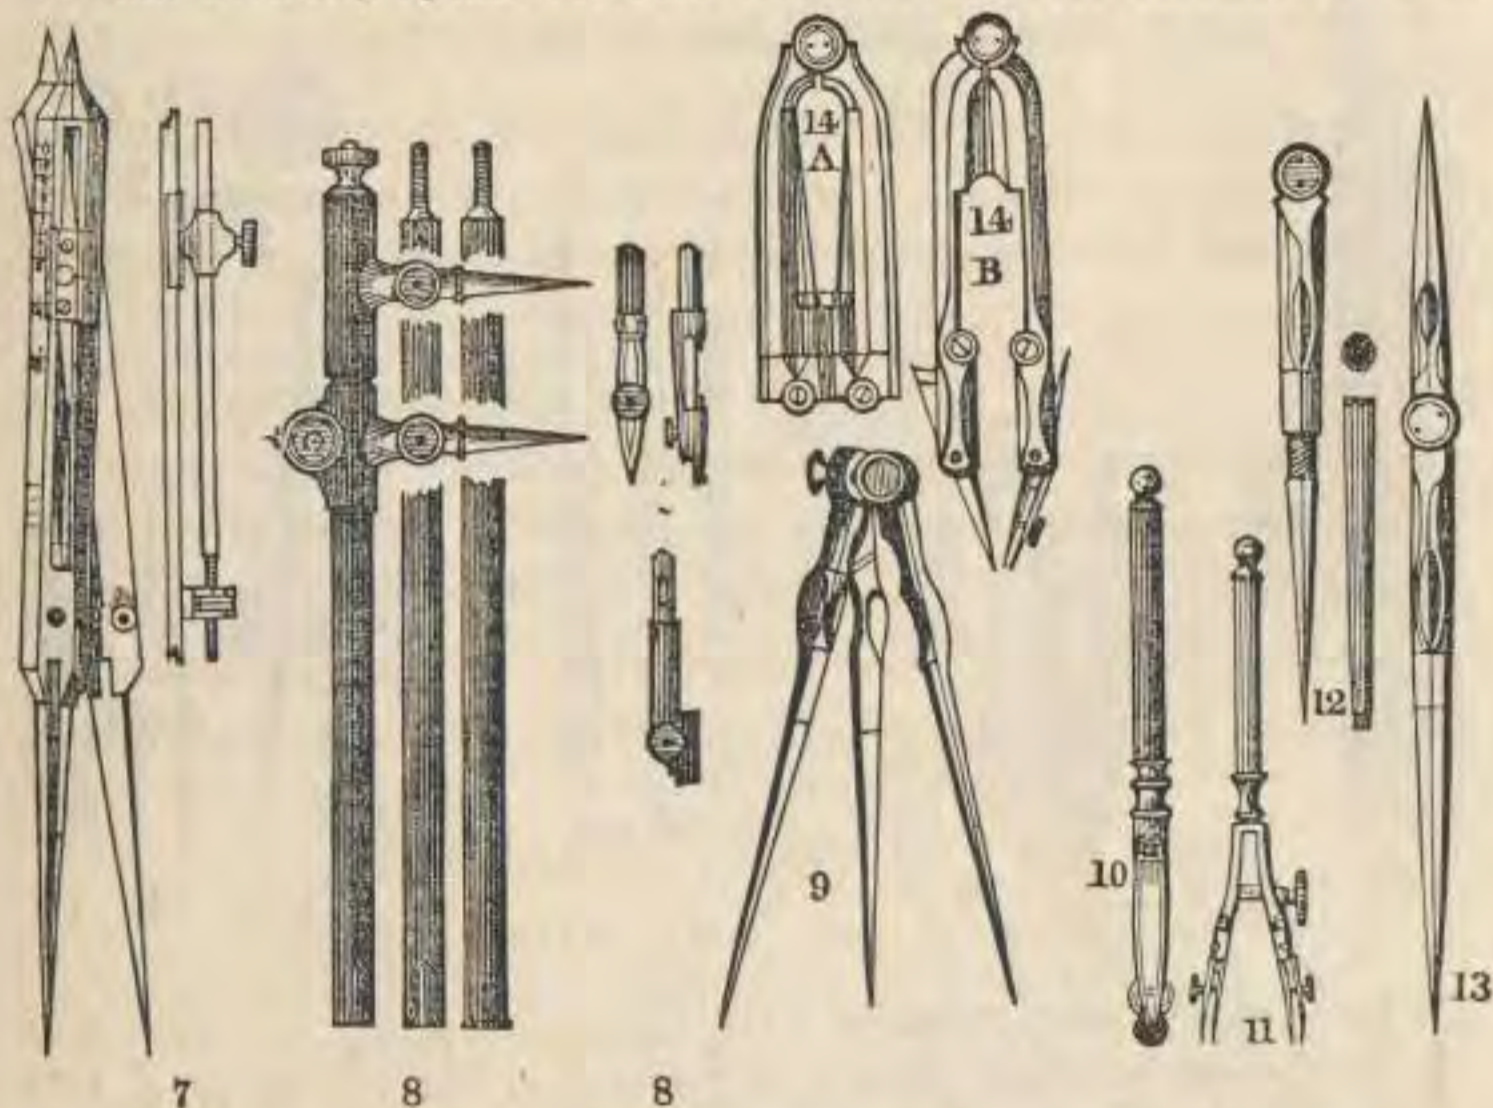


27



22


23

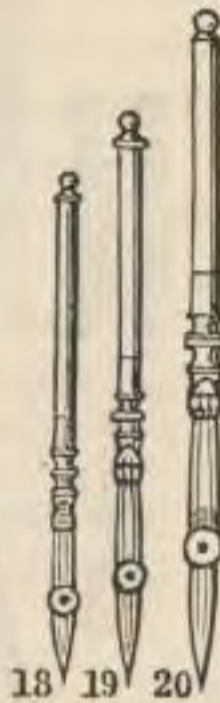

18

19


20

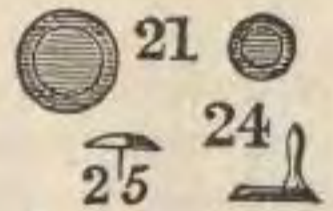

21

24

25

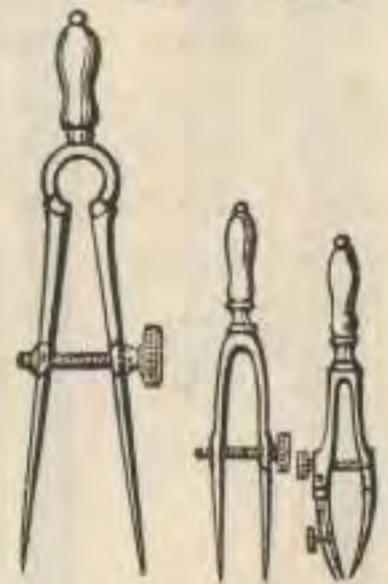


15

16

17

15. Large Steel Spring Dividers, 5 to 6-inch.....	3 25
16. Small Steel Stepping Dividers, 3½ inches	1 75
17. Small Steel Compass, with pen, do	2 25
17. Small Steel Bow Pencil, do	2 25
18. Drawing Pen, with joint, 4¼ inches long.....	1 50
19. do do 5¼ do	1 75
20. do do 6 do	2 00
21. Horn Centre, with German Silver frame	45
22. Bow Pen.....	2 75
23. Bow Pen, with pencil-holder.....	3 50
24. German Silver Centre, with handle	50
25. German Silver Paper Pins, per dozen.....	85
25. do Steel do do	85
27. Eccentric rule.....	3 00

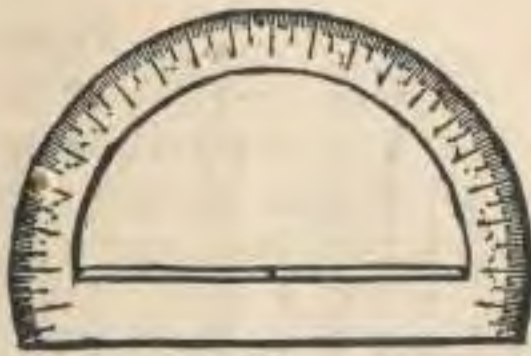


28



28

Figure No.	Price.
28. Horn Protractors, 4-inch, 25 cents; 5-inch, 50 cents; 6-inch, 75 cents; 7-inch	\$1 00
28. Protractor, German Silver, 5 $\frac{1}{4}$ -inch diameter, $\frac{1}{2}$ circle, $\frac{1}{2}$ degrees, center on outer edge	2 50
28. Protractor, German Silver, 6 $\frac{1}{4}$ -inch diameter, $\frac{1}{2}$ circle, $\frac{1}{2}$ degrees, center on outer edge	3 25
28. Protractor, German Silver, 6 $\frac{1}{4}$ -inch diameter, $\frac{1}{2}$ circle, $\frac{1}{4}$ degrees, center on outer edge	4 00
28. Protractor, German Silver, 5 $\frac{1}{4}$ -inch diameter, $\frac{1}{2}$ circle, $\frac{1}{2}$ degrees, center on inner edge	2 75
28. Protractor, German Silver, 6 $\frac{1}{4}$ -inch diameter, $\frac{1}{2}$ circle, $\frac{1}{4}$ degrees, center on inner edge	4 50

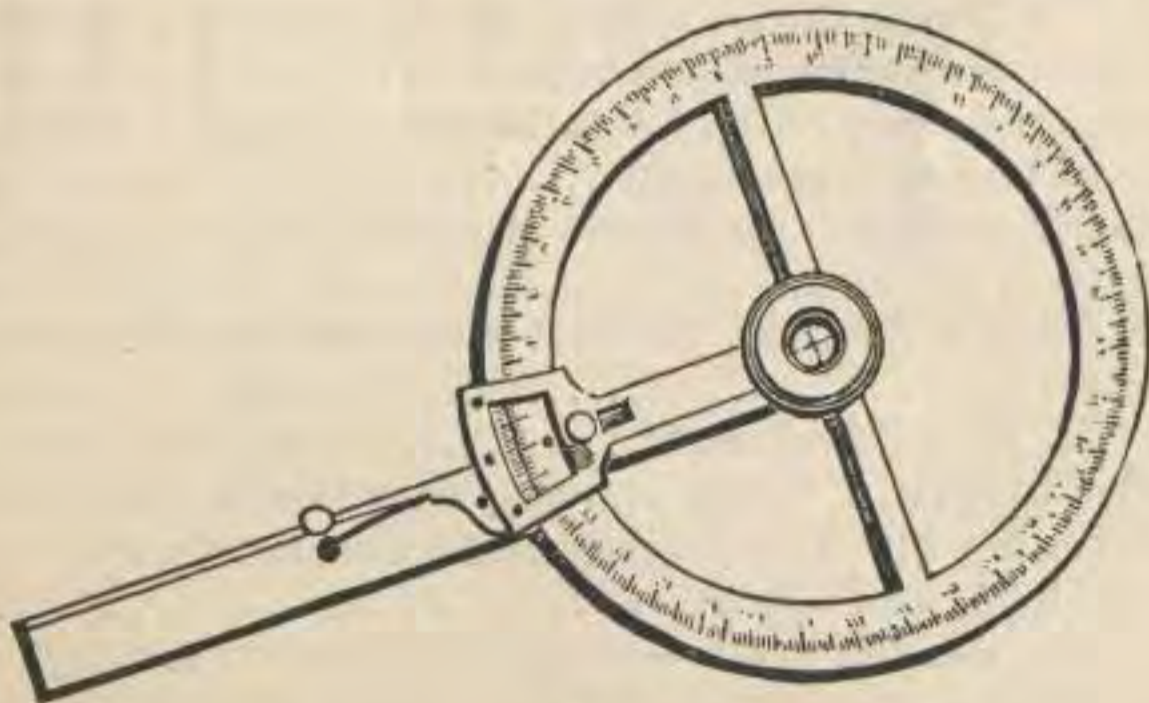

29

29. Protractor, German Silver, 5 $\frac{1}{2}$ -inch diameter, whole circle, $\frac{1}{2}$ degrees, with vernier to three minutes	14 00
29. Protractor, German Silver, 8-inch diameter, whole circle, $\frac{1}{4}$ degrees, vernier to 1 minute	16 25

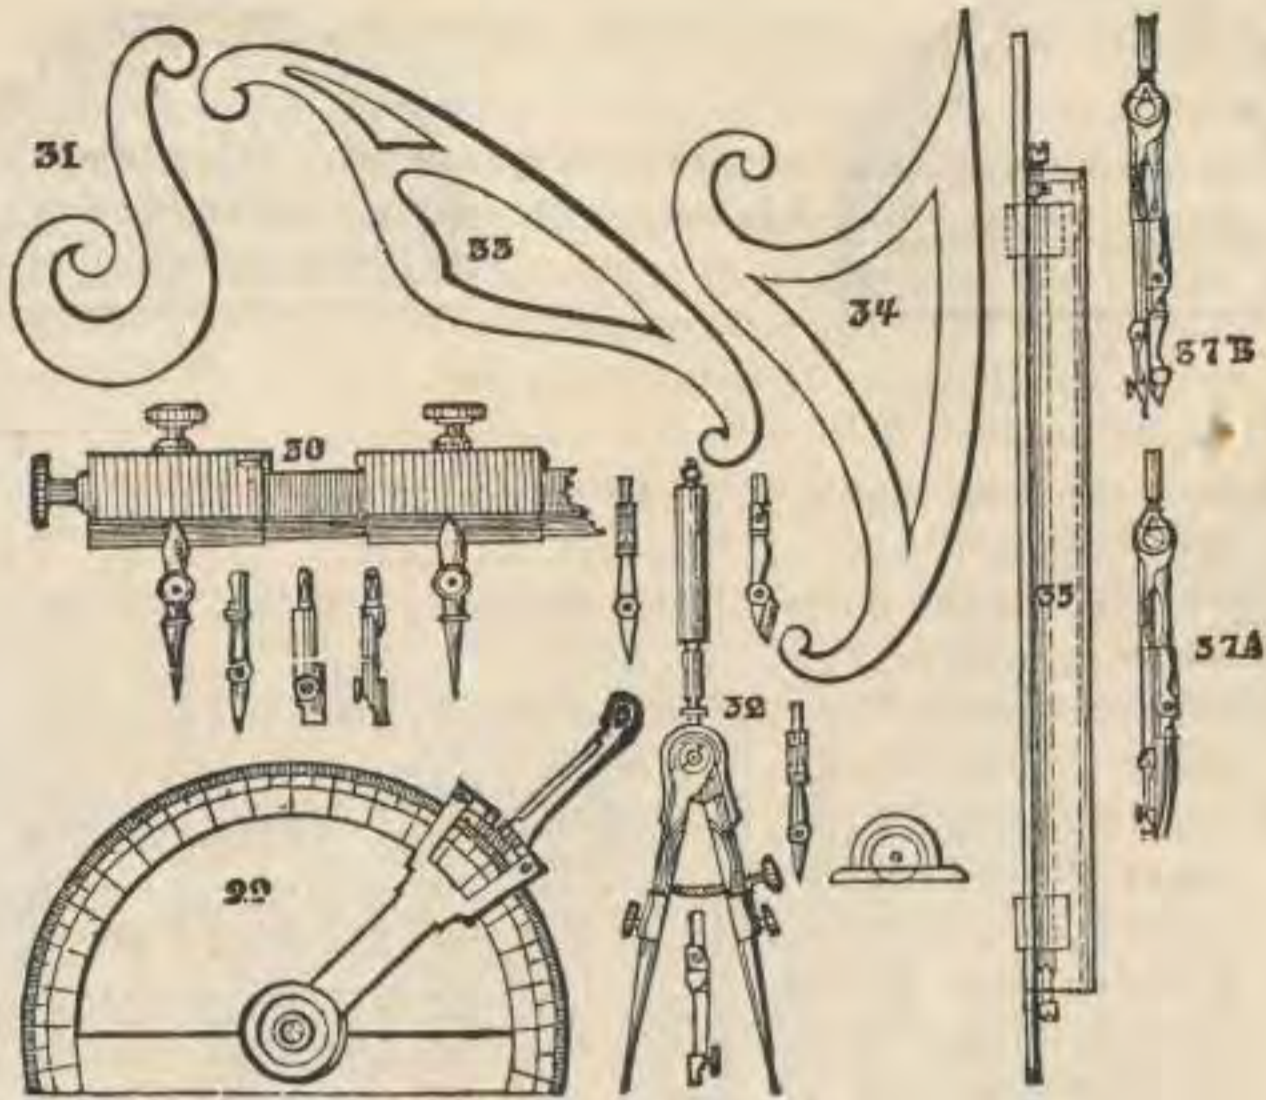


Figure No.	Price.
29. Protractor, German Silver, 5½-inch diameter, ½ circle, ½ degrees, with vernier reading to three minutes.....	\$11 25
29. Protractor, German Silver, 8-inch diameter, ½ circle, ¼ degrees, vernier reading to one minute	14 50
29. Protractor, German Silver, 10-inch diameter, ½ circle, ¼ degrees, vernier to one minute.....	18 25
30. Beam Compass furniture, for wood beams, \$7.50; in Morocco box.....	8 50
31, 33 and 34. Horn Curves, each	1 00
32. Drawing Compass, 4 inches, with long ivory handle, spring and micrometer, with 2 pens, pencil-holder and needle point.....	7 75
35. Parallel Rule, with rollers.....	3 50
37 A. Bow Compass, fast needle point and pen; joints in both legs..	3 25
37 B. Bow Compass, fast needle point and pencil-holder, with joints in both legs	3 25

☞ For Boxwood and Ivory Scales, Protractors, &c., see pages 147-148.

Parties wanting cases made up, can select the pieces, and we will have boxes made to suit, at an additional cost of from \$7 to \$15, according to the size of the boxes, which are made of rosewood, mahogany or walnut, highly finished.

CASES OF EXTRA FINE SWISS DRAWING INSTRUMENTS.

Figure No.	Price.
40. Polished Walnut Box, with lock and key, and tray. Containing: Pair Dividers, $6\frac{1}{2}$ inches long, with pen, pencil, and needle points, and lengthening bar; Pair plain Dividers, $5\frac{1}{2}$ inches long; Steel Bow Pen, with spring; two Drawing Pens, one $4\frac{1}{2}$ inches long, and one $6\frac{1}{2}$ inches long; Half Circle Protractor, 5 inches diameter, $\frac{1}{2}$ degrees	\$23 00
41. Same as No. 40, with the addition of a pair of Dividers, $3\frac{1}{2}$ inches long, with pen, pencil, and needle points, and a Steel Bow Pencil, with spring	31 00
42. Polished Rosewood Box, with lock, and key, and tray. Containing: Pair Dividers, $6\frac{1}{2}$ inches long, with pen, pencil, and needle points, and lengthening bar; Pair Dividers, $3\frac{1}{2}$ inches long, with pen, pencil, and needle points; Pair plain Dividers, $5\frac{1}{2}$ inches long; Pair Hair Spring Dividers, $5\frac{1}{2}$ inches long; Pair Steel Spacing Dividers, $3\frac{1}{2}$ inches long, with spring; Steel Bow Pen, with spring; Steel Bow Pencil, with spring; Three Drawing Pens, one $4\frac{1}{2}$ inches, one $5\frac{1}{2}$ inches, and one 6 inches long; Half Circle Protractor, $6\frac{1}{4}$ inches diameter, $\frac{1}{2}$ degrees; Triangular Scale of Boxwood, 12 inches long	45 00
43. Same as No. 42, with the addition of a Pair of Proportional Dividers 9 inches long, and the Protractor graduated in $\frac{1}{4}$ degrees	60 00
44. Polished Rosewood Box, with lock and key, and tray. Containing: Pair Dividers, $6\frac{1}{2}$ inches long, with pen, pencil and needle points, and lengthening bar; Pair Dividers, 3 inches long, with pen, pencil, and needle points; Pair plain Dividers, $5\frac{1}{2}$ inches long; Pair Hair Spring Dividers, $5\frac{1}{2}$ inches long; Pair Proportional Dividers, 9 inches long; Pair Steel Spacing Dividers, $3\frac{1}{2}$ inches long, with spring; Steel Bow Pen, with spring; Steel Bow Pencil, with spring; Beam Compass, 21 inches long, with three bars; Three Drawing Pens, one $4\frac{1}{2}$ inches, one $5\frac{1}{2}$, and one $6\frac{1}{2}$ inches long; Railroad Drawing Pen; Dotting Pen; Half Circle Protractor, $6\frac{1}{4}$ inches diameter, $\frac{1}{4}$ degrees, center on the inner edge; Triangular Scale of Boxwood, 12 inches long	85 00
45. Polished Rosewood Box, with lock and key, and tray; Pair Dividers, $6\frac{1}{2}$ inches long, with pen, pencil, and needle points, and lengthening bar; Pair Dividers, 4 inches long, with ivory handle, adjusting screw and spring, pencil, needle and two	

Price.

pen points; Pair plain Dividers, $5\frac{1}{2}$ inches long; Pair Hair Spring Dividers, $5\frac{1}{2}$ inches long; Pair Proportional Dividers, 9 inches long, with micrometer adjusting screw; Pair Steel Spacing Dividers, $3\frac{1}{2}$ inches long, with spring; Pair Steel Spacing Dividers, 5 inches long; Steel Bow Pen, with spring; Steel Bow Pencil, with spring; Beam Compass, 36 inches long, in 4 bars; Three Drawing Pens, one $4\frac{1}{2}$ inches, one $5\frac{1}{2}$ inches, and one 6 inches long; Railroad Drawing Pen, Dotting Pen; Half Circle Protractor, 8 inches diameter, with arm and vernier; Triangular Scale of Boxwood, 12 inches long\$104 00

MATHEMATICAL INSTRUMENTS

OF BRASS, FOR SCHOOLS.


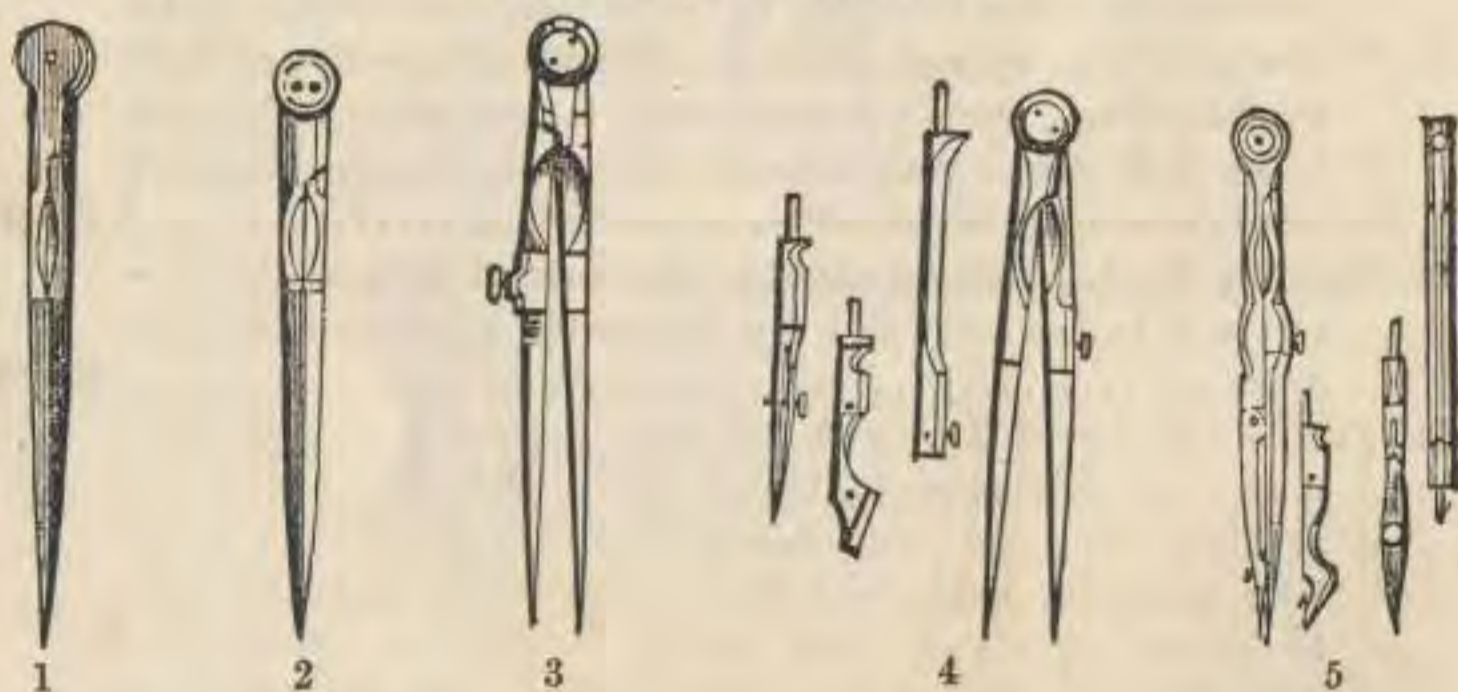


Figure No.		Price.
1.	Brass Dividers, brass joints, rivet heads, 5-inch, 15 cents; 6-inch,	\$0 25
2.	do steel joints, screw heads, 5-inch, 30 cents; 6-inch,	40
2.	do brass joints, turned cheeks, 3-inch, 30 cents; 4-inch, 40 cents; 5-inch, 50 cents; 6-inch	65
2.	do steel joints, turned cheeks, 4-inch, 65 cents; 5-inch, 85 cents; 6-inch.....	1 00
3.	do steel joints, turned cheeks, hair spring, 5-inch...	1 25
3.	do do do do 6-inch...	1 65
4.	Dividers, brass, brass joints, turned cheeks, $4\frac{1}{2}$ inches long, with pen, and pencil points and lengthening bar, per set.....	1 60

Figure No.	Price.
Dividers, brass, brass joints, turned cheeks, 6 inches long, with pen and pencil points and lengthening bar, per set.....	\$1 25
5. Dividers, brass, brass joints, turned cheeks, needle point, 4½ inches long, with pen and pencil points and lengthening bar, per set,	1 25
Dividers, brass, brass joints, turned cheeks, needle point, 6 inches long, with pen and pencil points and lengthening bar, per set,	1 50

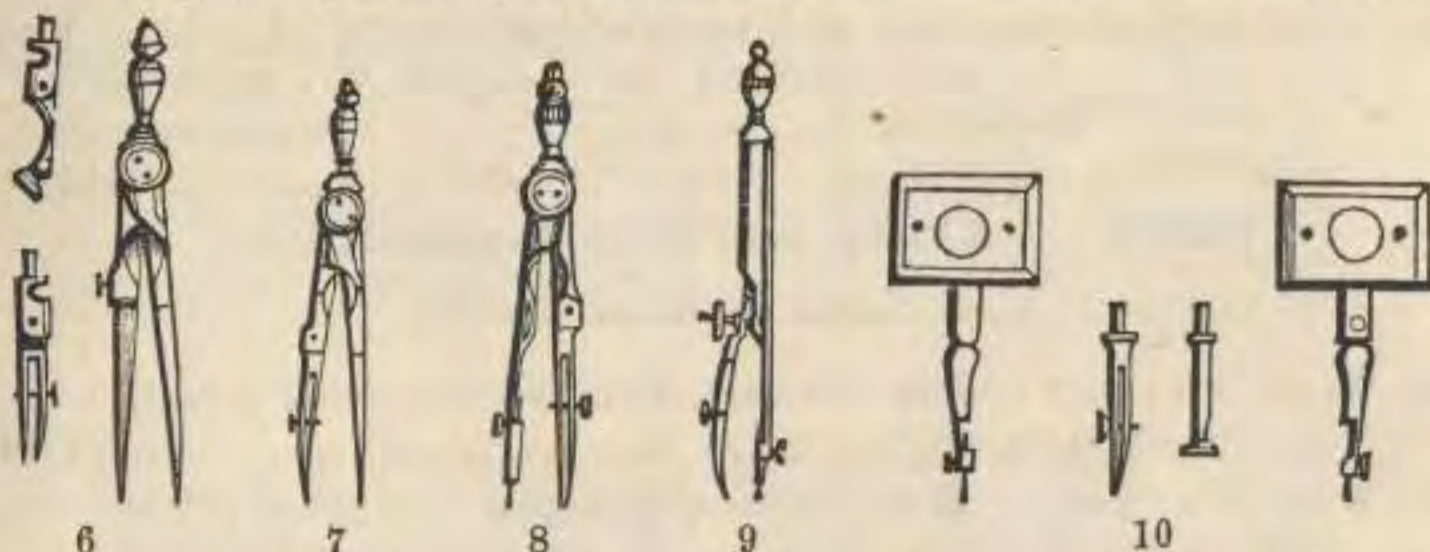

6. Dividers, brass, medium quality, needle point, with pen and pencil points, 3 inches	75
7. Bow Pen, brass.....	75
8. Bow Pen, brass, needle points	1 00
9. Bow Pen, brass, needle points and adjusting spring	75


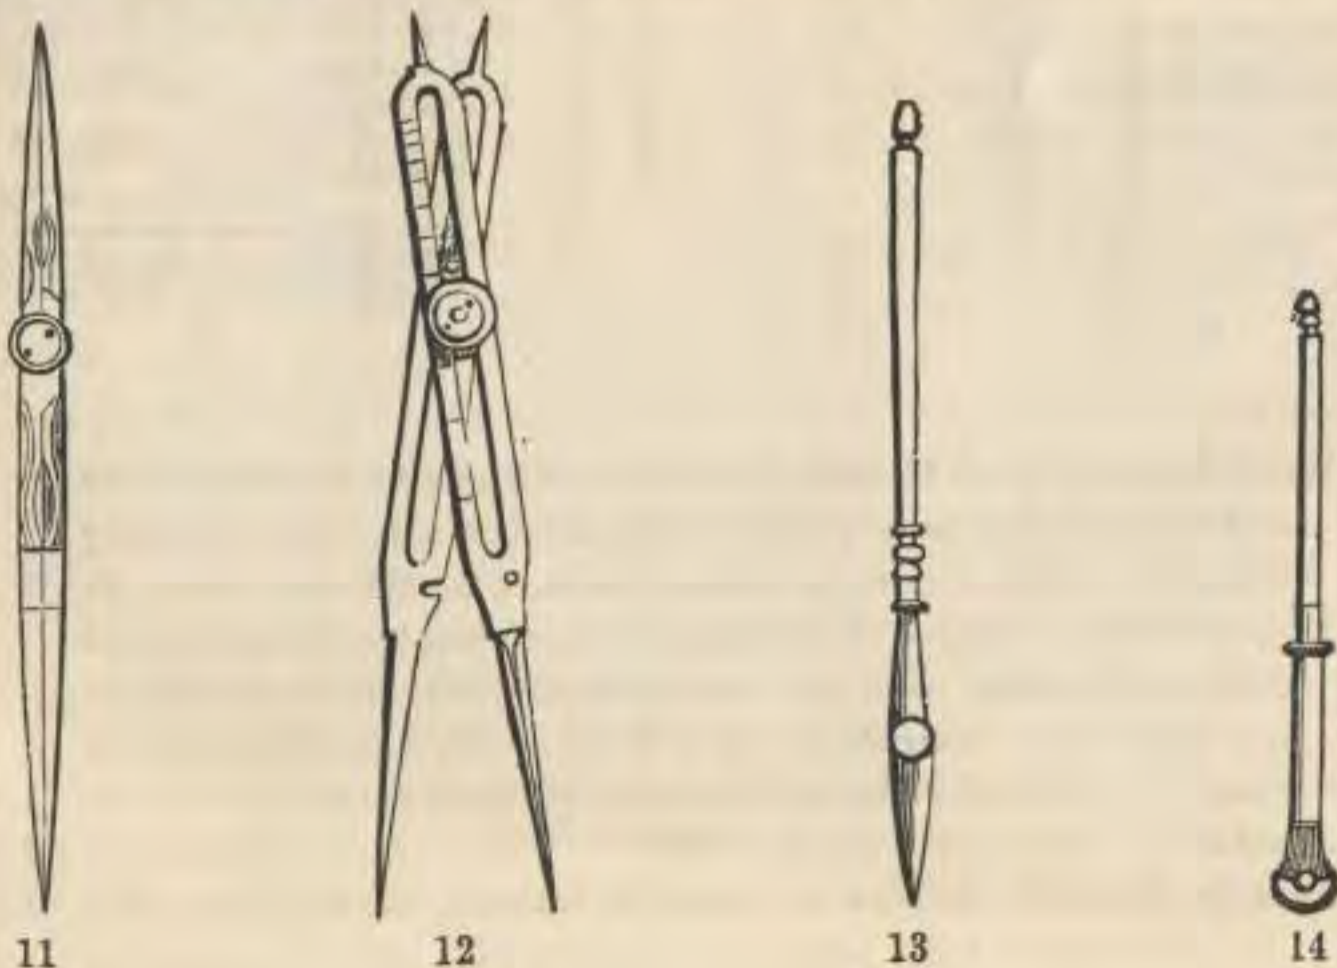



Figure No.	Price.
10. Furniture for Beam Compass, brass, with adjusting screw, in morocco case.....	\$6 00
11. Bisecting Dividers, brass.....	75
12. Proportional Dividers, brass, half divided.....	2 50
13. Drawing Pen, black handle.....	35
Drawing Pen, ivory handle.....	50
14. Roulette for dotting lines, with extra wheels	1 50

CASES OF BRASS DRAWING INSTRUMENTS,
FOR SCHOOLS.

20. Wood Box; pair $4\frac{1}{2}$ -inch Dividers, with pen and pencil points, and Crayon Holder	1 00
21. Wood Box; pair $4\frac{1}{2}$ -inch Dividers, with pen and pencil points and lengthening bar; Ebony handle Drawing Pen; Boxwood Scale, 4 inches long	1 50

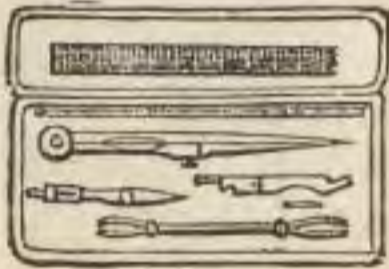


20

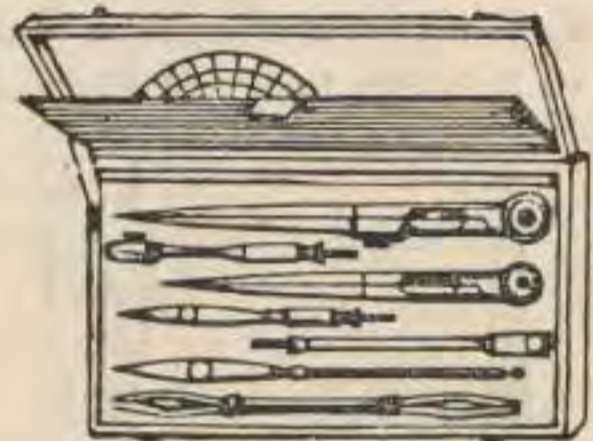

22

22. Wood Box; Pair of $4\frac{1}{2}$ -inch Dividers, with pen and pencil points and lengthening bar; Pair of $3\frac{1}{2}$ -inch plain Dividers, Drawing Pen, Horn Protractor; Boxwood Scale, 4 inches long	1 75
23. Rosewood Box; Pair $5\frac{1}{2}$ -inch Dividers, with pen and pencil points and lengthening bar; Pair of $4\frac{1}{2}$ -inch plain Dividers, Drawing Pen, Horn Protractor; Box Wood Scale, 6 inches long....	2 50
24. Same as 23, with addition of Parallel Ruler.....	2 85
25. Same as 23, with Ivory Scale, 6 inches long	3 00
26. Same as 25, with addition of Parallel Ruler.....	3 35

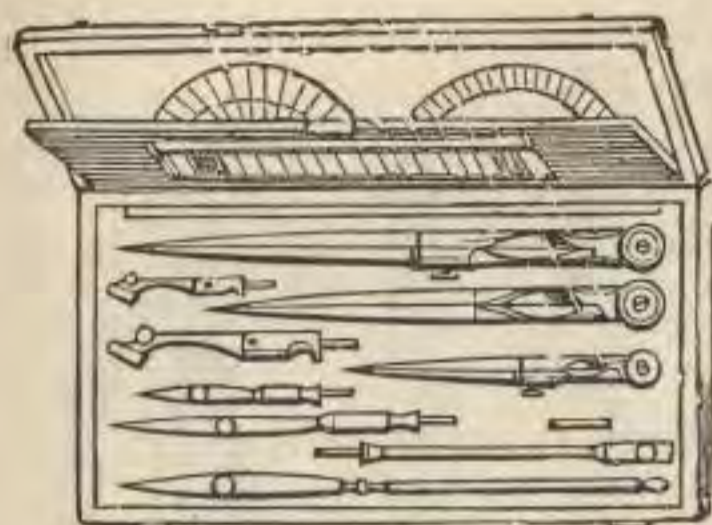

27



29

Figure No.	Price.
27. Rosewood Box; Pair of 6-inch Dividers, with pen and pencil points and lengthening bar; Pair of 4½-inch plain Dividers, Drawing Pen; Pair of 3½-inch Dividers, with pen and pencil points; Brass Protractor, Horn Protractor; Ivory Scale, 6 inches long, per set.....	\$4 00
28. Same as No. 27, but with the instruments set in a tray, so that colors, etc., may be put below, per set.....	4 50
29. Rosewood Box; Pair of 6-inch needle point Dividers, with pen and pencil points, and lengthening bar; Pair 4½-inch plain Dividers; Pair of 3½-inch needle point Dividers, with pen and pencil points; Drawing Pen, Brass Protractor, Horn Protractor; Ivory Scale, 6 inches long, per set.....	4 75
30. Same as No. 29, but with lock and key and the instruments set in a tray, so that the colors may be put below, per set.....	5 00
31. Same as No. 30, with addition of Parallel Ruler, per set.....	5 35
32. Rosewood Box, with lock and key, the instruments set in a tray, so that colors, etc., may be put below; Pair of 6-inch needle point Dividers, with pen and pencil points, and lengthening bar; Drawing Pen, Pair 4½-inch plain Dividers, Brass Protractor, Horn Protractor, Pair of 3½-inch Needle Point Dividers, with pen and pencil points; Spring Bow Pen, with needle point; Ivory Scale, 6 inches long, per set.....	5 75
33. Same as No. 32, with addition of Parallel Ruler, per set.....	6 25
34. Same as No. 33, with the addition of a pair Proportional Dividers, per set.....	8 50

FINE GERMAN SILVER INSTRUMENTS.

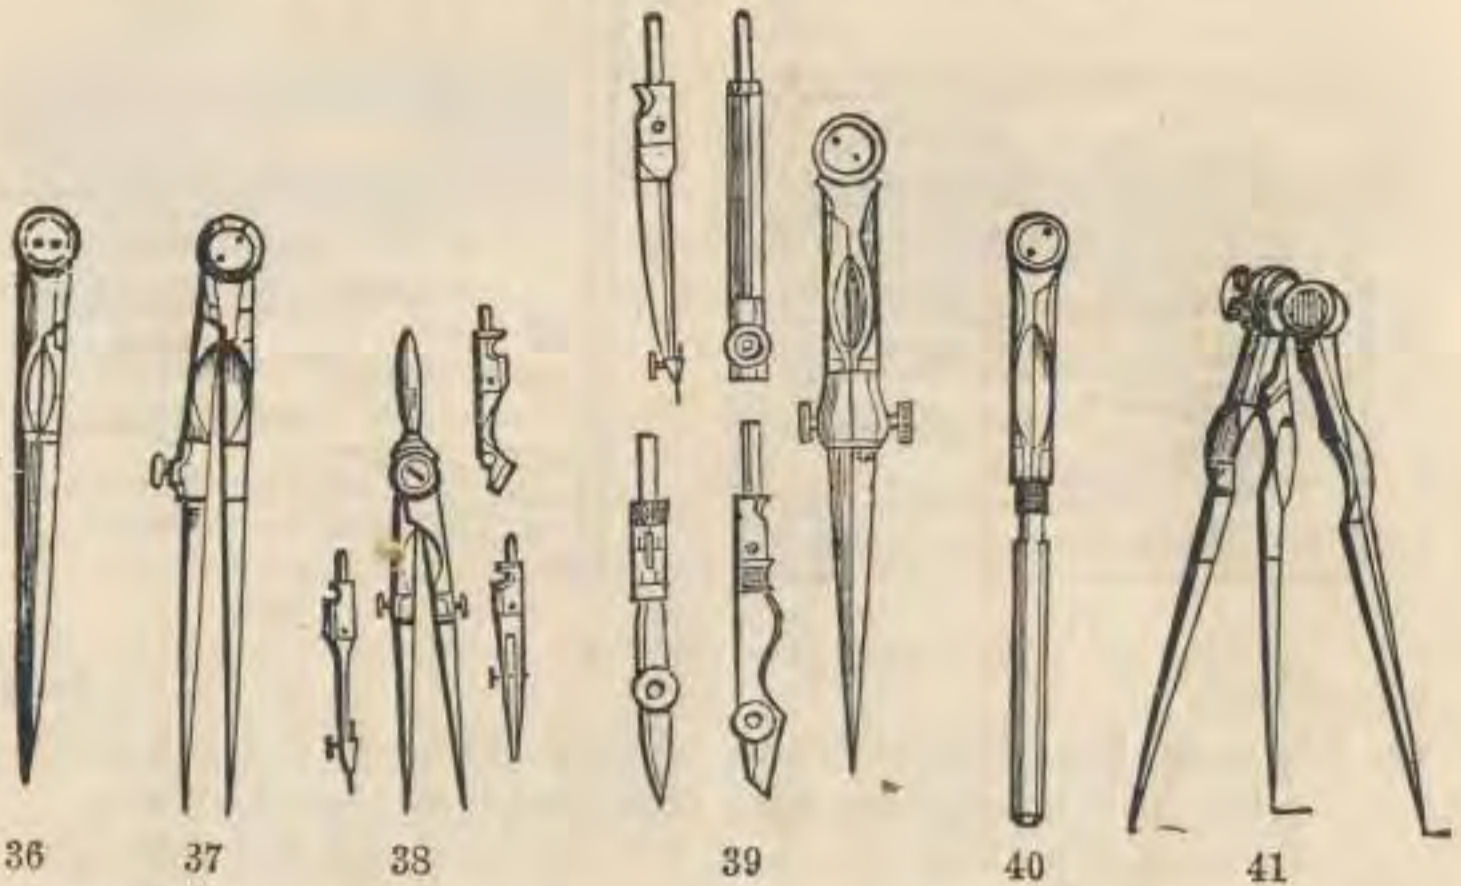


Figure No.	Price.
36. Dividers, German Silver; steel joints, turned cheeks, fine finish, 4-inch, 85 cents; 5-inch, \$1.10; 6-inch, \$1.25; 7-inch	\$1 75
37. Dividers, German Silver; steel joints, turned cheeks, fine finish, hair spring, 4-inch, \$2.00; 5-inch, \$2.50; 6-inch.....	3 00
38. Dividers, German Silver; fine quality, needle point, with pen and pencil point, 3 inches.....	3 50
39. Dividers, German Silver; fine quality, with needle point, pen, lengthening bar, and pencil points, 6 inches.....	4 50
40. Dividers, German Silver; 5-inch, fine finish, with shield for pocket.....	2 75
41. Dividers, German Silver; 5-inch, three-legged.....	4 75
42. Proportional Dividers, German Silver, 7½ inches long, divided for lines	3 50
43. Proportional Dividers, German Silver, 9 inches long, finely divided for lines and circles.....	13 25
44. Bisecting Dividers, German Silver	1 50
45. Steel-Spacing Dividers, 5 inches long, with ivory handle.....	3 25
46. do do 3½ do do or metal handle,	1 75
47. Spring Bow Pen, all steel, ivory handle....	2 25
48. Spring Bow Pencil, ivory handle.	2 25
49. Spring Bow Pen, German Silver ..	2 00
50. do do with pencil point.....	3 30


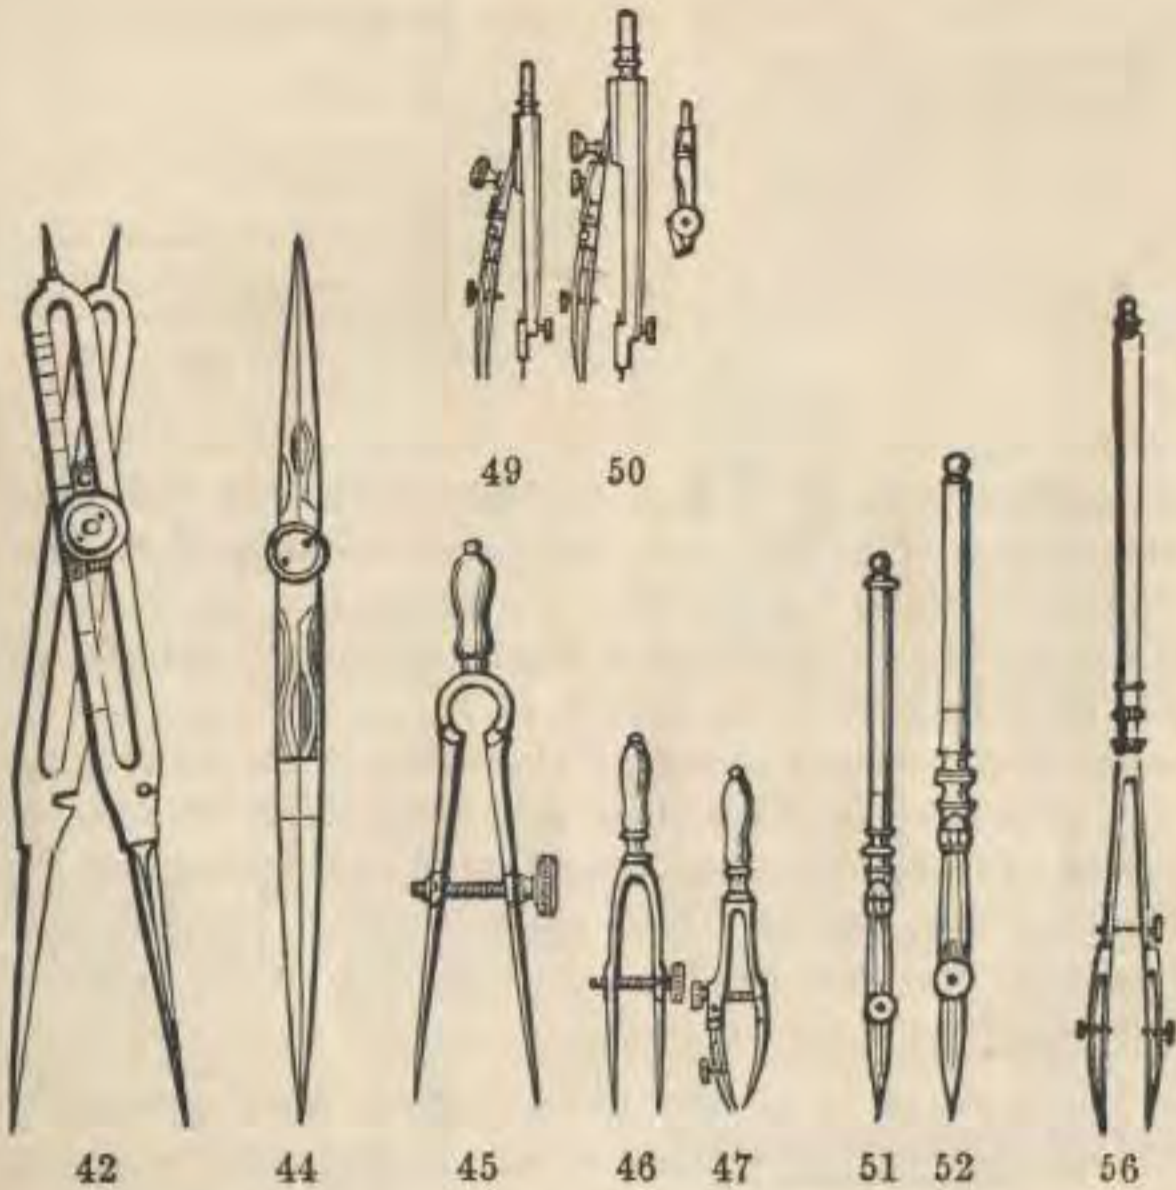



Figure No.	Price.
51. Drawing Pen, German Silver; fine finish, hinge to pen.....	\$0 85
52. Drawing Pen, German Silver; fine finish, hinge to pen, and protracting pin.....	1 00
53. Drawing Pen, German Silver; fine finish, hinge to pen.....	1 00
54. do do and protracting pin, extra fine, 5½-inch	1 80
55. Drawing Pen, all German Silver, for red ink.....	1 25
56. Double Drawing Pen, or Road Pen, fine finish	3 50

**CASES OF FINE GERMAN SILVER INSTRUMENTS,
FOR ENGINEERS, ARCHITECTS, AND MACHINISTS.**

60. Morocco Box; pair of 5½-inch Dividers, with Pen and Pencil Points, Drawing Pen, Ivory Scale, 6 inches long, same as in school-cases of instruments	4 50
61. Morocco Box; pair of 3-inch Dividers, with Pen, Pencil and Needle-Points, and Lengthening Bar, Drawing Pen. No Scale or Protractor. Per set.....	5 50

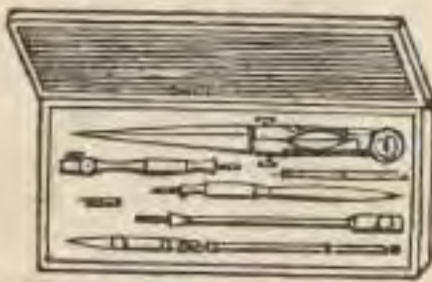

61

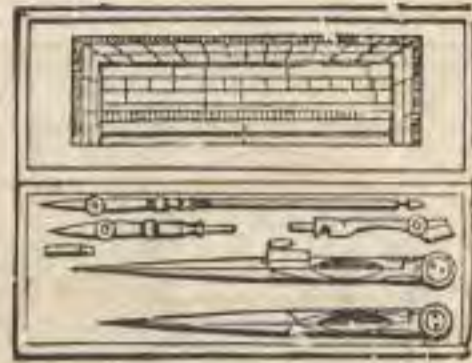


62

Figure No.	Price.
62. Morocco Box; pair of $5\frac{1}{2}$ -inch Dividers, with Pen and Pencil Points, pair of 5-inch plain Dividers, Drawing Pen, Ivory Protractor Scale, 6 inches long, per set.....	\$6 25
63. Same as No. 62, with addition of Needle Points and Lengthening Bar to $5\frac{1}{2}$ -inch Dividers, per set.....	8 50
64. Morocco Box, rounded corners, for carrying in the pocket; pair of $4\frac{3}{4}$ -inch Dividers, with hinge in one leg, Needle Points, with Pen and Pencil Points, and Lengthening Bar, Spring Bow Pen, Needle Point, pair of 4-inch plain Dividers, rounded point, Drawing Pen, ivory handle, 5-inch Ivory Inch Rule, divided into eighths, per set.....	8 50




65

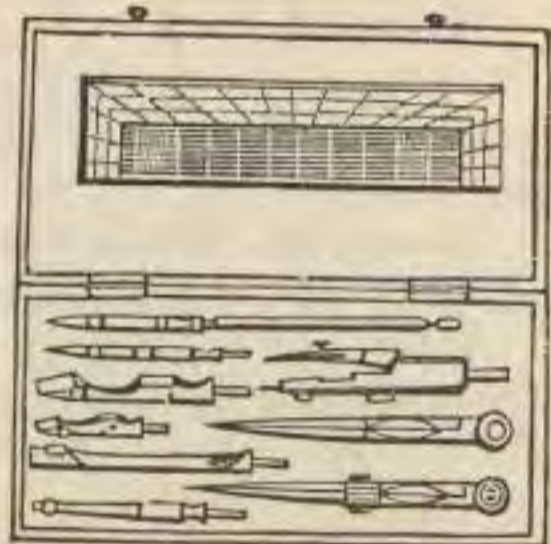

66

65. Morocco Box; pair of $5\frac{1}{2}$ -inch Dividers, with Pen and Pencil Points, and Lengthening Bar, pair of 5-inch plain Dividers, pair of 3-inch Dividers, with Pen and Pencil Points, Drawing Pen, German Silver Protractor, German Silver Square, Ivory Scale, 6 inches long, per set.....	10 80
66. Morocco Box; pair of $5\frac{1}{2}$ -inch Dividers, with Pen, Pencil and Needle Points, and Lengthening Bar, pair of 5-inch plain Dividers, Spring Bow Pen, Drawing Pen, Ivory Protractor Scale, 6 inches long, per set.....	10 80

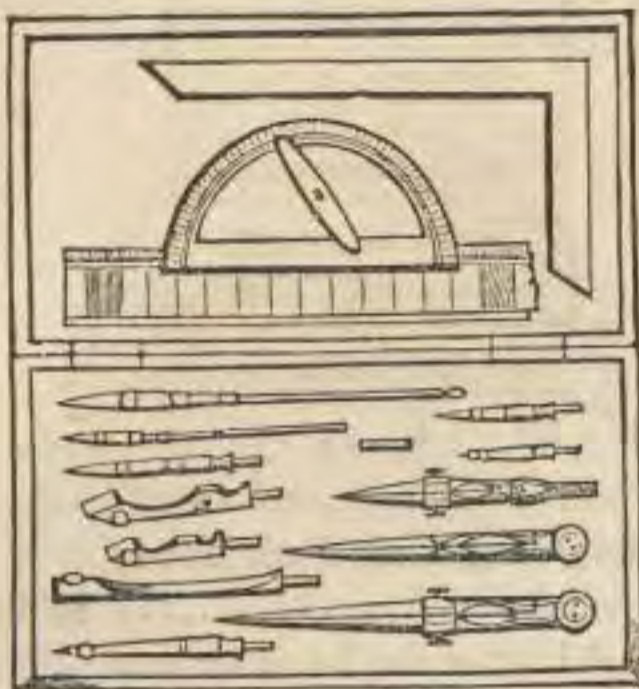

67




73

Figure No.	Price.
67. Morceco Box; pair of 5½-inch Dividers, with Pen, Pencil and Needle Points, and Lengthening Bar, pair of 5-inch plain Dividers, pair of 3-inch Dividers, with Pen, Pencil and Needle Point, 2 Drawing Pens, German Silver Square, German Silver Protractor, Ivory Scale, 6 inches long, per set	\$15 25
68. Same instruments as in No. 67, in polished Walnut Box, per set,	16 00
69. Same instruments as No. 67, omitting Ivory Scale, German Silver Protractor and German Silver Square, but in polished Walnut Box, with lock and tray	16 00
70. Polished Walnut Box; same instruments as No. 68, with the addition of Spring Bow Pen with Needle Point	18 00
71. Same as No. 70, with the addition of 5-inch hair-spring Dividers,	20 00
72. Same as No. 70, set in a tray, and the box much larger, with lock, thus affording space for extra instruments or colors, &c.,	23 00
73. Polished Walnut Box, with lock and key, instruments set in a tray; pair of 5½-inch Dividers, with Pen, Pencil and Needle Points, and Lengthening Bar, pair of 5-inch plain Dividers, pair of 5-inch hair-spring Dividers, pair of 3-inch Dividers, with Pen, Pencil, and Needle Points, pair of 7½-inch Proportional Dividers, German Silver Square, Spring Bow Pen, with Needle Point, German Silver Protractor, Ivory Scale, 6 inches long, per set	40 00
74. Polished Walnut Box; instruments same as No. 173, with addition of a Railroad or Double Drawing Pen, per set.....	44 00

PROTRACTORS OF HORN, BRASS, GERMAN SILVER,
IVORY AND PAPER.



80

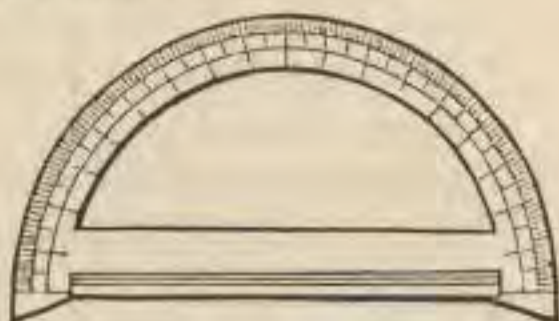

81

Figure No.		Price.
80.	Horn Protractors, half circle, half degrees, 5-inch diameter, \$0.50; 6-inch, \$0.75; 7-inch, \$1.00; 8-inch	\$1 25
81.	Brass Protractors, half circle, whole degrees, 4-inch	0 25
	do do half degrees, 4-inch, \$0.50; 5-inch, \$0.75; 6 inch	1 00
82.	German Silver Protractor, 4 inches diameter, $\frac{1}{2}$ circle, whole deg.	0 75
	do do half degrees, 5-inch, \$1.25; 6-inch, \$1.50; 7-inch	1 75
83.	German Silver Protractors, with beveled edges, 5-inch, \$1.75; 6-inch, \$2.50; 7-inch	3 25
84.	Paper Protractor, whole circle, $\frac{1}{2}$ degrees, 12-inch thin paper...	0 30
	do do do do $\frac{1}{2}$ degrees, 12 inch Bristol board.	0 40
	do do half circle, $\frac{1}{2}$ degrees, 5-inch card board	0 25
	do do do whole degrees, 4-inch card board.	0 20



85

85.	Ivory Protractor, 6 inches long, $1\frac{3}{4}$ inches wide, whole degrees, with 6 scales of equal parts, 4 scales of feet and inches, 2 scales of chords and diagonal scale	1 50
86.	Ivory Protractor, 6 inches long, $1\frac{3}{4}$ inches wide, whole degrees, with 6 scales of equal parts, 8 scales of feet and inches, 2 scales of chords and diagonal scale	2 50
87.	Ivory Protractor, 6 inches long, 2 inches wide, whole degrees, with 8 scales of equal parts, 10 scales of feet and inches, 2 scales of chords, diagonal scale and line of 40 on lower edge..	3 50
88.	Ivory Protractor, same as No. 87, but in half degrees	4 50
87 $\frac{1}{2}$.	do do 6 inches long, $2\frac{1}{4}$ inches wide, half degrees, with 10 scales of equal parts, 12 scales of feet and inches, 2 scales of chords, diagonal scale, and line of 40 on lower edge,	5 75

Figure No.	Price.
89. Ivory Protractor, 6 inches long, 2½ inches wide, with 8 scales of equal parts, 12 scales of feet and inches, 3 scales of chords, lines of sines, tangents, secants, hours, &c., &c., and line of 40 on lower edge.....	\$7 75
90. Ivory Protractor, 8 inches long, 2 inches wide, half degrees, with 6 scales of equal parts, 8 scales of feet and inches, 2 scales of chords, diagonal scale and line of 40 on lower edge.....	5 75
91. Ivory Protractor, 12 inches long, 2½ inches wide, half degrees, with 10 scales of equal parts, 12 scales of feet and inches, 2 scales of chords, diagonal scale and line of 40 on lower edge...	13 50

IVORY AND BOXWOOD SCALES.

92. Boxwood Protractor, 6 inches long, 1¾ inches wide, whole degrees, with 6 scales of equal parts, 4 scales of feet and inches, 2 scales of chords, and diagonal scale	0 75
---	------

IVORY SCALES.



95

93. Ivory Sector, 6 inches, opens to 12 inches.....	2 25
94. Ivory Scale, 6 inches long, same as in school cases of instruments,	0 80
95. Ivory Chain Scales, 12 inches long, graduated on two edges with either 10 and 10 parts, or 10 and 20, or 20 and 40, or 30 and 50, or 40 and 60, or 50 and 60, each.....	3 50
do do do do with 40 and 80, or 50 and 100, each.	6 00
96. Ivory Architects' Scales, 12 inches long, each.....	3 50
do do do with diagonal scale on one side, each.....	3 50
do do do with 16 different graduations all brought to the edges, each.....	3 50

BOXWOOD SCALES.

97. Boxwood Scale, 6 inches long, same as in school cases of instruments	0 30
98. Boxwood Scale, 12 inches long, for Architects.....	1 25
99. do 12 do with 16 different graduations, all brought to the edges	1 25

Figure No.	Price.
100. Boxwood Scale, 12 inches long, for Architects, with diagonal scale on one side	\$1 25
101. Triangular Scale of Boxwood, 24 in. long, graduated 10, 20, 30, 40, 50 and 60 to the inch	5 00
102. do do do do 12 inch,	2 00
102½. do do do do 6 inch,	1 50



102.

103. Triangular Scale of Boxwood, 24 in. long, graduated $\frac{3}{32}$, $\frac{3}{16}$, $\frac{1}{8}$, $\frac{1}{4}$, $\frac{3}{8}$, $\frac{1}{2}$, $\frac{3}{4}$, 1, $1\frac{1}{2}$, 3 and 16ths to the foot.....	5 00
104. do do do do 12 inches long,	2 00
105. do do do do 6 do	1 50
106. Boxwood Gunter Scales, 12 inches long.....	0 65
107. Satin Wood do do 24 do	1 00

PAPER SCALES, STEEL RULES, &c.

PAPER SCALES.

108. Paper Scale, on card paper, $1\frac{1}{4}$ inches wide, 12 inches long; one edge inches and 10ths, and the other feet and 100ths.....	0 10
109. Paper Scale, 12 in., one edge 20 parts to the inch, the other 40,	0 10
110. Paper Scale, 12 inches, one edge inches and sixteenths; the other inches and forty-eighths	0 10
111. Paper Scales, on card paper, 19 inches long, for architects and engineers, in sets of 6 scales, per set.....	1 00
112. Series A contains 6 scales, one each, divided to $\frac{1}{4}$, $\frac{1}{2}$, $\frac{3}{4}$, 1, $1\frac{1}{2}$ and 3 inches to the foot, for architects.....	1 00
113. Series B contains 6 scales, one each, divided to 3-32, $\frac{1}{8}$, 3-16, 5-16, $\frac{3}{8}$ and $\frac{7}{8}$ inch to the foot, for architects	1 00
114. Series C contains 6 scales, one each, divided to 10, 20, 30, 40, 50 and 60 parts to the inch, for engineers	1 00
Single Scale of any of the above series, A, B, C—each scale ...	0 20
115. Paper Scales, 19 inches, divided either to $\frac{5}{8}$, $1\frac{1}{8}$, $1\frac{1}{4}$ or $1\frac{3}{8}$ inches to the foot, each	0 20

The advantages of these scales are—they expand and contract nearly the same as drawing-paper, do not soil the work, and distances can be set off from them without the use of the dividers.

STANDARD STEEL RULES FOR MACHINISTS.

Figure No.					Price.
116.	24 inch steel rule, divided into 8ths, 10ths, 12ths, 14ths, 16ths, 20ths, 24ths, 28ths, 32ds, 48ths, 50ths, 64ths, and 100ths of an inch				\$4 00
117.	12 inches	do	do	do	2 00
118.	9 inches	do	do	do	1 50
119.	6 inches	do	do	do	1 00
120.	4 inches	do	do	do	0 75
121.	3 inches	do	do	do	0 50

SHRINK RULES FOR PATTERN MAKERS.

122.	24 $\frac{1}{4}$ inch single shrink, full, divided, Steel.....				4 50
123.	24 $\frac{1}{4}$ do do do Boxwood				3 00
124.	24 $\frac{1}{2}$ inch double shrink, 8ths and 16ths, Steel.....				4 50
125.	24 $\frac{1}{2}$ do do do Boxwood				3 00

STANDARD SCALES—STEEL.

126.	36 inch Steel or Standard Yard, full, divided	8 00
127.	36 inch Steel Standard Yard, $\frac{3}{8}$ in. square, divided to feet only,	2 00
128.	French Standard Metre, divided on 3 edges to millimetres, and one edge to 5ths of millimetres	10 00
129.	Centre Gauge for lathes, also for screw tools.....	0 50
130.	Horse-shoe Magnets, steel, 2-inch, \$0.15; 2 $\frac{1}{2}$ -inch, \$0.20; 3-inch, \$0.40; 4-inch, \$0.50; 5-inch, \$0.70; 6-inch	1 00

STEEL SQUARES FOR MACHINISTS.




131

131	Steel Squares, with 3-inch blade, \$2.50; 4-inch, \$3.00; 6-inch, \$3.50; 9-inch, \$4.00; 12-inch.....	6 00
-----	--	------

Figure No.

Price.


132. Hardened Cast-steel Try Squares, for machinists, 15-inch, \$15
 12-inch, \$12; 9-inch, \$9; 6-inch, \$6; 4½ inch, \$4.50; 3-inch
 \$3.50; 1½-inch \$2 50

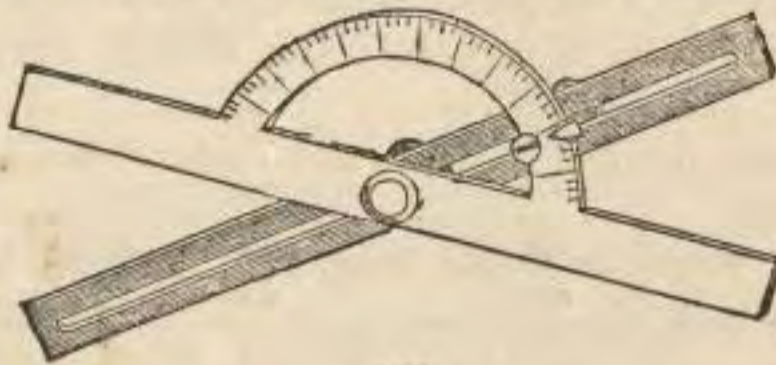


133

133. Steel Bevel Protractor, with sliding arm, divided to degrees,
 for machinists; with 6-inch arm, \$6; with 10-inch arm 6 50


TRIANGLES, SQUARES, &c.

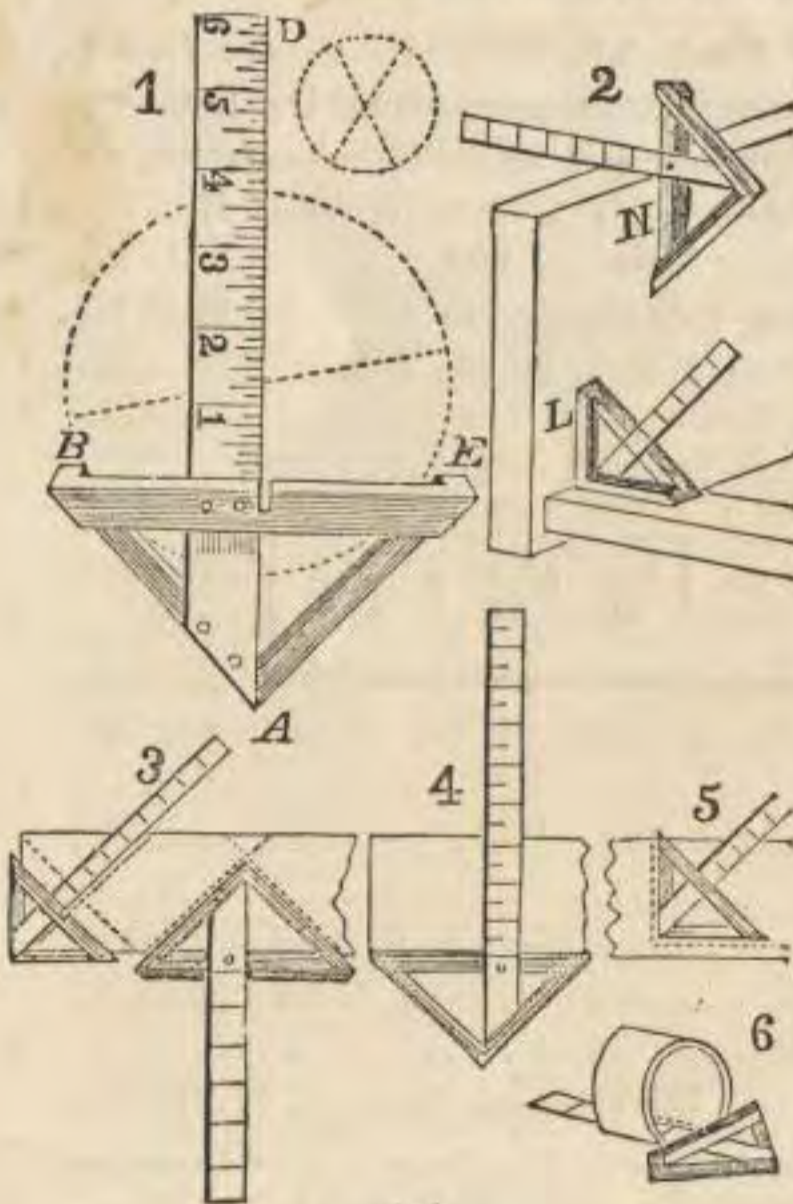

139

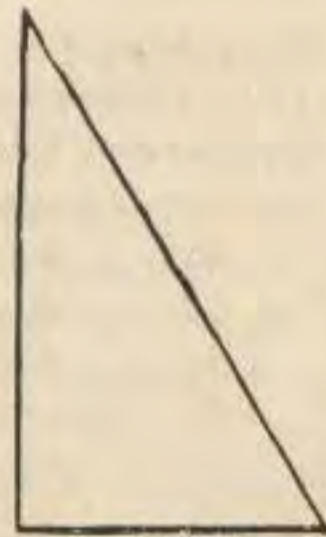

140

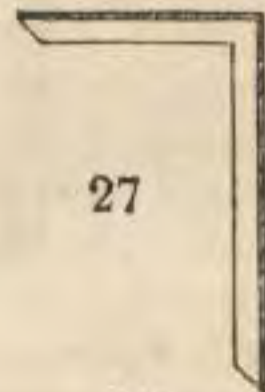

27

148


Figure No.	Price.
134. Hardened Cast-steel Pocket Vernier Calliper; vernier to 1000ths of inches, one edge to millimetres, \$6; in morocco case	\$7 00
135. Improved Vernier Calliper, vernier reads to 1000ths of inches inside and outside Callipers, and points to transfer the distance, with dividers; in morocco case; 6-inch, \$18; 12-inch, \$25; 24-inch.....	30 00
136. Calliper Squares, divided to 100ths and-64ths of inches; 2-inch, \$3.50; 3-inch.....	4 50
137. Steel Straight Edge, 48 inches long, \$10; 36-inch, \$7.50; 30-inch, \$5; 24-inch	3 50
138. Polished Rosewood Straight Edge, 20-inch, \$0.25; 30-in. \$0.50; 40-inch, \$0.75; 50-inch, \$1; 60-inch, \$2.50; 72-inch.....	4 50
139. Ames' Patent Universal Square, blade 6 inches long, \$3; 8-in. \$4; 10-inch, \$5; 12-inch	6 00
140. Pearwood Triangles, 30, 60 and 90 degrees, and 45, 45 and 90 degrees; 5 to 7-inch, \$0.25; 7 to 10-inch, \$0.35; 12-inch	0 45
141. Rosewood or Beachwood Triangle, framed, degrees as No. 140, plain finish; 6 to 10-inch, \$0.50; 12 to 15-inch	1 10
142. Rosewood or Beachwood Triangle, polished, 6 to 10-in., \$0.60; 12 to 15-inch.....	1 25
143. Hard Rubber Triangle, 6-inch, \$1; 7 to 10-inch.....	1 25
144. Ger. Silv. Triangle, 30, 60 and 90 deg. perpendicular, 6 to 7 in.	2 50
145. do do do do do 9 to 10 in.	4 00
146. do do 45, 45 and 90 deg. do 4 to 5 in.	2 25
147. do do do do do 6 to 7 in.	4 00
148. do Squares, perpendicular, 6 to 7 inches	1 10

CURVES, T SQUARES, ETC., ETC.


149. Whitewood Irregular Curves, 5 to 9 inches long, various patterns, each \$0.35; 10 to 12-inch, \$0.75; 13 to 18-inch, each...	1 10
150. T Square, Pearwood or Beech, fixed head, blade 15 inches long, each \$0.50; 20-inch, \$0.75; 30-inch, \$0.85; 40-inch, \$1; 50-inch	1 75
151. T Square, Rosewood or Beach (fig. 150), polished, 30-inch, \$1.75; 40-inch	2 50
152. T Square, Pearwood or Beech, single head to turn; head takes off and blade can be used as a rule; 20 inch, \$1.25; 30-inch, \$1.50; 40-inch, \$1.75; 50-inch	2 00
153. T Square, Pearwood or Beech, double head, 24-inch, \$1.75; 30-inch. \$2.25; 40-inch.....	2 75
154. T Square, Rosewood, polished (fig. 153), 30-inch, \$2.75; 42-in.	3 50




149

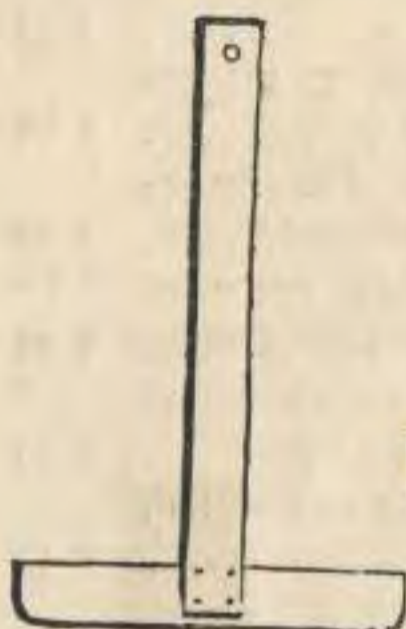

150

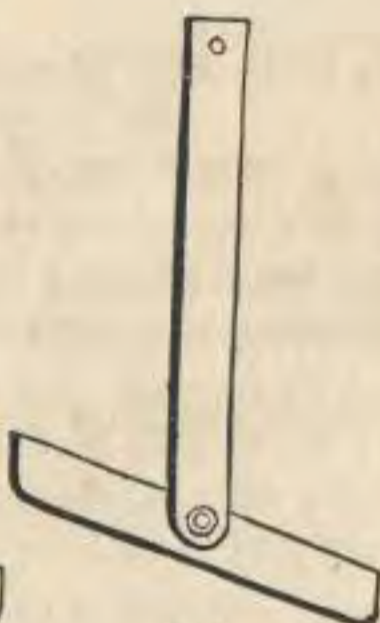

152

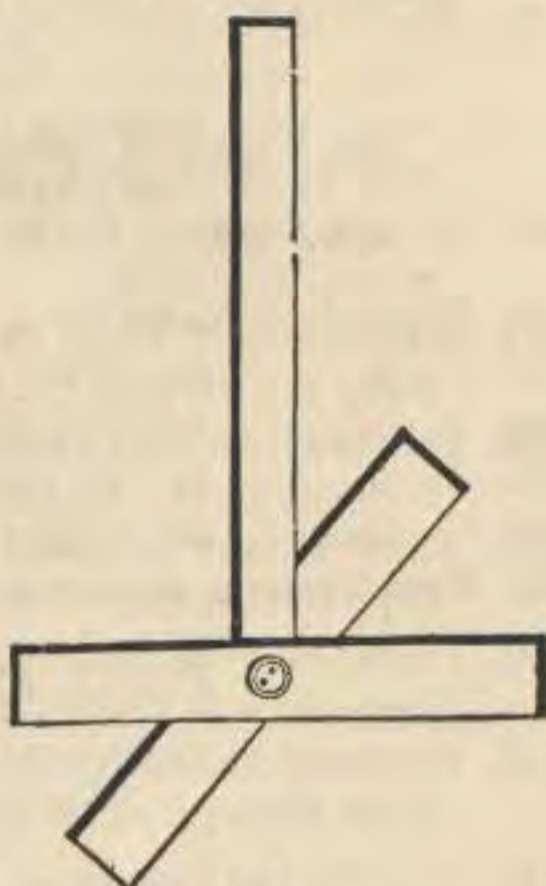

153

PARALLEL RULES, &c.

Figure No.	Price.
155. Parallel Rulers, Ebony, brass mounted, 6 inches long, each,	
\$0.35; 9-inch, \$0.75; 12-inch, \$1; 15-inch, \$1.25; 18-inch,	
\$1.50; 24-inch.....	\$3 00



155



159

156. Parallel Rulers, German Silver, mounted, 12-inch.....	1 75
157. do do all German Silver, on rollers, 15-inch, \$10;	
18-inch	12 00
158. Parallel Rulers, all Brass, on rollers, 9-inch, \$6.25; 12-inch,	
\$8.25; 15-inch	10 50
159. Parallel Rulers, Ebony, on rollers, 12-inch, \$4.25; 15-inch. \$5;	
18-inch	6 25

Figure No. Price.
 160. Parallel Rulers, Ebony, ivory graduated edges, 12-inch, \$6.50;
 15-inch, \$8; 18-inch\$10 00



162



161




166



165

161. Engineers' Tacks, thick heads, brass, per doz..... 0 30
 162. do do thin heads do do 0 40
 163. do do do German Silver, per doz 0 75
 164. do do do Ger. Sil. large & extra fine, per doz. 1 50
 165. do no right angle brass, 3 points, per doz 0 75
 166. Horn Centres, to prevent the dividers from marking the paper. 0 25

IVORY AND BOXWOOD RULES.

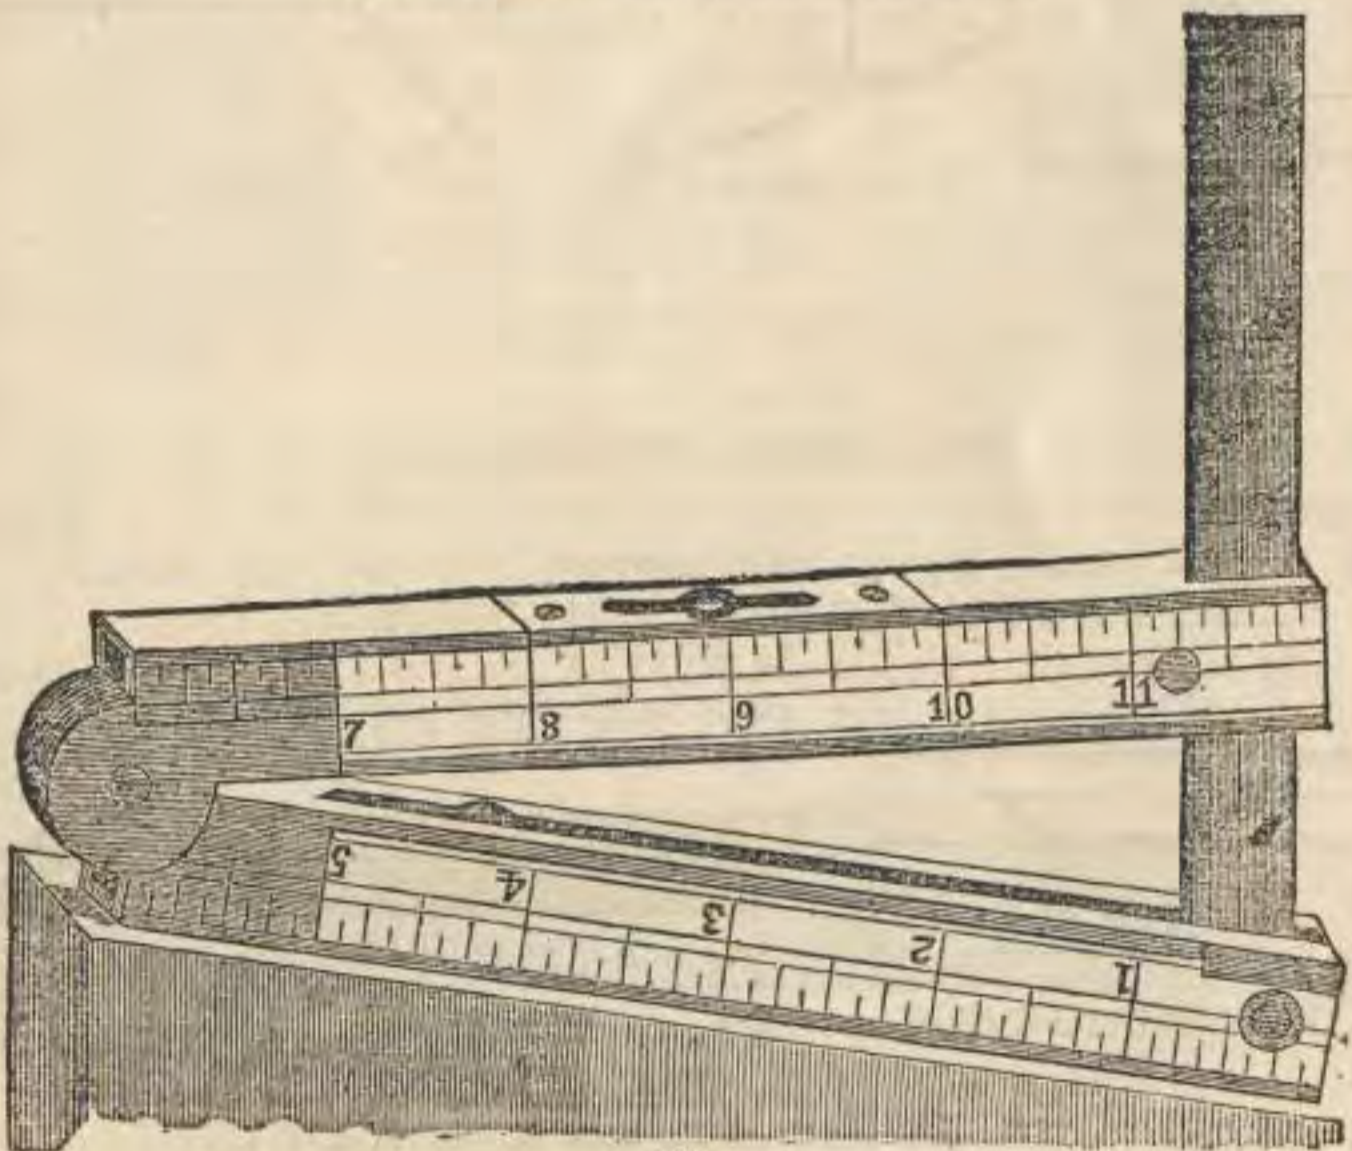

167

167. Combination Rule, 1 foot, 2 fold, boxwood. This is the most convenient and useful pocket-rule ever made; it combines in itself a Carpenter's Rule, Spirit Level, Square, Plumb, Bevel,

154 SPIRIT LEVELS AND POCKET COMPASSES.

Figure No.	Price.
Indicator, Bracæ, Scale, Draughting Scale of equal parts, T Square, Protractor, Right angle Triangle, and with a straight edge can be used as a Parallel Ruler, all the parts of which, in their separate applications, are perfectly reliable.....	\$4 00
168. Combination Rule, 1 foot, 2 fold; ivory, same as above.....	8 00
An explanation and directions for use accompanies each of the Combination Rules.	

POCKET RULES.


169. One foot, 4 fold, boxwood, each	0 35
170. do do do brass edges.....	1 00
171. do do ivory, brass mounted	1 00
172. do do German Silver, mounted	1 50
173. do do do do graduated in 10ths and 100ths, for engineers.....	1 50
174. do do do edges	2 75
175. Two feet, 4 fold, boxwood.....	0 50
176. do do do brass edges.....	1 25
177. do do ivory, German Silver bound, with 8th, 10th and 16th inches, and $\frac{1}{4}$, $\frac{1}{2}$, $\frac{3}{4}$ and 1 inch drafting scales.....	6 50
178. do do do German Silver edges..	7 50
179. Two feet, 6 fold rules, boxwood, graduated, 8th, 10th, and 16th inches.....	1 25
180. do do ivory, graduated, 8th, 10th, 10th and 16th inches	6 50

SPIRIT LEVELS AND POCKET COMPASSES.



185

185. Locke's Hand Level, made of German Silver	15 00
186. do do do brass.....	13 00
187. Levels, mounted in brass, for mechanical purposes, 3 to 12 in. long, per inch.....	0 25
188. Level Bulbs, unmounted, 2 to 4 inches, 25c; 4 to 6 inches	0 35



187

Figure No.	Price.
189. Spirit Levels, for millwrights, mahogany stock, with 3 ground level vials set in brass, all adjustable, 24 and 30-inch	\$6 00
190. Spirit Levels, for millwrights, with 2 ground level vials, adjustable, 24 and 30-inch	4 50
191. Spirit Levels, with unground level vials, of good quality; 3 levels, \$4; 2 levels.....	3 00
192. Brass Plumb Bobs, steel-point screw heads; 3-oz. \$1; 6-oz. \$1.50; 10-oz. \$1.75; 14-oz. \$2.25; 20-oz. \$2.75; 24-oz. \$3; 32-oz.	3 50

POCKET COMPASSES.



195



200



198

195. Mahogany Case, with stop to needle, 1½ inches square, \$1.75; 2-inch, \$2; 2½ inch, \$2.50; 3-inch	3 00
196. Brass, round, with cover, 1½ inches diameter, stop to needle ...	1 50
197. do do do do do and agate centre to needle.....	2 25
198. do watch pattern, stop, agate centre, 1½ in., \$1.50; 2-inch	2 25
199. do watch pattern, stop, agate centre, 1½-inch, with hinged cover	3 00
200. do Gilt Charm Compasses, to hang to watch-guard..	0 25
201. Solid Gold Charm Compasses do do ..	3 00

Also, a variety of cheap Pocket Compasses, in wood and brass, from 25 to 75 cents each.

MICROSCOPES, &c.

SIMPLE MICROSCOPES TO FOLD IN CASES.


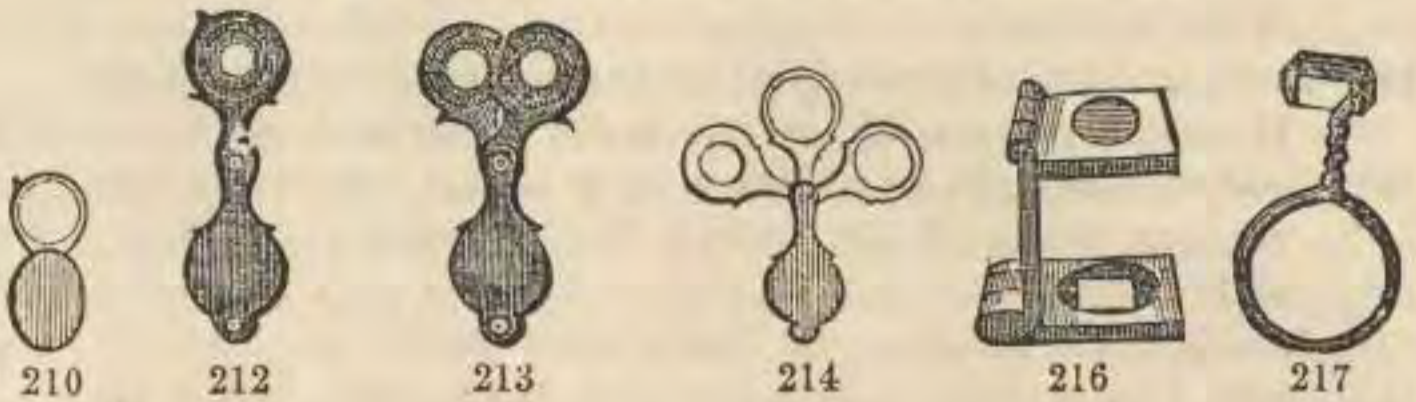


Figure No.	Price.
210. Hard Rubber case and frame, round form, 1 double convex lens, $\frac{3}{4}$ inch diameter, \$.50; 1-inch, \$.75; $1\frac{1}{4}$ -inch, \$1; $1\frac{1}{2}$ -inch, \$1.25; $1\frac{3}{4}$ -inch, \$1.50; 2-inch.....	\$2 25
211. Hard Rubber case and frame, round form, 2 double convex lenses, $\frac{3}{4}$ -inch, \$.75; 1-inch, \$1.25; $1\frac{1}{4}$ -inch, \$2; $1\frac{1}{2}$ -inch...	2 50
212. Hard Rubber case and frame, bellows form, $\frac{3}{4}$ -in. \$0.75; 1-in.	1 00
213. do do do 2 lenses, $\frac{3}{4}$ -in. \$1; 1-in.	1 25
214. do do do 3 do $\frac{3}{4}$ -in. \$1.50; 1-in.	1 75
215. Microscope on three legs, with screw adjustment for focus.....	1 00
216. Linen Provers, or Microscope for counting the threads in linen fabrics	0 75
217. Stanhope lens, in German Silver frame.....	1 50
218. Coddington lens, brass frame.....	2 00
219. do silver frame.....	2 50
220. do do with cover.....	3 50
221. do do large size, with cover	5 50

READING AND PICTURE LENSES.

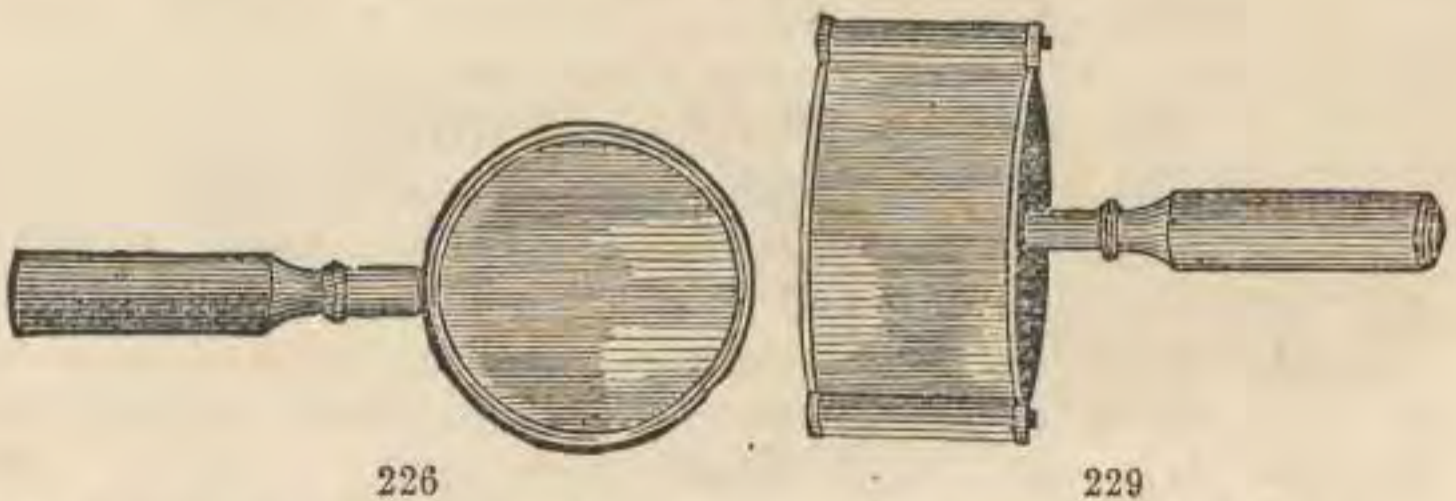

225. Reading Glass, hard rubber frame, double convex lens, $\frac{1}{2}$ -inch diameter, \$0.35; $1\frac{3}{8}$ -inch, \$0.85; 2-inch, \$1.50; $2\frac{1}{2}$ -inch, \$3; 3-inch.....	3 75
---	------

Figure No.	Price.
226. Reading Glass, oxidized metal frame, double convex lens, 2-inch, \$1; 2½-inch, \$1.50; 3-inch, \$2; 3½-inch, \$2.50; 4-inch, \$3.25; 4½-inch.....	\$5 00
227. Reading Glass, oxidized metal frame, two plano-convex lenses, 2½ inches diameter, \$2.25; 3-inch, \$3; 3½-inch, \$4.25; 4-in..	5 00
228. Reading Glass, gilt metal frame, ivory handle, one double convex lens, 2-inch, \$2.25; 2½-inch, \$2.75; 3-inch, \$3.75; 4-in., \$4.75; 4½-inch.....	6 50
229. Reading Glass, black metal frame, wood handle, double convex lens, 3 inches long by 1½ inches wide, \$1 50; 3¼x1¾ inches, \$2; 4x2 inches.....	2 50
230. Picture Glasses, rosewood frame and handle, double convex lens, 5 inches diameter, \$5; 6-inch.....	7 50

ACHROMATIC OPERA GLASSES.

Diameter of object-glasses given in lines 12 to 1 inch.

235. Six lens, metal body, japaned, black, 13 lines, \$5.25; 15 lines, \$5.75; 17 lines, \$7; 19 lines, \$8.50; 21 lines, \$9.50; 24 lines,	12 00
236. Six lens, metal body, covered with black imitation Turkey morocco, bars connecting the two bodies curved; 13 lines, \$8.25; 15 lines, \$10.50; 17 lines, \$11; 19 lines, \$12.75; 21 lines....	14 75
237. Twelve lens, metal body, covered with imitation Turkey morocco, superior quality; 13 lines, \$13; 15 lines, \$14; 17 lines, \$16.50; 19 lines, \$18; 21 lines.....	19 50
238. Twelve lens, metal body, covered with black Turkey morocco, superior quality; 13 lines, \$15; 15 lines, \$16.50; 17 lines, \$18.50; 19 lines, \$21; 21 lines.....	24 00

Also, a large variety mounted in pearl, enamel, and oxidized metal.

MARINE, OR FIELD GLASSES.

239. Six lens Achromatic Field Glass, metal body, covered with Turkey morocco, sun shade to extend over the object-glasses, and soft leather case, with strap.	
Body 3¾ inches long; object-glasses 15 lines in diameter.....	9 00
do 4¼ do do 17 do.....	10 50
do 4½ do do 19 do.....	11 25
do 4¾ do do 21 do.....	12 00
do 5¾ do do 24 do.....	14 00
do 6¼ do do 26 do.....	16 00


Figure No.	Price.
240. U. S. Army Signal Service six lens Achromatic Field Glass, metal body, covered with Turkey morocco, sun shade to extend over the object-glasses, and heavy leather case, with strap; very superior.	
Body, $5\frac{3}{8}$ inches long; object-glasses 21 lines in diameter.....	\$17 00
do $5\frac{7}{8}$ do do 24 do	20 00
do $6\frac{1}{4}$ do do 26 do	22 00

ACHROMATIC TELESCOPES.



251

241. Telescope, wood body, 3 draws, 15 inches drawn out, 6 inches shut, object-glass 1 inch in diameter, power 15 times \$3 50
242. Telescope, wood body, 3 draws, 16 inches drawn out, 6 inches shut, object-glass $1\frac{1}{8}$ inches in diameter, power 20 times..... 4 25
243. Telescope, wood body, 3 draws, 23 inches drawn out, 8 inches shut, object-glass $1\frac{3}{8}$ inches in diameter, power 25 times..... 7 00
244. Telescope, wood body, 3 draws, 30 inches drawn out, 10 inches shut, object-glass $1\frac{5}{8}$ inches in diameter, power 30 times 9 00
245. Telescope, wood body, 4 draws, 37 inches drawn out, 11 inches shut, object-glass $1\frac{7}{8}$ inches in diameter; superior glass; power 35 times 17 00
246. Telescope, wood body, 4 draws, 42 inches drawn out, $11\frac{1}{2}$ inches shut, object-glass $2\frac{1}{8}$ inches in diameter, power 40 times 30 00
247. Telescope, wood body, 4 draws, 48 inches drawn out, $13\frac{1}{2}$ inches shut, object-glass $2\frac{3}{8}$ inches in diameter, power 45 times 41 00
248. Telescope, wood body, 5 draws, 28 inches drawn out, $7\frac{3}{8}$ inches shut, object-glass $1\frac{5}{8}$ in. in diameter; about the same power as No. 245, but more portable; power 35 times..... 12 00
249. Telescope, wood body, 6 draws, 17 inches drawn out, $4\frac{3}{4}$ inches shut, object-glass $1\frac{1}{8}$ inches in diameter, power 20 times 8 00
250. Telescope, wood body, 6 draws, 16 inches drawn out, $4\frac{1}{4}$ inches shut, object-glass $\frac{7}{8}$ inch in diameter; very portable; power 15 times 7 00
251. Telescope, brass body, covered with cord or leather; shade to keep off the sun and rain; 1 draw, 36 inches drawn out, 20 in. shut, power 25 times..... 15 00
252. Same as above, but with 2 or 3 draws; 15 inches shut 15 00

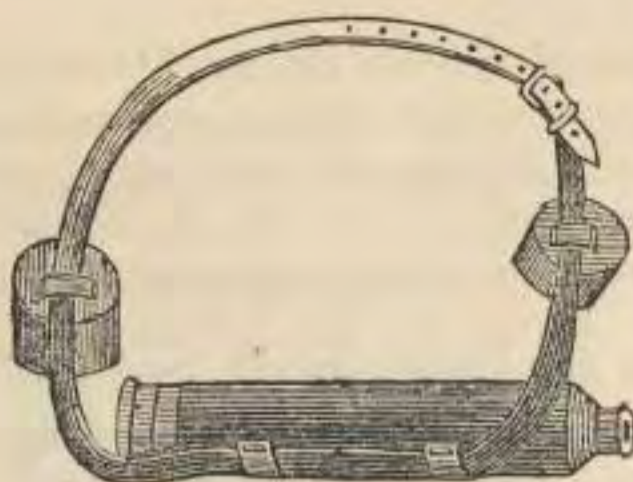

253

Figure No.	Price.
253. Tourist's Achromatic Spy-glass, with brass body, covered with Turkey morocco; 3 draws, 17 inches drawn out, 6 inches shut, object-glass $1\frac{1}{4}$ inches diameter; sun shade to slip beyond the object-glass; heavy leather caps to cover both the eye-glass and object-glass; strong leather strap to sling over the shoulder: power 20 times	\$12 00
254. Same as No. 253, but is 21 inches drawn out, 7 inches shut, object-glass $1\frac{5}{8}$ inches diameter; power 25 times	15 50
255. Same as No. 253, but is 24 inches drawn out, 9 inches shut, object-glass $1\frac{5}{8}$ inches diameter, power 30 times	21 00
256. Same as No. 253, but has 4 draws, and is 36 inches drawn out, 10 inches shut, object-glass $1\frac{7}{8}$ in. diameter, power 35 times..	30 00
257. Brass Clamp with gimlet screw, to fasten a Spy-glass to a post or tree.....	3 50

Drawing Paper, Colors, &c.

In filling orders for Instruments from different parts of the country, we have frequently been called upon to furnish, in addition, the various materials for the office work of the Surveyor and Engineer, as Drawing Paper, Colors, Text Books, &c. We have therefore supplied ourselves with an assortment of these goods, and shall hereafter be able to furnish them on as favorable terms as any other dealer in the Union.

WHATMAN'S TURKEY MILL DRAWING PAPERS.

Demy.....	20x15 inches	per quire	\$1 50
Medium	22x17 do	do	2 00
Royal	24x19 do	do	3 00
Super-Royal.....	27x19 do	do	3 50
Imperial.....	30x21 do	do	5 50
Elephant	28x22 do	do	5 50
Columbier	34x23 do	do	6 00
Atlas	33x26 do	do	6 00
Double Elephant.....	40x26 do	do	8 00
Antiquarian	52x31 do	do	35 00

DRAWING PAPER IN ROLLS.

ANY LENGTH.

White, Extra Thick, 40 inches wide, per yard.....	0 25
do do 54 do do	0 40
Buff Tint, Bleached Manilla, exceedingly strong and tough, for working plans, 45 inches wide, extra thick, per yard	0 15

DRAWING PAPER ON MUSLIN.

In Rolls 8 yards long and 40 inches wide, per yard.....	1 50
do 8 do do 54 do do	2 00

VELLUM, OR TRACING CLOTH.

SAGAR'S PATENT.

18 inches wide, in rolls of 24 yards, per yard, \$0.50; per piece	10 00
36 do do do do 1.00; do	20 00

FRENCH TRACING PAPER.

Fine quality, very clear and strong.

In Sheets.	Royal, 19 by 25 inches, per quire.....	\$2 00
do	Super-royal, 21 by 26 inches, per quire.....	2 50
do	Double Elephant, 28 by 40 inches, per quire.....	4 25
In Rolls	11 yards long and 43 inches wide, per yard, \$0.35; per roll,	2 00
do	22 do 43 do do 0.35; do	4 00

PROFILE PAPER.

Plate A, 42x15 in., horizontal ruling, 4, vertical, 20 to in., per sheet,	0 40
Plate B, 42x13 $\frac{1}{4}$ do 4, do 30 do do	0 40
Plate C, 42x15 do 5, do 25 do do	0 40

CROSS SECTION PAPERS.

Trautwine's Cross Section and Diagram, 10 feet to inch, for embankments of 14 and 24 feet, roadway, and for excavations of 18 and 28 feet, ruling 19 $\frac{3}{4}$ x12 inches, per sheet.....	0 25
Cross Section, ruling 22x16 inches, 8 feet to inch, per sheet.....	0 25
Cross Section, ruling 13 $\frac{1}{2}$ x16 inches, 10 feet to inch, do.....	0 25
Ruled and Section, 14x17 inches, 4 feet to inch, do.....	0 08

LYONS' TABLES.

A set of Tables for finding at a glance, the true cubical contents of Excavation and Embankments for all Bases, and for every variety of Ground and Side Slopes; by M. E. LYONS, C. E.

Sheet No 1. General Table for all Bases and all Slopes.

do	2.	For Side Hill Cuts and Fills.	
do	3.	Base 12 feet Slopes	1 $\frac{1}{2}$ to 1
do	4.	do 14 do	1 $\frac{1}{2}$ to 1
do	5.	do 15 do	$\frac{1}{4}$ to 1
do	6.	do 15 do	1 to 1
do	7.	do 15 do	1 $\frac{1}{2}$ to 1
do	8.	do 16 do	$\frac{1}{4}$ to 1
do	9.	do 16 do	1 to 1
do	10.	do 18 do	$\frac{1}{4}$ to 1
do	11.	do 18 do	$\frac{3}{4}$ to 1
do	12.	do 18 do	1 to 1
do	13.	do 18 do	1 $\frac{1}{2}$ to 1
do	14.	do 20 do	1 $\frac{1}{2}$ to 1
do	15.	do 24 do	$\frac{1}{4}$ to 1
do	16.	do 24 do	1 $\frac{1}{2}$ to 1
do	17.	do 25 do	1 $\frac{1}{2}$ to 1
do	18.	do 26 do	1 $\frac{1}{4}$ to 1

Sheet No. 19.	Base 28 feet	Slopes	$\frac{1}{4}$ to 1
do	20.	do 30	do 1 to 1
do	21.	do 30	do $1\frac{1}{4}$ to 1
do	22.	do 30	do $1\frac{1}{2}$ to 1
do	23.	do 32	do 1 to 1
do	24.	do 32	do $1\frac{1}{2}$ to 1

The Tables are printed in clear, bold type on tinted paper, sheets 25x16 inches. They may be used by candle-light without injuring the eye-sight. Each sheet is complete in itself, and embraces all that is wanted in connection with the Base or Slope designated, whether on level or side-hill cross section.

Per sheet, \$0.25; bound in one volume \$ 50

FIELD BOOKS.

Level Books, each	0 75
Transit Book, do	0 75
Record do	0 90

Lithographic or Steel Plate engraved, Letter Headings, Papers, Envelopes, Ink, Pens, and every description of office Stationery furnished to order, of the best quality.

PAPER PROTRACTOR—SHEETS AND BOARDS.

Whole Circle Protractors, 12 in. diam. $\frac{1}{2}$ degrees, thin paper, each,	0 30
do do do do Bristol boards do	0 40

INK SLABS, SAUCERS AND WATER COLORS.



INK SLABS

For India Ink and Colors; containing 3 holes or cups and 1 slanting division.

Measuring $2\frac{3}{4}$ by $1\frac{5}{8}$ inches, each	0 20
do 3 by 2 do	0 35
do 4 by $2\frac{5}{8}$ do	0 40

CABINET NESTS.

Porcelain Saucers in Nests; fitted on each other.

Containing 6 Saucers, $2\frac{1}{4}$ inches in diameter, per nest	1 00
do 6 do $2\frac{3}{4}$ do do	1 25

WINSOR & NEWTON'S WATER COLORS.

In Half and Whole Cakes.

Whole cakes, 35 cents; half cakes, 20 cents.

Antwerp Blue,	Gamboge,	Payne's Grey,
Bistre,	Hooker's Green, No. 1,	Prussian Blue,
Blue Black,	Hooker's Green, No. 2,	Prussian Green,
British Ink,	Indigo,	Raw Sienna,
Brown Ochre,	Indian Red,	Raw Umber,
Brown Pink,	Italian Pink,	Red Lead,
Burnt Roman Ochre,	Ivory Black,	Roman Ochre,
Burnt Sienna,	King's Yellow,	Sap Green,
Burnt Umber,	Lamp Black,	Terre Verte,
Chrome Yellow,	Light Red,	Vandyke Brown,
Deep Chrome,	Naples Yellow,	Venetian Red,
Dragon's Blood,	Neutral Tint,	Vermilion,
Emerald Green,	Olive Green,	Yellow Lake,
Flake White,	Orange Chrome,	Yellow Ochre.

Whole Cakes, 75 cents; half cakes, 40 cents.

Brown Madder,	Mars Yellow,	Scarlet Lake,
Chinese White,	Neutral Orange,	Scarlet Vermillion,
Constant White,	Purple Lake,	Sepia,
Crimson Lake,	Roman Sepia,	Warm Sepia.
Indian Yellow,	Ruben's Madder,	

Whole cakes, 90 cents; half cakes, 50 cents.

Cobalt Blue,	Orange Vermillion,	Violet Carmine.
--------------	--------------------	-----------------

Whole cakes, \$1.50; half cakes, 75 cents.

Anreolin,	Green Oxide of Chrome,	Pink Madder,
French Blue,	Intense Blue,	Rose Madder.
	Lemon Yellow,	

Whole cakes, \$2.25; half cakes, \$1.15.

Burnt Carmine,	Gallstone,	Purple Madder,
Cadmium Yellow,	Pure Scarlet,	Smalt,
Cadmium Orange,	Madder Carmine,	Ultramarine Ash.
Carmine	Mars Orange,	

OSBORNE'S WATER COLORS.

Mahogany and Rosewood Chests, with Lock, Drawer, Paint Stone, Water Glass, India Ink, Brushes, and 12 colors..	\$10 00
Mahogany, etc. do do do	18 do 11 50
Mahogany, etc. do do do	24 do 14 00
Mahogany, etc. do do do	24 half cakes, 10 10

INDIA INK.

India Rubber, best quality, each	6 to 50 cents.
India Ink, best quality, 20c, 25c, 35c, 50c, 75c and	\$1 00
Mouth Glue, slips	4 cents.

MAPPING AND CROW-QUILL PENS.

Gillott's, on cards.....	per dozen.....	\$0 85
Gillott's Lithographic Crow-Quill, on cards.....	do.....	0 85
Gillott's Mapping.....	do.....	0 60

LEAD PENCILS.

A. W. FABER'S POLYGRADES (GENUINE).

Hexagon Gilt, Nos. 1 2, 3, 4 and 5.....	per dozen.....	1 25
Black or Red Gilt, round, 1. 2, 3, 4.....	do.....	1 00
Black or Yellow Gilt, 1, 2, 3, 4, small.....	do.....	0 75
One box, containing 7 Pencils, for Engineers, sliding ends to box...		0 75
do 5 Pencils, BB to H.....		0 75
do 7 Pencils, BBB to HH.....		0 90
do 10 Pencils, BBBB to HHHH.....		1 25

LIST OF BOOKS

ON

Civil Engineering, Surveying, &c.

[When any of the following works are ordered to be sent by mail, the postage, which must be prepaid, will be added to the price of the work. Should any other works on kindred topics be desired, we will furnish them at publishers' prices.]

ARCHITECTURE.

	Price.	Postage.
ARMENGAUD, Amoureux and Johnson, Book of Industrial Design	\$10 00	\$0 72
BULLOCK'S Rudiments of Architecture and Building.....	3 50	0 44
CLEVELAND, American Villas and Cottages.....	4 00	0 32
CUMMINGS and MILLER'S Architecture, with 382 designs and 714 illustrations, a new and practical work.....	10 00	0 52
CUMMINGS and MILLER'S Modern American Architecture, containing designs and plans for Villas, Farm-houses, School-houses, Cottages, City Residences, Churches, &c.....	10 00	0 52
DOWNING'S Cottage Residences	3 00	0 32
do Country Houses.....	8 00	0 64
do Landscape Gardening	6 50	0 68
HATFIELD'S American House Carpenter	3 50	0 40
HOLLEY'S Country Seats, Villas, Railway Stations, &c.....	6 00	0 48
LOUDON'S Cyclopaedia of Architecture	21 00	0 88
ROBINSON and TREDGOLD, Carpentry and Joinery.....	3 00	0 40
SLOAN'S Homestead Architecture, } do City and Suburban do }	4 50	0 36
VAUX'S Villas and Cottages	3 00	0 30
WOODWARD'S Country Homes.....	1 50	0 16

DRAWING.

APPLETON'S Cyclopaedia of Drawing, cloth	10 00	0 72
BECKER'S Letter Book for Draughtsmen	4 00	0 16
MAHAN'S Industrial Drawing.....	2 50	0 24
MINIFIES' Mechanical Drawing	4 00	0 36
do Geometrical Drawing, abridged	1 50	0 12
SMITH'S Topographical Drawing	2 00	0 16
WARREN'S Manual of Projections.....	1 50	0 12
do Linear Perspective.....	1 00	0 08
do Plane Problems.....	1 25	0 12
do Descriptive Geometry	3 50	0 48

LIST OF BOOKS.

CONSTRUCTIONS.

	Price.	Postage.
BAKER'S Engineering and Earthworks	\$2 50	\$0 12
BLAND'S Arches, Piers and Buttresses.....	0 75	0 12
BURGOYNE'S Road-making and Macadamized Roads.....	0 75	0 12
COLE'S Contractor's Book, containing working drawings for Canal and Railroad Constructions	10 00	0 60
DOBSON'S Foundations and Concrete Works	0 50	0 08
do Masonry and Stone Cutting.....	1 00	0 08
do Art of Building.....	0 50	0 08
EASTON'S Horse Railways, their Location, Construction and Management	2 00	0 16
GILLESPIE'S Roads and Railroads	2 00	0 20
GILLMORE'S Limes, Cements and Mortars.....	4 00	0 40
JERVIS' Railway Construction and Management	2 00	0 24
LAW and BURNELL'S Limes, Cements and Mortars	0 75	0 08
MAHAN'S Civil Engineering. A Treatise on Structures and Materials	4 00	0 44

SURVEYING AND ENGINEERING.

BAKER'S Land and Engineering Surveying	1 00	0 08
GILLESPIE'S Land Surveying. The best and latest work published	4 00	0 36
GUMMER'S Surveying.....	2 50	0 28
LAW and BURNELL'S Engineering	2 25	0 16
MENDELL'S Military Surveying and Instruments, illustr'd,	2 00	0 12
RANKINE'S Manual of Civil Engineering	8 00	0 36
ROBINSON'S Surveying and Navigation.....	2 50	0 24
SIMMS' Principles and Practice of Leveling	4 25	0 16

TREATISES ON INSTRUMENTS.

DICK, The Telescope and Microscope.....	0 50	0 08
GURLEY'S Manual, illustrated.. ..	0 50	
HEATHER'S Treatise on Mathematical Instruments	0 60	0 08
HOGG, The Microscope, History Construction and Application	2 50	0 28
KENTISH Box of Instruments and Slide Rule, or Guide to Gauger, Seaman and Student	1 25	0 16
SIMMS' Mathematical Instruments	3 00	0 24
WARREN'S Draughtsman's Instruments.....	1 25	0 12

HYDRAULIC ENGINEERING.

DEMPSEY, Draining Districts and Lands.....	1 50	0 12
do Drainage and Sewerage of Towns and Buildings,	1 00	0 12
EVANS' Young Millwright's and Miller's Guide	2 50	0 24
FENWICK'S Subterraneous Surveying	1 25	0 12
FRENCH'S Principles, Process and Effects of Draining Lands	1 50	0 20
GLYNN'S Water Power as applied to Mills	1 00	0 12
HEWSON'S Embanking, Rivers, Levels, &c.....	2 00	0 28
HUGHES' Waterworks for Cities and Towns	1 50	0 16
LAW and BURNELL'S Hydraulic Engineering	1 75	0 16
PALLETTE, The Miller, Millwright and Engineer's Guide..	3 00	0 24
STEVENSON'S Canal and River Engineering.....	3 00	0 12
TEMPLETON'S Young Millwright's and Miller's Guide.....	2 00	0 12

LIST OF BOOKS.

BRIDGES.

	Price.	Postage.
CULLUM'S System of Military Bridging	\$3 50	\$0 30
HAUPT'S Bridge Construction.....	4 00	0 24
do Military Bridges	8 50	0 44
HUMBER'S Cast and Wrought-iron Bridges and Girders.....	18 00	1 24
do Cast and Wrought-iron Bridges, 2 vols.....	68 25	2 72
ROBINSON, TREGOLD and PRICE'S Roofs for Public and Private Buildings.....	3 00	0 32

POCKET-BOOKS, TABLES, &c.

BYRNE'S Pocket-Book for Railroad and Civil Engineers	1 25	0 08
BURT'S Key for Solar Compass.....	2 75	0 08
CROSS' Engineer's Field Book.....	1 50	0 08
GRISWOLD'S Pocket Companion for the Field	1 25	0 04
HASLETT'S Engineer's and Mechanic's Pocket-Book	2 50	0 12
HASWELL'S Engineer's and Mechanic's Pocket-Book	3 00	0 12
HENCK'S Field Book for Civil Engineer.....	3 00	0 08
MOLESWORTH'S Pocket-Book of Formula for Engineers ...	2 00	0 08
NYSTROM'S Pocket-Book of Mechanics and Engineering....	2 50	0 08
SCRIBNER'S Pocket Table Book	2 00	0 08
do Engineer's and Mechanic's Companion.....	2 00	0 08
TEMPLETON'S Millwright's and Engineer's Companion.....	2 50	0 08
TRAUTWINE'S Excavations and Embankments	2 00	0 08
do Railroad Curves	2 00	0 08
WARNER'S Theorems, Tables and Diagrams for the Compu- tation of Earthworks	6 25	0 44

MISCELLANEOUS.

APPLETON'S Dictionary of Mechanics, 2 vols	20 00	1 44
Fairbairn Iron, its History, Properties and Processes of Man- ufacture	3 50	0 40
GREGORY'S Mathematics for Practical Men	2 25	0 40
do Nautical Almanac, with Ephemeris.....	0 75	0 24
NICHOLSON'S Operative Mechanic and Machinist	15 75	
OVERMAN'S Mechanics, for the Millwright, Machinist, Civil Engineer and Architect.....	2 00	0 20
OVERMAN'S Metallurgy		0 36
URES' Dictionary of Arts, Manufactures and Mines, 3 vols., cloth	47 25	0 36

Table of Contents.

	PAGE.
Adjustments of Compass.....	16
do Vernier Transit.....	38-42
do Surveyors' Transit.....	60-62
do Solar Compass.....	76-79
do Leveling Instrument.....	112-113
Adjusting Socket.....	80
Ball, Compound Tangent.....	44
Builders' Level.....	120
Chains, Surveyors'.....	128
Chains, Engineers'.....	129
Chains, steel.....	126-129
Compass, plain.....	14
do Vernier.....	23
do Railroad.....	52
do Solar.....	64
do Miners'.....	123
do Pocket.....	124
Cross wire ring.....	30
Clamp and tangent.....	36
Drawing Instruments.....	132-148
Drawing papers, pencils, colors, &c.....	160-162
Eye-piece, how composed.....	29
Excellencies of the Vernier Transit.....	47
Farm Level.....	120
General matters.....	126
Jacob-staff socket.....	18
Leveling Instrument.....	107
Leveling Rods.....	121
Lacquering.....	127

TABLE OF CONTENTS.

	PAGE
Marking pins.....	130
Masons' Level.....	120
Micrometer.....	85
Needle Instruments.....	50
Object-glass, how composed.....	29
Parallax instrumental.....	45
Pinion to eye glass.....	101
Repairs of Compass.....	19
Solar Compass.....	64
Solar Compass, <i>proper</i>	92
Solar Telescope Compass.....	94
Tangent scale on sights.....	15
Transit, Vernier.....	28
Transit, Surveyors'.....	57
Transit, Engineers'.....	101
Tripod head, light.....	58
Tripod head, heavy.....	103
Tripod legs, different sizes of.....	126
Theodolite axis.....	106
Tapes, measuring.....	131
Vertical circle.....	36
Vernier Compass.....	23
Vernier transit.....	28
Watch telescope.....	105
Weight of Compasses, plain.....	22
do Vernier.....	27
do Railroad.....	55
do Vernier Transit.....	49
do Surveyors' Transit.....	62
do Solar Compasses.....	99
do Leveling Instrument.....	119

THE RENSSELAER POLYTECHNIC INSTITUTE.

FOUNDED IN 1824.

THIS well known School of the NATURAL SCIENCES and of CIVIL ENGINEERING has just opened for the years 1867-68, with very fine promise.

THE PROFESSORSHIPS are well filled, and the incumbents of the different chairs have entered upon the duties of their departments with much zeal, and under very favorable auspices. The several Divisions are filling up, and the Preparatory Department embraces a respectable number of Students.

Young gentlemen in various parts of the United States and the Canadas, who contemplate taking a thorough course in the NATURAL SCIENCES, and in the Higher Mathematics—and especially with a view to MINING OR CIVIL ENGINEERING, would do well to apply for the New Register of 1867, that they may know more of the character and terms of the Institute, and have the CURRICULUM before them.

Application may be made to CHARLES DROWNE, C. E., *Director*; WILLIAM H. YOUNG, *Treasurer*, or the subscriber of this notice.

JOHN F. WINSLOW,
President of R. P. Institute.

TROY, Jan'y, 1868,

SCIENTIFIC BOOKS

FOR

ENGINEERS, INVENTORS, DRAUGHTSMEN, ETC.,

And for High Schools, Scientific Schools, etc.

W. & L. E. GURLEY,

WILL SUPPLY THE FOLLOWING WORKS ON THE THEORY AND PRACTICE
OF GEOMETRICAL DRAWING.

Published by JOHN WILEY, 56 Walker Street, New York.

ELEMENTARY PLANE PROBLEMS. (*In Preparation.*)—

DRAFTING INSTRUMENTS AND OPERATIONS. Div. I.—*Instruments and Materials.* Div. II.—*Instrumental Operations.* Div. III.—*Constructions in two Dimensions.* Div. IV.—*Elementary Æsthetics of Geometrical Drawing.* Price, \$1.25.

MANUAL OF PROJECTIONS, ETC. Div. I.—*Elementary Projections.* Div. II.—*Details in Masonry, Wood and Metals.* Div. III.—*Elementary Shades and Shadows.* Div. IV.—*Isometrical Drawing.* Div. V.—*Simple Structure Drawing.* Price, \$1.50.

ELEMENTARY LINEAR PERSPECTIVE. Part I.—*Primitive Methods.* Part II.—*Derivative Methods.* Price, \$1.00.

**GENERAL PROBLEMS OF DESCRIPTIVE GEOMETRY,
PRICE, - - - - - \$3.50.**

By S. EDWARD WARREN, C. E.,

Professor of Descriptive Geometry and Geometrical Drawing in the Rensselaer Polytechnic Institute, Troy, N. Y.

The above published works are all fully illustrated with cuts and plates. They are used in several of the Scientific or Polytechnic Schools of the country, and have received warm commendation in various quarters. The volumes of the Elementary Course are especially adapted for the upper classes in High Schools and Academies, and for the Scientific Undergraduate Courses in Colleges, as well as for the lower classes in the Polytechnic Schools, and for the self-instruction of Artizans, etc. Vol. 6 is also especially adapted for Ladies' Seminaries and Schools of Design, in which the principles of perspective are taught.

ADVERTISEMENT.

443 AND 445 BROADWAY, NEW YORK.

D. APPLETON AND COMPANY

HAVE RECENTLY PUBLISHED

A Treatise on Land Surveying: THEORETICAL AND PRACTICAL.

By W. M. GILLESPIE, LL. D.,

Professor of Civil Engineering, Union College; Author of "Manual of Roads and Railways," &c.

1 Vol. 8vo.—124 Pages.—\$4.00.

WITH FOUR HUNDRED ENGRAVINGS, AND A MAP SHOWING THE VARIATION OF THE NEEDLE IN THE UNITED STATES.

Among the leading peculiarities of the work are these :

1. ALL the operations of surveying are developed from only *five simple principles*.
2. A complete system of surveying with only a chain, a rope, or any substitute, is fully explained.
3. Means of measuring inaccessible distances, in all possible cases, with the chain alone, are given in great variety, so as to constitute a *Land Geometry*. It occupies 26 pages, with 58 figures.
4. The Rectangular method of Compass-surveying is greatly simplified.
5. The Traverse Table gives increased accuracy, in one-fifteenth of the space of the usual tables.
6. The effect of the changes in the variation of the needle, on the resurvey of old lines, is minutely illustrated.
7. *Correct* tables of the times of elongation of the North Star are given; those in common use being in some cases nearly half an hour out of the way.
8. The adjustment of the engineer's Transit and Theodolite are here, for the first time, fully developed.
9. Methods of avoiding obstacles in angular surveying occupy 24 pages, with 35 figures.
10. Topographical Mapping is fully described, with illustrations.
11. Laying out, Parting off, and dividing up Land, are very fully explained, and illustrated by 50 figures.
12. The most recent improvements in the method of surveying the Public Lands of the United States, with the methods used for marking "corners," are minutely described from official authorities.

A double object has been kept in view in the preparation of the volume, viz: to make an introductory treatise easy to be mastered by the young scholar or the practical man of little previous acquirement, the only pre-requisites being Arithmetic and a little Geometry; and, at the same time, to make the instruction of such a character as to lay a foundation broad enough and deep enough

ADVERTISEMENT.

for the most complete superstructure which the professional student may subsequently wish to raise upon it.

The volume is divided as follows :

PART I. General Principles and Fundamental Operations. II. Chain Surveying. III. Compass Surveying. IV. Transit and Theodolite Surveying. V. Trigonometrical Surveying. VI. Trilinear Surveying. VII. Obstacles in Angular Surveying. VIII. Plain Table Surveying. IX. Surveying without Instruments. X. Mapping. XI. Laying out, Parting off, and Dividing up Lands. XII. United States Public Lands.

APPENDIX.—A. Synopsis of Plain Trigonometry. B. Demonstrations of Problems. C. Leveling.

TABLES.—Chords for Platting. Latitudes and Departures. Natural Sines and Cosines.

EXTRACTS FROM LETTERS.

From Prof. CHAS. W. HACKLEY, Columbia College, New York :

“Prof. Gillespie’s work is the most complete one in our language on the branches of surveying of which it treats.”

From Prof. D. H. MAHON, West Point Academy :

“I have received Prof. Gillespie’s work on Surveying, which you have had the kindness to send me. In this treatise, Prof. Gillespie has given another evidence of his practical acquaintance with the wants of the teacher and pupil in his specialty, and of his ability to meet them. His work, which presents several new features in its plan, is written with such plainness, and illustrated with such copiousness of diagram and detail, as cannot fail to render the subject of easy attainment to the most ordinary comprehension.”

From Prof. E. S. SNELL, Amherst College :

“Please accept my thanks for the copy lately received of Prof. Gillespie’s Surveying. I very much admire its systematic character, its completeness and fullness, and its adaptedness in all respects to the wants of the teacher, the pupil, and the practical Surveyor. I have seen no work which can at all be brought into comparison with it.”

From Prof. AUG. W. SMITH, Wesleyan University :

“On examination, I find it the most full and complete of any work on Practical Surveying with which I am acquainted. It furnishes information, minute and specific, on all points which are likely to occur in practice. . . . I know of no better work, or one better adapted to the wants of those who have not the aid of the living teacher.”

From J. W. ANDREWS, President of Marietta College, Ohio.

“From my knowledge of the author, I was prepared to expect a work of decided excellence, and certainly I have not been disappointed. . . . I shall take great pleasure in recommending it to all who wish a full knowledge of surveying.”

From A. C. ROE, Principal of Cornwall Collegiate School :

“I thank the author for the time and labor it has saved me, and express the great satisfaction with which I have used it. Valuable in its plan and the happy manner in which the principles of the science are unfolded, it is still more so in those practical hints which I have seen in no other work, and which, though of the greatest importance even to a beginner, I learned myself only after a long time, and very considerable experience.”

THE GREAT BOOKS OF THE DAY.

QUACKENBOS'S ARITHMETICS.

- A Primary Arithmetic.** Beautifully illustrated; carries the beginner through the first four Rules and the simple Tables, combining mental exercises with examples for the slate. 16mo. 108 pages. 40 cents.
- An Elementary Arithmetic.** Reviews the subjects of the Primary in a style adapted to somewhat maturer minds. Also embraces Fractions, Federal Money, Reduction, and the Compound Rules. 12mo. 144 pages. 60 cents.
- A Practical Arithmetic.** Prepared expressly for Common Schools, giving special prominence to the branches of Mercantile Arithmetic. 12mo. 336 pages. \$1.
- A Higher Arithmetic.** In preparation.
- A Mental Arithmetic.** Nearly ready.

Clear; thorough; comprehensive; logically arranged; well graded; supplied with a great variety of examples; brief and exact in their rules; condensed and searching in their analyses; teach the methods actually used by business-men; up to the times; oblige the pupil to think in spite of himself; anticipate nothing; make the solution of a question an intelligent and not a mechanical process; the only books that a progressive teacher can afford to use; *perfect* text-books; WITH NO DEFECTS. This is what teachers say of our new Series of Arithmetics (read their opinions on the opposite page). These are the features that are introducing them into schools everywhere.

Look, in particular, at the Practical. Its definitions, rules and analyses are free from unnecessary words; its methods are the shortest possible; its mode of developing the subject is pronounced unequalled. Above all, *it is the only book that recognizes all the important financial changes of the last five years.* The prices given in the examples are those of the present day; the difference between gold and currency is taught; the rate of duties agrees with the present tariff; the mode of computing the national income tax is explained; the different classes of U. S. securities are described, and examples given to show the comparative results of investments in them. These are matters that every one should understand, and *no Arithmetic that ignores them should be allowed to remain in the hands of our youth.*

Quackenbos's Arithmetics are used, to the exclusion of all others, in the Public Schools of Brooklyn and Jersey City. New York has adopted the whole series for its Common Schools. Our best Normal Schools and private institutions are introducing them. After examining them, teachers are unwilling to use any others.

QUACKENBOS'S ARITHMETICS.

"PERFECT TEXT-BOOKS,"

"WITH NO DEFECTS."

SO SAY SOME OF OUR BEST TEACHERS.
READ THEIR OPINIONS.

John C. Harkness, Principal of the Delaware State Normal School: "We have carefully examined the Practical Arithmetics before the American people, and to-day feel that said people owe a debt of gratitude to Mr. Quackenbos for *having perfected* a text-book in that department of education."

E. D. Kingsley, Superintendent Public Schools, Columbus, O.: "I have looked in vain, for the last ten years, for such a work. I regard it (the Primary) as *the most desirable treatise of the kind that has ever been published.*"

John C. Ridpath, Superintendent of Schools, Lawrenceburgh, Ind.: "I have examined the Arithmetics, and in some particulars think them superior to any yet published. Especially do I regard the Primary as **THE BEST** which I have seen. The illustrations cannot be surpassed: as a manual for the object method, it is just the thing."

David Copeland, President Hillsboro (Ohio) Female College: "I consider Quackenbos's Practical Arithmetic *superior to any similar work published in this country.* The subjects are all treated in a superior manner."

Walter Smart, Principal Class, Academy, Alleghany, Pa.: "I consider Quackenbos's Practical *the best Arithmetic I have ever had in my hands.*"

Geo. W. Todd, Principal High School, Edgartown, Mass.: "With a class of thirty now in your Practical Arithmetic, I cheerfully say *I never saw its equal* for the place it is designed to fill."

Chester Holcombe, Prin. Public School No. 11, Brooklyn, N. Y.: "They have been in use among the twelve hundred scholars of whom I am in charge, for the past three months, and thus I have had ample opportunity to judge of their merits. I am confident *there is no other series of text-books on that subject of an equal degree of excellence.* In the Primary I have found *an unequalled manual* for object teaching."

Henry H. Fay, Principal of English and Class. School, Newport, R. I.: "It is about six months since I introduced Quackenbos's Practical Arithmetic into my school, and *I do not hesitate to pronounce it the best I have ever used.*"

Sister M. Alfred, Superioress St. Francis School, Joliet, Ill.: "We have critically examined Quackenbos's Primary and Elementary Arithmetics, and pronounce them *the most excellent works of the kind.* We are now using them with entire satisfaction to both ourselves and our pupils. No other books than Quackenbos's shall henceforth be used in our schools."

We mail specimen copies of these standard books to any teacher or school officer on receipt of one-half the above prices. A careful examination is all we ask. Why use inferior books, when the best are within reach? The most favorable terms made for introduction. Address

D. APPLETON & Co., Publishers,
443 & 445 Broadway, New York.

